

Report on Geotechnical Investigation

Taronga Wildlife Hospital, Sydney
- Nutrition Centre

Prepared for Taronga Conservation Society Australia

> Project 99931.00 December 2021



Integrated Practical Solutions



Document History

Document details

Project No.	99931.00	Document No.	R.001.Rev1A					
Document title	Report on Geotec	hnical Investigation						
	Taronga Wildlife H	Taronga Wildlife Hospital, Sydney – Nutrition Centre						
Site address	Taronga Zoo, Bradleys Head Rd, Mosman, NSW, 2088							
Report prepared for	Taronga Conservation Society Australia							
File name	99931.00.R.001.Rev1A							

Document status and review

Status	Prepared by	Reviewed by	Date issued
Revision 0	Sam Balian	Peter Oitmaa	18 February 2021
Revision 1	Sam Balian	Peter Oitmaa	01 October 2021
Revision 1A	Sam Balian	Peter Oitmaa	08 December 2021

Distribution of copies

Status	Electronic	Paper	Issued to
Revision 0	1	-	Paul De Alwis, Taronga Conservation Society Australia
Revision 1	1	-	Paul De Alwis, Taronga Conservation Society Australia
Revision 1A	1	-	Kristine Marshall, Taronga Conservation Society Australia

The undersigned, on behalf of Douglas Partners Pty Ltd, confirm that this document and all attached drawings, logs and test results have been checked and reviewed for errors, omissions and inaccuracies.

Signature	Date
Author Republic for Sam Balian	08 December 2021
Reviewer 44	08 December 2021





Table of Contents

			Page
1.	Intro	duction	1
2.	Site	Description	1
3.	Geol	logy and Hydrogeology	2
4.	Field	d Work Methods	2
5.	Field	d Work Results	3
6.	Labo	pratory Testing	4
7.	Geo	technical Model	4
8.	Prop	posed Development	5
9.	Com	nments	5
	9.1	Excavation	5
	9.2	Excavation Support	5
	9.3	Site Preparation	6
	9.4	Groundwater	7
	9.5	Foundations	7
	9.6	Soil Aggressivity	7
10.	Limit	tations	8

Appendix A: About This Report

Appendix B: Drawings

Appendix C: Results of Field Work

Appendix D: Photographs of Existing Shotcrete to the West of the Main Guard House

Appendix E: Laboratory Test Results



Report on Geotechnical Investigation Taronga Wildlife Hospital, Sydney - Nutrition Centre Taronga Zoo

1. Introduction

This report presents the results of a geotechnical investigation undertaken for the proposed Nutrition Centre Project at Taronga Zoo. The work was commissioned by the Taronga Conservation Society Australia and was undertaken in accordance with Douglas Partners' proposal SYD201344.002.Rev1 dated 8 December 2020.

It is understood that a new Nutrition Centre facility is proposed in the back-of-house area and Reptile (serpentarium) exhibit near the main security gatehouse at the north-west corner of the zoo. The development will involve the demolition of various structures, some earthworks, and construction of a 2 storey Nutrition Centre with a basement plant room, pedestrian linkage and roof plant room.

Geotechnical investigation was undertaken to provide information on subsurface conditions on the site and included the drilling of ten cored boreholes, three dynamic cone penetration tests (DCPs), inspection of the existing shotcrete and rock faces to the west of the gatehouse and access road, as well as laboratory testing and engineering analysis. Details of the field work and comments relating to design and construction are provided in this report.

Douglas Partners (DP) also undertook a preliminary site investigation for contamination assessment purposes, the results of which are outlined in the *Report on Preliminary Site Investigation (Contamination)* for Project 99931.00 dated December 2021.

2. Site Description

The development covers the area from the base of the slope to the west of the main security entrance, south about 150 m towards the chimpanzee enclosure and Reptile (serprentaria) exhibit. There are several brick buildings and framed storage sheds within the proposed development area.

The site has been terraced and there are several cuttings and retaining walls which support structures and walking paths/roadways. Sandstone outcrops and cuttings are evident in the area of the works. Ground surface levels nearby the area range from about RL 62 m to RL 73 m AHD. The higher levels were encountered at the crest of the slope near the main security entrance.

The portion of the site proposed for redevelopment is shown on Drawing 1 in Appendix B.



3. Geology and Hydrogeology

The Sydney 1:100 000 Geological Series Sheet shows that the site is underlain by Hawkesbury Sandstone which typically comprises medium to coarse-grained quartz sandstone with minor shale and laminite lenses. An extract from the geological map is shown in Figure 1.



Figure 1: Extract from geological map

The groundwater table is likely to be well below the bedrock surface. Near-surface Hawkesbury Sandstone generally exhibits low permeabilities which result in very low groundwater yields. Groundwater use from this aquifer is therefore unlikely to be significant.

Groundwater is likely to follow the surface topography and flow to the south.

4. Field Work Methods

Ten cored boreholes (WH1 to WH9 and PF1) were drilled to depths of between 5.5 m and 12.0 m using a Hanjin D8 drilling rig. The boreholes were commenced using solid flight augers to drill through the soil to the top of rock. Soon after rock was encountered, the bores were advanced using NMLC-sized diamond core drilling equipment to obtain 50 mm diameter continuous samples of the rock for identification and strength testing purposes.



Three dynamic cone penetration tests (DCPs) were carried out to refusal at depths of between 0.5 m and 1.45 m in areas that were inaccessible to the drilling equipment.

Coordinates and levels for all test locations apart from WH4, WH10 and PF1 were determined using a differential GPS (dGPS) receiver. Due to heavy vegetation and interference from buildings the dGPS could not be used for WH4, WH10 and PF1 so levels at these test locations were estimated from the Details and Levels Plan (By: Hammond Smeallie & Co Pty Ltd, DWG No: TZ Master Survey with Infrastructure_MGA, Revision B, Dated 8/8/2017) provided by Taronga Conservation Society Australia. The test locations are shown on Drawing 1 in Appendix B.

5. Field Work Results

The subsurface conditions encountered in the boreholes are presented in the borehole logs in Appendix C. Notes defining descriptive terms and classification methods are included in Appendix A. The boreholes encountered:

- FILL typically asphalt, gravelly or clayey sand, and roadbase to depths of between 0.34 m to 1.23 m in all boreholes apart from WH2 and WH4 which encountered fill to depths of approximately 3.1 m. This deeper fill included the above material plus concrete, timber and asbestos containing fibre cement at depth in WH2; overlying
- **SANDSTONE BEDROCK** sandstone bedrock from depths of between 0.1 m and 3.6 m to the base of the bores at 5.5 m to 12.0 m depth. The rock was generally medium and high strength.

Natural soils were not encountered in the boreholes.

Table 1 summarises the levels at which the different materials were encountered in the current boreholes.

Table 1: Summary of Material Strata Levels

Stratum	RL of Top of Stratum (m, AHD)										
Stratum	WH1	WH2	WH3	WH4	WH5	WH6	WH7	WH8	WH9	PF1	
Ground Surface / Top of Fill	64.7	73.2	67.0	73.0	61.2	65.0	67.9	71.6	62.4	62.1	
Typically Medium / High Strength Sandstone*	62.6	71.1	64.9	70.9	59.1	62.9	65.8	69.5	60.3	60.0	
Base of Borehole	60.5	69.0	62.8	68.8	57.0	60.8	63.7	67.4	58.2	57.9	

Groundwater was not observed whilst augering in any of the boreholes. The use of water as a drilling fluid during NMLC diamond coring of the bedrock precluded further observation of the groundwater levels below the bedrock surface during the field work.



Three DCPs were carried out nearby to the Reptile (serprentaria) exhibit. Assuming the DCPs refused on rock, these would indicate that the depth to rock in that area is about 0.5 to 1.5 m. This will require confirmation during construction.

Whilst undertaking the field work, mapping of outcropping rock and areas of obvious fill was completed. Observable rock outcrops are shown in Drawing 1 in Appendix B. Areas of deeper fill were encountered in boreholes WH2 and WH4; it is likely deeper fill may be encountered where filling has been required to achieve current site levels, for example at the top of cuttings and batters and in any natural gullies that may have previously run through the site.

An inspection of the existing shotcrete and rockface to the west of the gatehouse was also undertaken. No obvious deflects in the shotcrete were observed. Photographs of the shotcrete are presented in Appendix D.

6. Laboratory Testing

Ninety-two (92) samples selected from the rock core were tested for axial point load strength index (Is_{50}). The results ranged between 0.2 MPa and 2 MPa which correspond to low strength and high strength rock, respectively. These Is_{50} values suggest unconfined compressive strength (UCS) values in excess of 40 MPa for the samples of high strength rock tested.

Two soil samples were tested in a NATA accredited laboratory for measurement of electrical conductivity, pH, and chloride and sulphate ion concentrations in order to assess the aggressivity of the site soils to buried concrete and steel. Two additional tests were undertaken for pH as part of the testing for the PSI. The laboratory results are included in Appendix E, with the results summarised in Table 2.

Table 2: Aggressivity Testing of Soil Samples

Borehole	Depth (m)	Strata Description	nH		CI (mg/kg)	SO₄ (mg/kg)
WH4	2.4 – 2.5	Fill	5.0	-	-	-
WH6	0.9 – 1.0	Fill	7.6	120	<10	10
WH7	1.4 – 1.5	Fill	9.0	-	-	-
WH8	1.45 – 1.55	Fill	8.5	48	<10	57

Notes: CI = Chloride ion concentration, SO4 = Sulphate ion concentration.

7. Geotechnical Model

The site appears to be underlain by varying depths of fill overlying sandstone bedrock. The bedrock was generally medium strength or high strength. The groundwater table is likely to be well below the bedrock surface.

A geotechnical cross-section is provided in Drawing 2 in Appendix B.



8. Proposed Development

It is understood that the project involves the redevelopment of the back-of-house area near the security gatehouse towards the north-west corner of the zoo. This will involve the demolition of various structures, some earthworks, and the construction of a 2 storey Nutrition Centre with a basement plant room, pedestrian linkage and roof plant room. The plant room at Level 1 has a proposed floor level at RL 62.7 m. Excavation to depths of about 5 m below current surface levels would be required to achieve the proposed floor level. A bulk excavation level was not known for the pedestrian linkage at the time of preparing this report.

The geotechnical issues that may be relevant to the proposed development include excavation, excavation support, site preparation, groundwater, and foundations.

9. Comments

9.1 Excavation

Excavation for the proposed development may be required within fill and sandstone bedrock of medium to high strength, noting that some weaker and stronger bands may be present. Excavation in the fill and any soil or very low and low strength sandstone encountered should be readily achievable using a hydraulic excavator with bucket attachment. Excavation in medium and high strength sandstone will require ripping, hammering and/or sawing. Rock strengths in excess of 40 MPa (UCS) were encountered in the boreholes and stronger bands are also present.

It should be noted that any off-site disposal of spoil will generally require assessment for re-use or classification in accordance with current *Waste Classification Guidelines* (NSW EPA, 2014).

9.2 Excavation Support

Excavations in fill and any soil or very low and low strength rock if encountered, will not be able to stand vertically for extended periods of time but may be able to be supported by temporary batters where space permits. A maximum temporary batter slope of 1.5(H):1(V) is recommended for excavations of up to 3 m depth in these materials where they are above the water table, and where not subjected to surcharge loads. Permanent batters should be flattened to no steeper than 2(H):1(V). The medium and high strength rock should be able to stand vertically providing adverse jointing is not present.

Retaining walls (temporary and/or permanent) will be required in some areas of the site and could be designed using the material and strength parameters outlined in Table 3.



Material	Bulk Unit Weight (kN/m³)	Ka	Ko	Poisson's Ratio	Young's Modulus (MPa)	Effective Cohesion (kPa)	Effective Friction Angle (°)	Ultimate Passive Earth Pressure (kPa)
Fill	20	0.4	0.6	0.35	10	0	30	-
MS/HS Sandstone	23	0	0	0.25	500	100	35	3000²

Notes: 1. Unless unfavourably jointed; 2 Only below ground level and where jointing is favourable; MS = medium strength; HS = high strength; K_a = coefficient of active earth pressure; K_o = coefficient of earth pressure at rest;

A triangular lateral earth pressure distribution could be assumed for cantilevered walls. Lateral pressures due to surcharge loads from sloping ground surfaces, adjacent buildings, construction machinery and vehicles should be included where relevant. Hydrostatic pressure acting on the retaining walls should also be included in the design where adequate drainage is not provided behind the full height of the walls.

9.3 Site Preparation

Areas of the site that require filling to raise site levels should be stripped of vegetation and existing fill materials prior to proof-rolling with a minimum 10 t steel smooth drum roller (soil subgrades only). Any areas exhibiting significant heaving should be assessed by a geotechnical engineer to determine any rectification measures that may be required. Proof-rolling will not be required if the subgrade is low, medium or high strength sandstone bedrock.

Approved fill should then be placed on the prepared subgrade in 250 mm thick layers and be compacted to achieve a dry density ratio of at least 98% relative to Standard compaction. This density criteria could be relaxed to a dry density ratio of at least 95% relative to Standard compaction in areas that are not required to support structures or pavements. The moisture content of the fill should be within 2% of optimum if it exhibits clay-like properties. Density testing should be undertaken in accordance with the provisions of AS 3798 - 2007 *Guidelines on earthworks for commercial and residential developments*.

The subgrade in areas where fill is not required should also be prepared in accordance with the above advice if they are required to support structures or pavements.

Pavements could be designed on the basis of a design subgrade CBR of 12% for the sandy and gravelly materials provided that the subgrade is prepared in accordance with the advice provided above. The design subgrade CBR should be lowered to 3% for clayey materials.



9.4 Groundwater

The regional groundwater table is expected to be well below the bedrock surface and flow in a southerly direction towards Athol Bay. However, some seepage through and along strata boundaries should be expected and this should be considered in the design of the drainage systems on the site. Seepage may also need to be removed from footing and pile excavations prior to pouring concrete.

9.5 Foundations

It is 'good engineering practice' to uniformly support a multi-storey building such as that proposed on natural material of uniform strength to reduce the potential for differential settlement, especially considering the variability and depth of the fill at the site. Foundation systems will depend on the proposed bulk excavation level. It is expected that shallow footings or short piles or a combination of both would be required to bear on bedrock.

Footings and piles could be designed using the information provided in Table 4.

Table 4: Allowable Design Parameters for Spread Footings and Bored Piles in Sandstone

Material Description	Allowable End Bearing Pressure	Allowable Shaft Adhesion ¹ (kPa)
MS/HS Sandstone	3500	300

Notes: Only for piles where adequate socket-roughness has been achieved; MS = medium strength; HS = high strength

Foundations proportioned on the basis of the allowable bearing pressures in Table 4 would be expected to experience total settlements of less than 1% of the pile diameter, or minimum footing dimension, under the applied working load, with differential settlements between adjacent columns expected to be less than half of this value.

Footings should be positioned outside a 45-degree zone of influence from the base of nearby excavation. If this is not possible, the allowable bearing pressure may need to be reduced by up to 50% of the original value, subject to inspection and assessment by a geotechnical engineer.

All new footings should be inspected by an experienced geotechnical professional to check the suitability of the foundation material, and in the case of bored piles the socket roughness and the base cleanliness. Higher bearing pressures could be justified, if required, provided additional testing is undertaken during construction.

9.6 Soil Aggressivity

The results of electrical conductivity, pH, chloride and sulphate analyses indicate that the concentrations within the soil samples analysed are mildly aggressive to concrete piles (Table 6.4.2(C) of AS 2159 - 2009) and non-aggressive to steel piles (Table 6.5.2(C) of AS 2159 - 2009). Reference should be made to Table 6.4.3 of AS 2159 - 2009 to determine minimum concrete cover to steel.



10. Limitations

Douglas Partners (DP) has prepared this report for this project at Taronga Zoo in accordance with DP's proposal SSYD201344.P.002.Rev1 dated 8 December 2020 and acceptance received from Mr Paul Alwis. The work was carried out under DP's Conditions of Engagement. This report is provided for the exclusive use of Taronga Conservation Society Australia for this project only and for the purposes as described in the report. It should not be used by or relied upon for other projects or purposes on the same or other site or by a third party. Any party so relying upon this report beyond its exclusive use and purpose as stated above, and without the express written consent of DP, does so entirely at its own risk and without recourse to DP for any loss or damage. In preparing this report DP has necessarily relied upon information provided by the client and/or their agents.

The results provided in the report are indicative of the sub-surface conditions on the site only at the specific sampling and/or testing locations, and then only to the depths investigated and at the time the work was carried out. Sub-surface conditions can change abruptly due to variable geological processes and also as a result of human influences. Such changes may occur after DP's field testing has been completed.

DP's advice is based upon the conditions encountered during this investigation. The accuracy of the advice provided by DP in this report may be affected by undetected variations in ground conditions across the site between and beyond the sampling and/or testing locations. The advice may also be limited by budget constraints imposed by others or by site accessibility.

The assessment of atypical safety hazards arising from this advice is restricted to the (geotechnical / environmental / groundwater) components set out in this report and based on known project conditions and stated design advice and assumptions. While some recommendations for safe controls may be provided, detailed 'safety in design' assessment is outside the current scope of this report and requires additional project data and assessment.

Building demolition materials, such as concrete, timber and asbestos containing fibre cement sheet fragments were, located in previous below-ground filling, and these are considered as indicative of the possible presence of hazardous building materials (HBM), including asbestos.

This report must be read in conjunction with all of the attached and should be kept in its entirety without separation of individual pages or sections. DP cannot be held responsible for interpretations or conclusions made by others unless they are supported by an expressed statement, interpretation, outcome or conclusion stated in this report.

This report, or sections from this report, should not be used as part of a specification for a project, without review and agreement by DP. This is because this report has been written as advice and opinion rather than instructions for construction.

Douglas Partners Pty Ltd

Appendix A

About This Report

About this Report Douglas Partners O

Introduction

These notes have been provided to amplify DP's report in regard to classification methods, field procedures and the comments section. Not all are necessarily relevant to all reports.

DP's reports are based on information gained from limited subsurface excavations and sampling, supplemented by knowledge of local geology and experience. For this reason, they must be regarded as interpretive rather than factual documents, limited to some extent by the scope of information on which they rely.

Copyright

This report is the property of Douglas Partners Pty Ltd. The report may only be used for the purpose for which it was commissioned and in accordance with the Conditions of Engagement for the commission supplied at the time of proposal. Unauthorised use of this report in any form whatsoever is prohibited.

Borehole and Test Pit Logs

The borehole and test pit logs presented in this report are an engineering and/or geological interpretation of the subsurface conditions, and their reliability will depend to some extent on frequency of sampling and the method of drilling or excavation. Ideally, continuous undisturbed sampling or core drilling will provide the most reliable assessment, but this is not always practicable or possible to justify on economic grounds. In any case the boreholes and test pits represent only a very small sample of the total subsurface profile.

Interpretation of the information and its application to design and construction should therefore take into account the spacing of boreholes or pits, the frequency of sampling, and the possibility of other than 'straight line' variations between the test locations.

Groundwater

Where groundwater levels are measured in boreholes there are several potential problems, namely:

 In low permeability soils groundwater may enter the hole very slowly or perhaps not at all during the time the hole is left open;

- A localised, perched water table may lead to an erroneous indication of the true water table;
- Water table levels will vary from time to time with seasons or recent weather changes. They may not be the same at the time of construction as are indicated in the report;
- The use of water or mud as a drilling fluid will mask any groundwater inflow. Water has to be blown out of the hole and drilling mud must first be washed out of the hole if water measurements are to be made.

More reliable measurements can be made by installing standpipes which are read at intervals over several days, or perhaps weeks for low permeability soils. Piezometers, sealed in a particular stratum, may be advisable in low permeability soils or where there may be interference from a perched water table.

Reports

The report has been prepared by qualified personnel, is based on the information obtained from field and laboratory testing, and has been undertaken to current engineering standards of interpretation and analysis. Where the report has been prepared for a specific design proposal, the information and interpretation may not be relevant if the design proposal is changed. If this happens, DP will be pleased to review the report and the sufficiency of the investigation work.

Every care is taken with the report as it relates to interpretation of subsurface conditions, discussion of geotechnical and environmental aspects, and recommendations or suggestions for design and construction. However, DP cannot always anticipate or assume responsibility for:

- Unexpected variations in ground conditions.
 The potential for this will depend partly on borehole or pit spacing and sampling frequency:
- Changes in policy or interpretations of policy by statutory authorities; or
- The actions of contractors responding to commercial pressures.

If these occur, DP will be pleased to assist with investigations or advice to resolve the matter.

About this Report

Site Anomalies

In the event that conditions encountered on site during construction appear to vary from those which were expected from the information contained in the report, DP requests that it be immediately notified. Most problems are much more readily resolved when conditions are exposed rather than at some later stage, well after the event.

Information for Contractual Purposes


Where information obtained from this report is provided for tendering purposes, it is recommended that all information, including the written report and discussion, be made available. In circumstances where the discussion or comments section is not relevant to the contractual situation, it may be appropriate to prepare a specially edited document. DP would be pleased to assist in this regard and/or to make additional report copies available for contract purposes at a nominal charge.

Site Inspection

The company will always be pleased to provide engineering inspection services for geotechnical and environmental aspects of work to which this report is related. This could range from a site visit to confirm that conditions exposed are as expected, to full time engineering presence on site.

Appendix B

Drawings

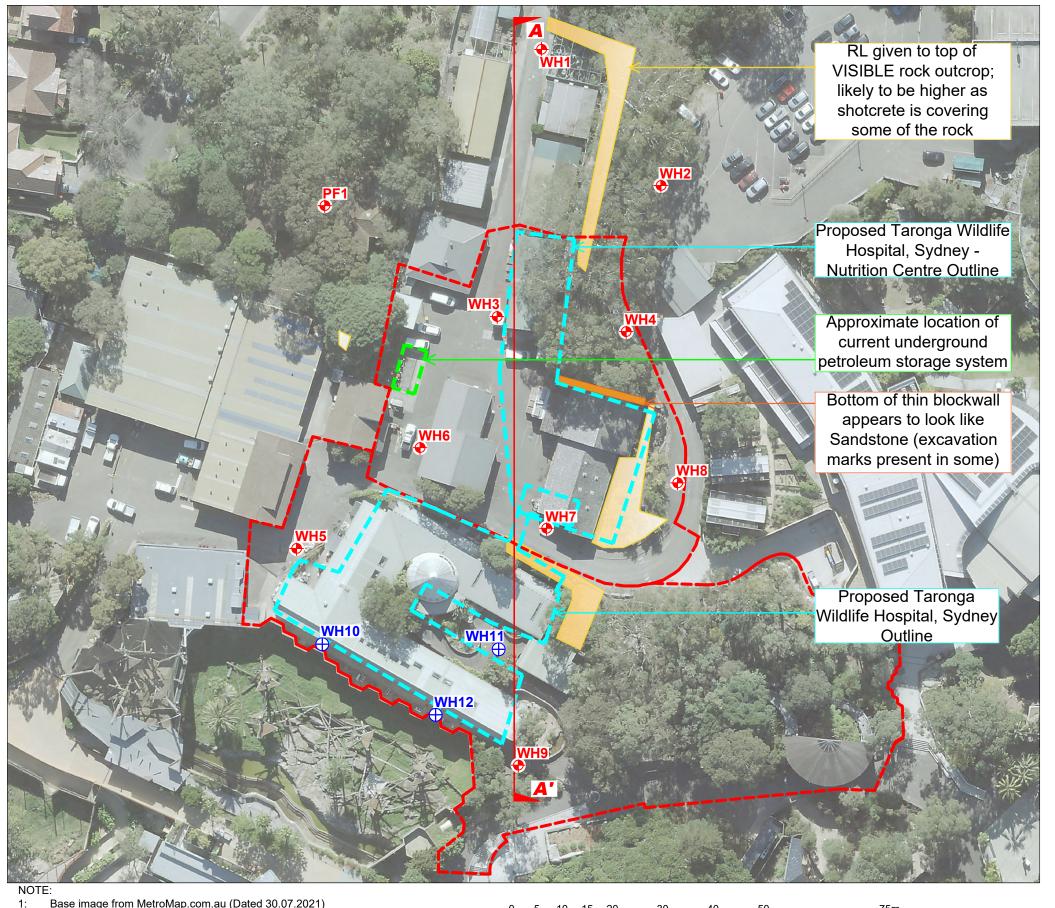



SITE LOCALITY

LEGEND

Test Bore Location and Number

DCP Location and Number

Rough Outline of Rock Outcrop Geological Cross Section

Proposed Development Site


PROJECT No: 99931.00 DRAWING No: REVISION: 3

Base image from MetroMap.com.au (Dated 30.07.2021)
Proposed building extents and levels were estimated based on the Schematic Design
Architectural Drawings (By: DWP Australia Pty Ltd, Project No. TWH 20-0527, Issues D
and P, Dated 10.09.2021 and 24.11.2021 respectively)

CLIENT: Taronga Conservation Society Australia OFFICE: Sydney DRAWN BY: CJ/MG SCALE: 1:750 @ A3 DATE: 01.12.2021

TITLE: Location of Boreholes Taronga Wildlife Hospital, Sydney - Nutrition Centre Taronga Zoo, Mosman



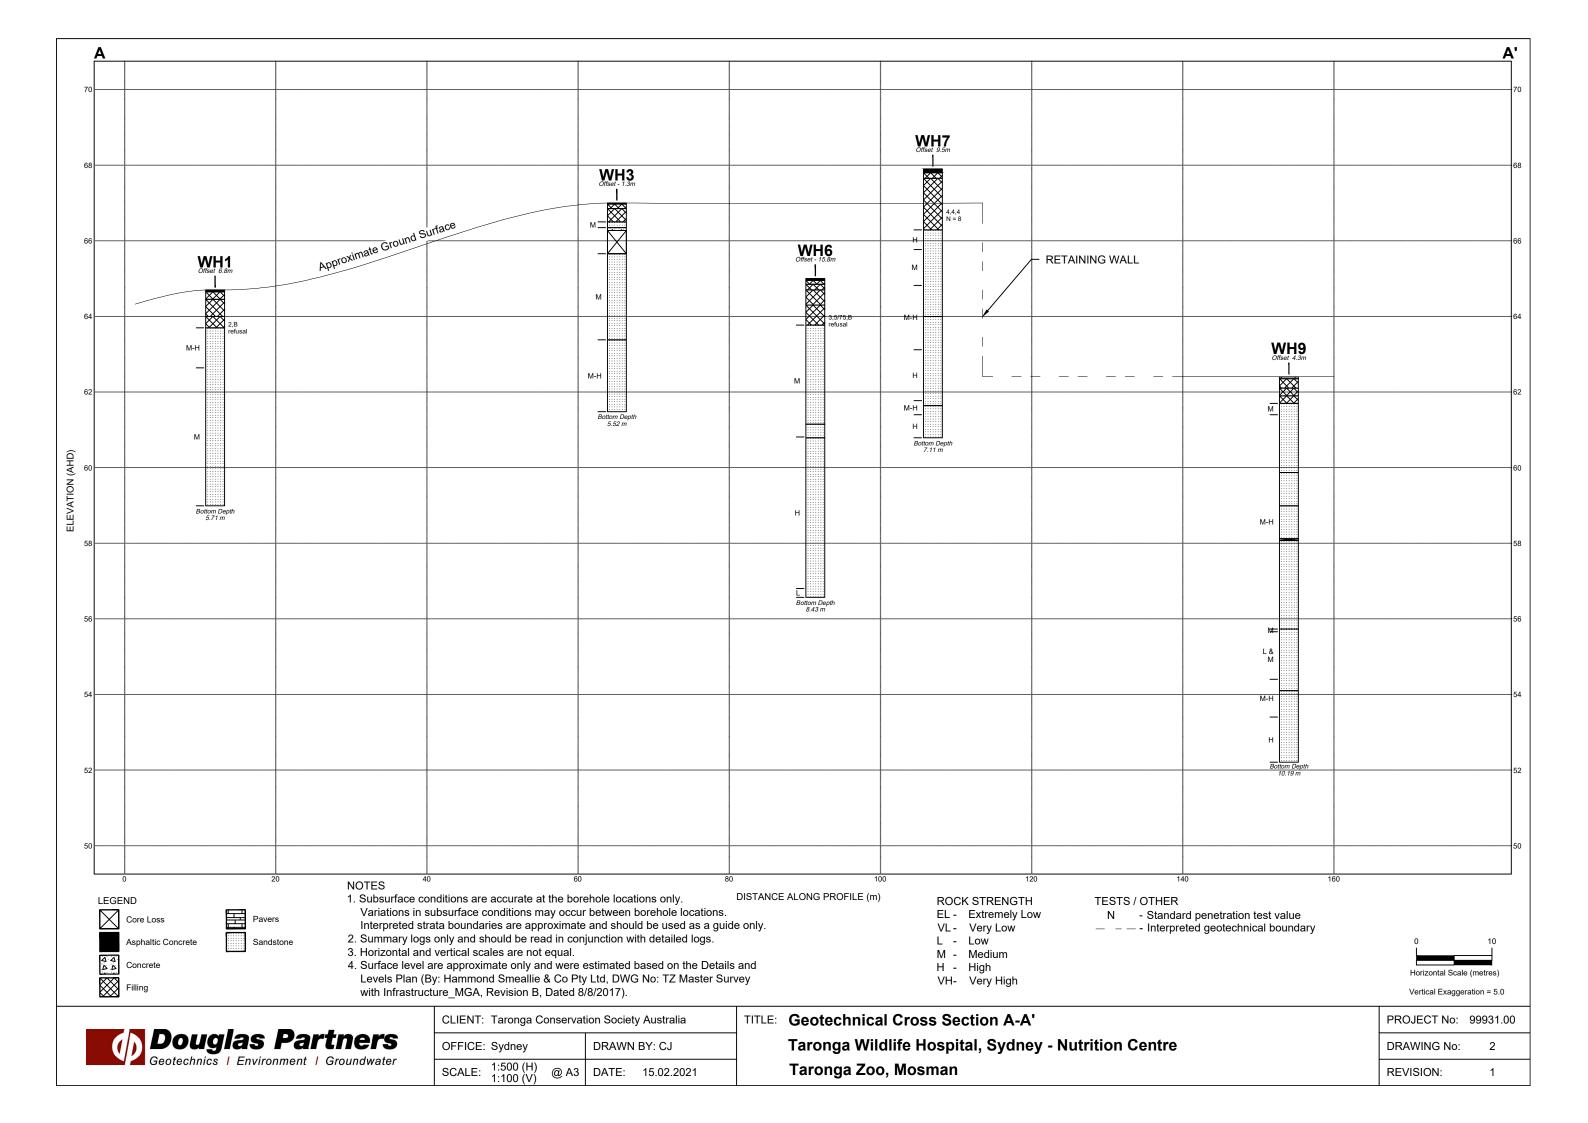

Appendix C

Results of Field Work

CLIENT: Taronga Conservation Society Australia

PROJECT: Taronga Wildlife Hospital, Sydney - Nutrition Centre **EASTING:** 337180

LOCATION: Bradleys Head Road, Mosman

SURFACE LEVEL: 62.1 AHD **BORE No:** PF1

ASTING: 337180 **PROJECT No**: 99931.00

NORTHING: 6254000 **DATE:** 20/1/2021 **DIP/AZIMUTH:** 90°/-- **SHEET** 1 OF 1

		Description	Degree of Weathering	je	Rock Strength	Fracture	Discontinuities				In Situ Testing
	epth (m)	of	Degree of Weathering	srapt Log	Strength Low Nedium High Kery High Kery High Kery High Kery High Kery High Kery High Mater	Spacing (m)	B - Bedding J - Joint	Type	ore c.%	RQD %	Test Results
			EW HW EW FS SW FS	Ö	Medi Kery Very Very Kery Kery Kery Kery Kery Kery Kery K	0.01 0.10 0.50 1.00	S - Shear F - Fault	F	Q &	80	Comments
8	0.03	ASPHALTIC CONCRETE /	1 1 1 1 1	\times				A/E			PID<1 ppm
-1	0.34	FILL/SAND: fine to medium, yellow-brown, with fine sandstone gravel, moist, apparently loose SANDSTONE: medium to coarse grained, orange and pale grey, low to medium then medium strength,		XX			0.94m: B0°, pl, ro, cly vn				PL(A) = 0.3
-		moderately weathered, fractured to slightly fractured, Hawkesbury Sandstone					1.13m: Ds, 20mm 1.15m: B0°, pl, ro, cly co 10mm 1.75m: Cs, 30mm	С	100	95	PL(A) = 0.3
-2							2.04m: Cs, 50mm				PL(A) = 0.4
-3	2.53	SANDSTONE: medium to coarse grained, pale grey, medium to high strength, fresh, slightly fractured, Hawkesbury Sandstone				 	2.39m: B0°, ir, ro, cly vn				PL(A) = 0.6
-											PL(A) = 0.7
8-4							3.97m: B0°, pl, ro, cly co 5mm	С	100	96	PL(A) = 1.9
-5							4.48m: Cs, 30mm 4.6m: B0°, pl, ro,cly co 2mm				PL(A) = 1.6
	5.55	Bore discontinued at 5.55m - Target depth reached									
-6						 					
7											
-8											
-											
-9						 					
-											

RIG: Hanjin D8 DRILLER: Hagstrom LOGGED: KR CASING: HQ to 0.3m


TYPE OF BORING: Solid flight auger (TC-bit) to 0.34m, NMLC drilling to 5.55m **WATER OBSERVATIONS:** No free groundwater observed whilst augering

REMARKS:

SAMPLING & IN SITU TESTING LEGEND										
Α	Auger sample	G	Gas sample	PID	Photo ionisation detector (ppm)					
В	Bulk sample	Р	Piston sample	PL(A) Point load axial test Is(50) (MPa)					
BLK	Block sample	U,	Tube sample (x mm dia.)	PL(D) Point load diametral test Ís(50) (MPa)					
С	Core drilling	WÎ	Water sample	pp ·	Pocket penetrometer (kPa)					
D	Disturbed sample	⊳	Water seep	S	Standard penetration test					
F	Environmental cample	¥	Water level	\/	Shoor yong (kDa)					





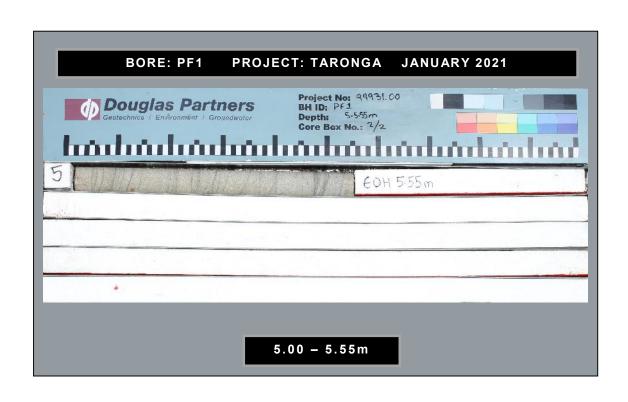

CLIENT: Taronga Conservation Society Australia

Taronga Wildlife Hospital, Sydney - Nutrition Centre **EASTING**: 337223 PROJECT:

Bradleys Head Road, Mosman LOCATION:

SURFACE LEVEL: 64.7 AHD BORE No: WH1

PROJECT No: 99931.00 NORTHING: 6254031 **DATE:** 14/1/2021 **DIP/AZIMUTH:** 90°/--

SHEET 1 OF 1

		Description	Degree of Weathering	<u>.0</u>	Rock Strength	Fracture	Discontinuities				In Situ Testing
R	Depth (m)	of	Troduicing	aph	Strength Nedlum N	Spacing (m)	B - Bedding J - Joint)e	e %.	RQD %	Test Results
	()	Strata	EW MW SW FS FS	Ō	/ery L	0.05	S - Shear F - Fault	Туре	လို့ လို့	RG %	& Comments
H	0.05	ASPHALTIC CONCRETE		$\times \times$				A/E	1		PID=2 ppm
64	· ·	FILL/ROADBASE: Gravelly SAND, fine to medium, grey-brown, fine igneous gravel, with silt, moist						A/E	1		PID<1 ppm
	.	FILL/SAND: fine to medium, dark brown, with silt, clay, trace fine ligneous gravel and ash, moist, apparently medium dense FILL/SAND: fine to medium, yellow-brown, with fine sandstone						A/E* S/E			PID<1 ppm 2,B refusal PL(A) = 1.1
62 63	- 2 - 2 	gravel, moist, apparently medium dense SANDSTONE: medium to coarse grained, pale grey, medium to high then medium strength, fresh, slighty fractured, Hawkesbury Sandstone					2.06m: Ds, 50mm	С	100	97	PL(A) = 0.7
61	-3	3.23-3.65m: fractured to slightly fractured, some siltstone laminations					3.22m: B0°, cly co 10mm 3.28-3.34m:Bx5, 0°, pl, ro, cly vn 3.64m: B0°, cly co				PL(A) = 0.5
09	-4						4.42m: B0°, cly co 5mm 4.61m: Ds, 40mm 4.81m: B0°, pl, ro, cly vn	С	100	94	PL(A) = 0.4
29	. 5.71										PL(A) = 0.7
56 57 58		Bore discontinued at 5.71m - Target depth reached									

RIG: Hanjin D8 **DRILLER:** Hagstrom LOGGED: KR CASING: HQ to 5.7m

TYPE OF BORING: Solid flight auger (TC-bit) to 1.00m, NMLC drilling to 5.71m WATER OBSERVATIONS: No free groundwater observed whilst augering

REMARKS: *Blind duplicate taken at 0.9-1.0m (BD3/20210114).

SAMPLING	& IN SITU	TESTING L	EGEND

A Auger sample
B Bulk sample
BLK Block sample
C Core drilling
D Disturbed sample
E Environmental sample Gas sample
Piston sample
Tube sample (x mm dia.)
Water sample
Water seep
Water level

PID Photo ionisation detector (ppm)
PL(A) Point load axial test Is(50) (MPa)
PL(D) Point load diametral test Is(50) (MPa)
pp Pocket penetrometer (kPa)
S Standard penetration test
V Shear vane (kPa)







CLIENT: Taronga Conservation Society Australia

PROJECT: Taronga Wildlife Hospital, Sydney - Nutrition Centre **EASTING:** 337247

LOCATION: Bradleys Head Road, Mosman

SURFACE LEVEL: 73.2 AHD BORE No: WH2

EASTING: 337247 **PROJECT No**: 99931.00 **NORTHING**: 6254004 **DATE**: 12/1/2021

DIP/AZIMUTH: 90°/-- **SHEET** 1 OF 2

		Description	Degree of Weathering	ō	Rock Strength	Fracture	Discontinuities	Sa	mplir	ng & I	n Situ Testing
씸	Depth (m)	of		raph Log	Strength Nedium High Ex High Strength Water	Spacing (m)	B - Bedding J - Joint	Type	Core Rec. %	Q.,	Test Results
	()	Strata	MW HW SW SW FR	Ō	Ex Low Low Medium High Ex High Wa	0.01	S - Shear F - Fault	~	ပိမ္တ	RO %	& Comments
F_	0.05	ASPHALTIC CONCRETE /									
[]	0.2	CONCRETE SLAB	1	X				A/E*			PID<1 ppm
ŀ	-	FILL/Clayey SAND: fine to medium, yellow-brown, with fine		$\langle \! \! \! \! \! \! \! \! \! \! \! \! \! \! \! \! \! \! \!$				A/E	1		PID<1 ppm
	- 0.8	sandstone gravel, trace ash, moist,		\boxtimes							
ļ	-1	apparently medium dense to dense		$\langle \rangle \rangle$				A/E			PID<1 ppm
2	-	FILL/SAND: fine to medium, dark brown and brown, with clay, silt,		\boxtimes				s			6,5,4 N = 9
ŀ	-	fine sandstone gravel, trace ash, moist, apparently dense		$ \!\!>\!\!>$				A/E			PID<1 ppm PID<1 ppm
	-	1.5m: trace carbonaceous material		\bowtie							
	1.8	FILL/SAND: fine to medium, pale				i ii ii		A/E			PID<1 ppm
[_	-2 2.15	grey, trace clay, fine sandstone ¬ gravel, silt, ash, moist, apparently		XX				S		\sqcup	4/50,B
[]	2.34	dense		4.4		i ii ii					refusal PID<1 ppm
; ;	-	CONCRETE		\bigcap			2.5m: CORE LOSS:	C/E**	36	0	• •
	·	FILL/Gravelly CLAY: low plasticity, yellow-brown and brown, fine		X			600mm	0,2			
Ē	- 3 - 3.1	sandstone and igneous gravel,		$/ \setminus$							PL(A) = 0.5
2	3.1 -	trace timber, fibre cement fragments (confirmed asbestos									PL(A) = 0.5
	r	containing material), w <pl< td=""><td></td><td></td><td> </td><td> </td><td></td><td></td><td></td><td></td><td>PL(A) = 1.6</td></pl<>									PL(A) = 1.6
	-	SANDSTONE: medium to coarse grained, yellow-brown and									,
E	- La	red-brown, medium then high						С	100	100	PL(A) = 1.3
- 8	- "	strength, moderately weathered, slightly fractured, Hawkesbury									FL(A) - 1.3
ľ	-	Sandstone									
Ħ	- 4.5 -	SANDSTONE: medium to coarse								\square	
E	-	grained, pale grey, medium to high then high strength, fresh, slightly				! !! [[]	4.72m: B0°, pl, ro, cly co		400	400	PL(A) = 0.9
:	-5	fractured, Hawkesbury Sandstone				 	1mm	С	100	100	
-8	- r					! !! !	5.29m: B5°, pl, ro, cly co			\vdash	PL(A) = 1
Ħ	· -						2mm				
[-										
ŀ	- -6										
- 29	- '										
Ħ	-			: : : : : : : : : :							51(4)
[-										PL(A) = 1.5
	-							С	100	99	
إرا	- 7			: : : : :		<u> </u>					
99	-						7.16m: B0°, pl, ro, cly co 2mm				
[]	-					i ii l il					
	-						70 0 40				
	- -8		<u> </u>				7.8m: Ds, 40mm				PL(A) = 1.4
-89	· [
[-					i ii i i l					PL(A) = 1.8
	-					 					
						i ii i h l	8.86m: B0°, pl, ro, cly co				
ł., ł	-9 -					 	1mm	С	100	99	
64	-										
	-			:::::		 					
	- - 9.78	SANDSTONE: as below	-	:::::							PL(A) = 0.7
	•	5. 11501 OHL. 00 DOIOW		:::::							

RIG: Hanjin D8 DRILLER: Hagstrom LOGGED: KR CASING: HQ to 2.1m

TYPE OF BORING: Diacore (250mm) to 0.2m, solid flight auger (TC-bit) to 2.15m, NMLC drilling to 12.00m

WATER OBSERVATIONS: No free groundwater observed whilst augering

REMARKS: *Blind duplicate taken at 0.2-0.3m (BD1/20200112). **2 confirmed asbestos containing material fragments found within 2.5-3.1m from coring; sample taken of all fill return in core barrel from 2.5-3.1m. 100% loss of drilling water return from 2.15m-3.10m

SAMPLING & IN SITU TESTING LEGEND

A Auger sample
B Bulk sample
C Core drilling
D Disturbed sample
E Environmental sample

SAMPLING & IN SITU TESTING LEGEND

G Gas sample
P Piston sample
P Piston sample
Tube sample (x mm dia.)
V Water sample
V Water sample
V Water seep
S Standard penetration test
V Shear vane (kPa)



CLIENT: Taronga Conservation Society Australia

PROJECT: Taronga Wildlife Hospital, Sydney - Nutrition Centre EASTING: 337247

LOCATION: Bradleys Head Road, Mosman

SURFACE LEVEL: 73.2 AHD BORE No: WH2

EASTING: 337247 **PROJECT No:** 99931.00 **NORTHING:** 6254004 **DATE:** 12/1/2021

DIP/AZIMUTH: 90°/-- **SHEET** 2 OF 2

	_	Description	Degree of Weathering	. <u></u>	Rock Strength ់ច	Fracture	Discontinuities				In Situ Testing
귐	Depth (m)	of	oaioiiig	raph Log	Ex Low Very Low Low Medium High Kry High Ex High	Spacing (m)	B - Bedding J - Joint	Туре	Core Rec. %	Q,	Test Results &
	(***)	Strata	H W W W H W B W W B W W W W W W W W W W	Ō	Ex Low Very I Wediu Wediu Very Very Very Ex High		S - Shear F - Fault	7	လို့ လို	RG %	Comments
63	44	SANDSTONE: medium to coarse grained, pale grey, massive, medium to high and high strength, fresh, slightly fractured, Hawkesbury Sandstone (continued)						С	100	99	PL(A) = 1 PL(A) = 1.5
62	-11	11.04-11.70m: bedding dipping at 10 degrees					10.97m: Ds, 30mm	С	100	100	PL(A) = 1.5
	-12 12.0	Bore discontinued at 12.0m		: : : : :	┆┆┆┩┆ ┤						PL(A) = 1
61		- Target depth reached									
09	-13										
	- 14										
29											
28	-15										
57	-16										
26	-17										
55	-18										
54	-19										

RIG: Hanjin D8 DRILLER: Hagstrom LOGGED: KR CASING: HQ to 2.1m

TYPE OF BORING: Diacore (250mm) to 0.2m, solid flight auger (TC-bit) to 2.15m, NMLC drilling to 12.00m

WATER OBSERVATIONS: No free groundwater observed whilst augering

REMARKS: *Blind duplicate taken at 0.2-0.3m (BD1/20200112). **2 confirmed asbestos containing material fragments found within 2.5-3.1m from coring; sample taken of all fill return in core barrel from 2.5-3.1m. 100% loss of drilling water return from 2.15m-3.10m

SAMPLING & IN SITU TESTING LEGEND

A Auger sample
B Bulk sample
C Core drilling
D Disturbed sample
E Environmental sample


SAMPLING & IN SITU TESTING LEGEND

G Gas sample
P Piston sample
P Piston sample
Tube sample (x mm dia.)
V Water sample
V Water sample
V Water seep
S Standard penetration test
V Shear vane (kPa)







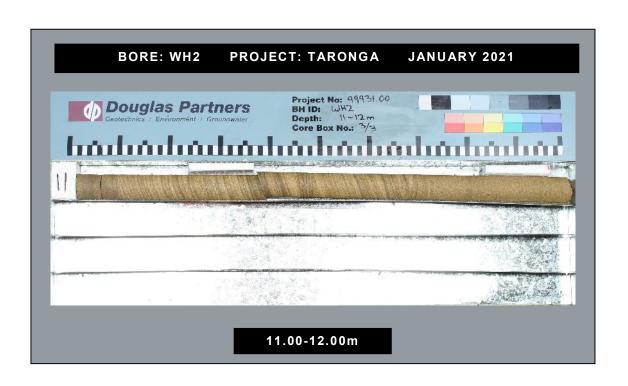

CLIENT: Taronga Conservation Society Australia

PROJECT: Taronga Wildlife Hospital, Sydney - Nutrition Centre EASTING: 337214

LOCATION: Bradleys Head Road, Mosman

SURFACE LEVEL: 67.0 AHD BORE No: WH3

NORTHING: 6253978 DIP/AZIMUTH: 90°/-- PROJECT No: 99931.00

DATE: 14/1/2021 **SHEET** 1 OF 1

ם הי		Description	Degree of Weathering	<u>.</u>	Rock Strength តែ	Fracture	Discontinuities	Sa			In Situ Testing
	Depth (m)	of Strata	Weathering	Graph Log	Ex Low Very Low Low High Very High Ex High Ex High Water	Spacing (m) 93.00 0.00 0.00 0.00 0.00 0.00 0.00 0.0	B - Bedding J - Joint S - Shear F - Fault	Type	Core	RQD %	Test Results &
49	0.03 0.15	ASPHALTIC CONCRETE	SW H HW FEW	XX							
	0.5	FILL/ROADBASE: Gravelly SAND, fine to medium, grey-brown, fine		XX				A/E			PID<1 ppm
: [0.65	igneous gravel, with silt, moist FILL/SAND: fine to medium, dark		XX			0.72m; CODE I OSS;				PL(A) = 0.7
-8-1		brown, with silt, clay, trace fine igneous gravel and ash, moist		\bigvee			0.73m: CORE LOSS: 610mm				
	1.34	FILL/SANDSTONE BOULDER: red-brown, medium strength		<u> </u>							DI (A) O A
: [CONCRETE					1.42m: B0°, pl, ro, cly co 1mm	С	61	61	PL(A) = 0.4 PL(A) = 0.6
2 - 9 - 9		SANDSTONE: medium to coarse grained, red-brown and	│ ┿ ┇╣┆┆┆		╡		1.8m: Ds, 40mm 1.84m: Cs, 20mm				PL(A) = 1.2
		yellow-brown, medium to high strength, moderately weathered, fractured to slightly fractured,					1.86m: Ds, 40mm				PL(A) - 1.2
:		Hawkesbury Sandstone									
								С	100	100	
-8-3											PL(A) = 0.6
:								С	100	100	PL(A) = 0.8
	3.62	SANDSTONE: medium to coarse grained, pale grey, medium to high	 						100	100	PL(A) = 0.8 PL(A) = 0.7
8 4		strength, fresh, slightly fractured to unbroken, Hawkesbury Sandstone									PL(A) = 0.9
[ansienen, navneessa y eanaetene									
:								С	100	100	
- 5 - 3 - 5							4.8m: B0°, pl, ro, cly co 2mm				
		5.26-5.52m: high strength			╡ ╡ ╡	┆╺┿╼┛┆	5.24m: Cs, 20mm				
: [5.52	Bore discontinued at 5.52m				 					PL(A) = 2
		- Target depth reached									
-6-6											
:											
-8-7 -											
8											
:											
·											
 - 85 - 9											
:											
:											

RIG: Hanjin D8 DRILLER: Hagstrom LOGGED: KR CASING: HQ to 0.5m


TYPE OF BORING: Solid flight auger (TC-bit) to 0.50m, NMLC drilling to 5.52m **WATER OBSERVATIONS:** No free groundwater observed whilst augering

REMARKS:

	SAMP	LING	& IN SITU TESTING	LEGE	ND
Α	Auger sample	G	Gas sample		Photo ionisation detector (ppm)
В	Bulk sample	P	Piston sample	PL(A) Point load axial test ls(50) (MPa)
BLK	Block sample	U,	Tube sample (x mm dia.)	PL(D	Point load diametral test (\$(50) (MPa)
С	Core drilling	WÎ	Water sample	pp `	Pocket penetrometer (kPa)
D	Disturbed sample	⊳	Water seep	s.	Standard penetration test
	Facility and the Control of the Cont	•	\A/-4 []	1/	Characteria (I-Da)





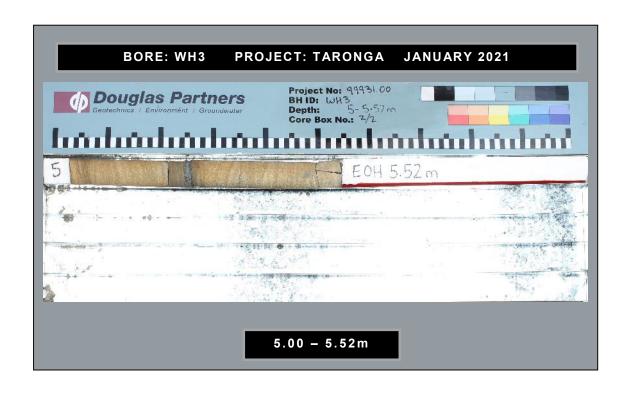

CLIENT: Taronga Conservation Society Australia

PROJECT: Taronga Wildlife Hospital, Sydney - Nutrition Centre **EASTING**: 337240

SURFACE LEVEL: 73.0 AHD **BORE No**: WH4 **EASTING**: 337240 **PROJECT No**: 99 **NORTHING**: 6253975 **DATE**: 12 - 13/1/

PROJECT No: 99931.00 **DATE:** 12 - 13/1/2021 **SHEET** 1 OF 2

LOCATION: Bradleys Head Road, Mosman

DIP/AZIMUTH: 90°/--

		Description	Degree of	Rock Strength	Fracture	Discontinuities	Sa	mplir	ng & lı	n Situ Testing
RL	Depth (m)	h of Strata	Meathering order of Control of Co	Strength Needium High Very High Needium High Very High Ex High Nater	Spacing (m)	B - Bedding J - Joint S - Shear F - Fault	Туре	Core Rec. %	RQD %	Test Results & Comments
٦	0.0	.031\ASPHALTIC CONCRETE					A/E			PID<1 ppm
-	-	FILL/ROADBASE: Gravelly SAND, fine to medium, grey-brown, fine igneous gravel, with silt, moist					A/E			PID<1 ppm
72	-1 -1 - - - 1	FILL/SAND: brown and grey, with clay, silt, trace fine sandstone gravel and ash, apparently medium dense to dense 9.8-1.15m: low to medium plasticity, red-brown silty clay fill band					A/E S A/E			9,4,5 N = 9 PID<1 ppm PID<1 ppm
71	-2 -	FILL/Sandy CLAY: low plasticity, pale orange-brown and red-brown, fine to medium sand, trace subrounded fine sandstone gravel					A/E			PID<1 ppm
. 0	- - - - -3	and ash, w <pl, a="" condition<br="" in="" stiff="">Below 2.0m: with sandstone gravel, trace igneous gravel, wood</pl,>					S A/E			PID<1 ppm 4,3,6 N = 9 PID<1 ppm PID<1 ppm
69	- 3.0 - - - - -	SANDSTONE: medium to coarse grained, yellow-brown and red-brown, medium to high and high strength, moderately weathered, slightly fractured, Hawkesbury Sandstone				3.63m: B0°, ir, ro, fe				PL(A) = 1 PL(A) = 1.4
	-					4.07mu DE° ni ro aluga	С	100	100	
- 89	-5 - - -					4.87m: B5°, pl, ro, cly co 1mm 5.14m: B0°, pl, ro, cly co 2mm 5.24m: B0° pl, ro, cly co				PL(A) = 0.7
67	-	SANDSTONE: medium to coarse grained, pale grey, medium to high strength, fresh, slightly fractured, Hawkesbury Sandstone		-		L5.24m: B0°, pl, ro, cly co 1mm				PL(A) = 1.3
99	- - - - - 7					6.9m: B10°, pl, ro, cly vn	С	100	99	PL(A) = 1.5
	-							.50		
99	- - 8 - -					8.07m: Ds, 20mm				PL(A) = 0.9
- 2	- - - - - 9									PL(A) = 0.6
	-					9.38m: B0°, pl, ro, cly vn	С	100	98	PL(A) = 1.3
	-	9.92-10.85m: massively bedded				9.82m: B0°x2, pl, ro, cly				

RIG: Hanjin D8 DRILLER: Hagstrom LOGGED: KR CASING: HQ to 3.7m

TYPE OF BORING: Solid flight auger (TC-bit) to 3.07m, NMLC drilling to 11.56m **WATER OBSERVATIONS:** No free groundwater observed whilst augering

REMARKS:

	SAME	PLING	& IN SITU TESTING	LEGE	END
A	Auger sample	G	Gas sample	PID	Photo ionisation detector (ppm)
В	Bulk sample	Р	Piston sample) Point load axial test Is(50) (MPa)
BLK	Block sample	U,	Tube sample (x mm dia.)	PL(D	Point load diametral test (s(50) (MPa)
С	Core drilling	WÎ	Water sample	pp `	Pocket penetrometer (kPa)
D	Disturbed sample	\triangleright	Water seep	S	Standard penetration test
E	Environmental sample	Ī	Water level	V	Shear vane (kPa)



CLIENT: Taronga Conservation Society Australia

PROJECT: Taronga Wildlife Hospital, Sydney - Nutrition Centre **EASTING:** 337240

LOCATION: Bradleys Head Road, Mosman

SURFACE LEVEL: 73.0 AHD BORE No: WH4

EASTING: 337240 **PROJECT No**: 99931.00 **NORTHING**: 6253975 **DATE**: 12 - 13/1/2021

DIP/AZIMUTH: 90°/-- SHEET 2 OF 2

Г		Description	Degree of Weathering	.ie	Rock Strength 🚡	Fracture	Discontinuities				n Situ Testing
꿉	Depth (m)	of		raph	Strength Necry Low Necry Low High Strigh Ex High Ex High Strigh Ex High Stright Strigh	Spacing (m)	B - Bedding J - Joint	Туре	c.%	RQD %	Test Results &
_	` ′	Strata	MW HW SW SW FS	Ŋ	Ex Lo Very Low High Kigh	0.00	S - Shear F - Fault		2 %	R ₀	Comments
62 63	-11	SANDSTONE: medium to coarse grained, pale grey, medium to high strength, fresh, slightly fractured, Hawkesbury Sandstone (continued)					co 1mm 10.85m: B0°, pl, ro, cly co 10mm 10.89m: B0°, pl, ro, cly co 3mm 11.1m: B5°, pl, ro, cly vn	С	100	98	PL(A) = 1.1 PL(A) = 1.4
ŀ	11.56	Bore discontinued at 11.56m	 		 						
	-12	- Target depth reached									
	-13 										
58	- - - - - - - - - - - - -										
57	- 16 16 										
	- 17 - 17 										
	-19										

RIG: Hanjin D8 DRILLER: Hagstrom LOGGED: KR CASING: HQ to 3.7m

TYPE OF BORING: Solid flight auger (TC-bit) to 3.07m, NMLC drilling to 11.56m **WATER OBSERVATIONS:** No free groundwater observed whilst augering

REMARKS:

SAMPLING	& IN SITU	TESTING	LEGEND

Auger sample
B Bulk sample
BLK Block sample
C Core drilling
C Core drilling
D Disturbed sample
E Environmental sample

W Water sample
W Water level

PID Photo ionisation detector (ppm)
PL(A) Point load axial test Is(50) (MPa)
PL(D) Point load diametral test Is(50) (MPa)
PL(D) Point load diametral test Is(50) (MPa)
p Pocket penetrometer (kPa)
S Standard penetration test
V Shear vane (kPa)







CLIENT: Taronga Conservation Society Australia

PROJECT: Taronga Wildlife Hospital, Sydney - Nutrition Centre EASTING: 337174

LOCATION: Bradleys Head Road, Mosman

SURFACE LEVEL: 61.2 AHD BORE No: WH5

ASTING: 337174 PROJECT No: 99931.00

NORTHING: 6253932 **DATE:** 15/1/2021 **DIP/AZIMUTH:** 90°/-- **SHEET** 1 OF 1

State			Description	De	gree o	f na .≌		Rock Strength	_	Fracture	Discontinuities	Sa	mplir	ng & I	In Situ Testing
SPHALTIC CONCRETE 0.25 LUSAND: fine to medium, prown-grey, trace silt, fine igneous gravel, moist AE			of			raph	_ 20 8		Vate	Spacing (m)	B - Bedding J - Joint	be	Core Rec. %	وي ا	Test Results &
Self-ILL/SAND: fine to medium, regret, trace silt, fine igneous gravel, moist medium, grey, fine igneous gravel, moist places grained, pale grey, medium to coarse grained, pale grey, medium to coarse grained, pale grey, high strength, resh, untroken, Hawkesbury Sandstone SANDSTONE: medium to coarse grained, pale grey, high strength, resh, untroken, Hawkesbury Sandstone C C 3.15 SANDSTONE: medium to coarse grained, pale grey, high strength, resh, untroken, Hawkesbury Sandstone SANDSTONE: medium to coarse grained, pale grey, high strength, resh, untroken, Hawkesbury Sandstone C C 3.15 SANDSTONE: medium to coarse grained, pale grey, high strength, resh, untroken, Hawkesbury Sandstone 5.5 Bore discontinued at 5.5m - Target depth reached	Į `	,		H W	SW FS	H Q	EX Lo	Kery High Exist	>	0.05	S - Shear F - Fault	Ţ	Rec	RC %	Comments
medium, grey, fine igneous gravel, moist FILL/SAND: fine to medium, yellow-brown and grey, trace fine igneous gravel, moist to wet SANDSTONE: medium to coarse grained, pale grey, medium to high strength, slightly weathered, slightly fractured, Hawkesbury Sandstone 2.31m: B5°, pl, ro, cly co 3mm 3.15 SANDSTONE: medium to coarse grained, pale grey, high strength, fresh, unbroken, Hawkesbury Sandstone 2.31m: B5°, pl, ro, cly co 3mm 5.5 Bore discontinued at 5.5m - Target depth reached 5.5 5.5 Sandstone 5.18m: B5°, pl, ro, cly vn 5.18m:	-	0.25 0.4	FILL/SAND: fine to medium, brown-grey, trace silt, fine igneous gravel, moist	- - - -	 		XXXX					A/E A/E			
SANDSTONE: medium to coarse grained, pale grey, medium to high strength, slightly fractured, Hawkesbury Sandstone SANDSTONE: medium to coarse grained, pale grey, high strength, fresh, unbroken, Hawkesbury Sandstone SANDSTONE: medium to coarse grained, pale grey, high strength, fresh, unbroken, Hawkesbury Sandstone 5.5 Bore discontinued at 5.5m - Target depth reached 7	- -1 -	0.78	medium, grey, fine igneous gravel, moist FILL/SAND: fine to medium, yellow-brown and grey, trace fine										100	100	PL(A) = 0.9
SANDSTONE: medium to coarse grained, pale grey, high strength, fresh, unbroken, Hawkesbury Sandstone 5.5 Bore discontinued at 5.5m - Target depth reached 5.7	-2		grained, pale grey, medium to high strength, slightly weathered, slightly								2.31m: B5°, pl, ro, cly co 3mm		100	100	PL(A) = 1
fresh, unbroken, Hawkesbury Sandstone C Solution Solu	-3	3.15													PL(A) = 0.9
Some discontinued at 5.5m - Target depth reached 5.18m: B5°, pl, ro, cly vn	-4		fresh, unbroken, Hawkesbury									С	100	100	PL(A) = 1.5
S. 18m: Bs , pi, ro, ciy vn - 6 - 6 - 7 - 8 - 8	-5														PL(A) = 1.4
		5.5			 						5.18m: B5°, pl, ro, cly vn				PL(A) = 2
	-6 -														
	-7 -					 				 					
	-8														
	9					i I									

RIG: Hanjin D8 DRILLER: Hagstrom LOGGED: KR CASING: HQ to 0.75m

TYPE OF BORING: Solid flight auger (TC-bit) to 0.78m, NMLC drilling to 5.50m **WATER OBSERVATIONS:** No free groundwater observed whilst augering

REMARKS:

	SAMP	LING	3 & IN SITU TESTING	LEGE	ND
Α	Auger sample	G	Gas sample	PID	Photo ionisation detector (ppm)
В	Bulk sample	Р	Piston sample	PL(A) Point load axial test Is(50) (MPa)
BLK	Block sample	U,	Tube sample (x mm dia.)	PL(D) Point load diametral test (s(50) (MPa)
С	Core drilling	WÎ	Water sample	pp `	Pocket penetrometer (kPa)
D	Disturbed sample	⊳	Water seep	S	Standard penetration test
	F	•	\A/=4==	١./	Ch (I-D-)







CLIENT: Taronga Conservation Society Australia

Taronga Wildlife Hospital, Sydney - Nutrition Centre **EASTING**: 337199 PROJECT:

Bradleys Head Road, Mosman LOCATION:

SURFACE LEVEL: 65.0 AHD BORE No: WH6

PROJECT No: 99931.00

NORTHING: 6253952 **DATE:** 18/1/2021 **DIP/AZIMUTH:** 90°/--SHEET 1 OF 1

П		D	De	eare	ee o	f	Т	Rock		Er	acture	Discontinuities	Sa	mnlir	na &	In Situ Testing
	Depth	Description of	We	ath	nerin	Graphic	2	Strength	te	Sp	acing					Test Results
씸	(m)			_		3rag	اِ اِ	dium low			(m)	B - Bedding J - Joint S - Shear F - Fault	Туре	ore	RQD %	&
18	0.00	Strata	N N	ž	S S	Ή.	ă	Kery Wedin	c	9 0	0.00	0 - Gricai 1 - 1 auit	┞ <u></u>	0 %	Ľ	Comments
	- 0.18		7				a ¦		H	i			A/E*			PID<1 ppm
	- 0.3	FILL/ROADBASE: Gravelly SAND, fine to medium, grey-brown, fine	d į	İ			ð Í			İ			A/E	1		PID<1 ppm
	_	igneous gravel, with silt, moist				XX	4¦									
	-	FILL/SAND: fine to medium,	H				S i		H	i						
-8	- -1	pale-brown, trace fine sandstone gravel, moist	l i	Ϊİ	i		i K	iiiii	i	i	i ii		A/E	1		PID1.1 ppm
	+	Bh FILL/SAND: fine to medium,	l!		_ _				LI!	_ !			S			3,5/75,B refusal
	- 1.2\ -	dark-brown and yellow-brown,	11	Ш			:		l li	i						PID<1 ppm
	-	trace silt and ash, clay, moist,	i	Ϊİ	i	i ::::	: i	iiiii	l li	į	i ii					PL(A) = 0.4 PL(A) = 0.4
	-	apparently medium dense SANDSTONE: medium to coarse				::::							С	100	100	1 2(11) 0.1
183	- -2	grained, red-brown, medium					:		H		 	0. 000				
	-	strength, moderately weathered,	l i	ili	i	i ::::	: i	iiiii	i	i	i li	2m: B0°, pl, ro, cly co 5mm				
	-	slightly fractured, Hawkesbury Sandstone								- !	! !!					
	-						: : : :			-		2.55m: B5°, un, ro, cly				
	-	2.70-3.14m: medium to high	l i	ili	i	::::		ii j ii	l li	i	i li	vn				
- 62	- -3	strength band	!	!!!			1			- !	! !!					PL(A) = 0.8
	-				+	┧╠┈	:				ከ	3.1m: B5°, pl, ro, cly co				
	-		H	ii	i		:		H	i	i ili	5mm				
	-		l i	İ						ĺ	<u> </u>					PL(A) = 0.5
	3.85	5]	ŀ	+	::::: :::::	<u> </u>							400		PL(A) = 0.5
126	F	SANDS I ONE: medium to coarse	l¦	ili]		H	4		3.92m: B0°, pl, ro, cly co	С	100	90	,
	- 4.2°	grained, pale grey and red-brown, low to medium strength, highly to	_ [[Ľ	i	Ĺ ::::	₽				iii	_N 5mm & J40°, pl, he, fe				
	-	moderately weathered, fractured,										3.96m: B0°, pl, he, fe 4.03m: J45°, pl, he, fe				
	-	Hawkesbury Sandstone					:		H	i	1 11	4.1m: B0°, pl, ro, cly co				
	-	SANDSTONE: medium to coarse grained, pale-grey, high strength,	i	Ϊİ	i		i	iiiii	l li	į	i ii	4.13m: Cs, 60mm				
-8	- -5	fresh, slightly fractured,					:					,				PL(A) = 1.2
	-	Hawkesbury Sandstone	H				1			i						
1			l i	Ϊİ	i		: i	iiiii	li	j	i ii					PL(A) = 1.5
1	-															
1	-						:			i						
- 62	-6		i	Ϊİ	i		: i	iiiii	i	i	i ii					
1							1					>>				PL(A) = 1.2
1	-						:		H							
1	-		i	ii	i		: i	i i i i i	l li	i	i ii					
F	-													400	400	
-82	- -7						:		¦	-			С	100	100	
F	-	7.12-7.82m: slightly weathered	Ιi	ii	\vdash		1	i i i i i	l li	i	i ii					PL(A) = 1.5
F	-				! !	::::	: !			- !						
F	-				H	::::	1			-						
F				ii	Ļ	h	1		¦	i	i ii					
-15	-8						: 1									
F		8.20-8.43m: low strength band									 <u></u>					
[]	8.43		+	+	-	11::::	1	- - - - -	i	-	il II	8.29m: B5°, pl, ro, cly co				PL(A) = 0.2
[]		Bore discontinued at 8.43m - Target depth reached		Į		!				İ		\1mm				
[]		Target deptil readiled														
-88	-9									i						
F			i	įί	į		i		i	i	į įį					
F																
F																
F			i	įί	i		i	IIIII	i	i	i ii					
ഥ					\perp				Ш							

RIG: Hanjin D8 **DRILLER:** Hagstrom LOGGED: KR CASING: HQ to 1.2m

TYPE OF BORING: Solid flight auger (TC-bit) to 1.23m, NMLC drilling to 8.43m WATER OBSERVATIONS: No free groundwater observed whilst augering

REMARKS: *No asbestos sample taken for 0.15-0.25m sample

	SAMPLING	i & IN SITU	TESTING	LEGI	END
Auger sample	G	Gas sample		PID	Phot

A Auger sample
B Bulk sample
BLK Block sample
C Core drilling
D Disturbed sample
E Environmental sample Gas sample
Piston sample
Tube sample (x mm dia.)
Water sample
Water seep
Water level) P U×V Δ

PID Photo ionisation detector (ppm)
PL(A) Point load axial test Is(50) (MPa)
PL(D) Point load diametral test Is(50) (MPa)
pp Pocket penetrometer (KPa)
S Standard penetration test
V Shear vane (kPa)







CLIENT: Taronga Conservation Society Australia

PROJECT: Taronga Wildlife Hospital, Sydney - Nutrition Centre EASTING: 337224

LOCATION: Bradleys Head Road, Mosman

SURFACE LEVEL: 67.9 AHD BORE No: WH7

EASTING: 337224 **PROJECT No**: 99931.00 **NORTHING**: 6253936 **DATE**: 13/1/2021

NORTHING: 6253936 **DATE:** 13/1/2021 **DIP/AZIMUTH:** 90°/-- **SHEET** 1 OF 1

	5	Description	Degree of Weathering	jic	Rock Strength	Fracture	Discontinuities	Sa	mplii	ng &	n Situ Testing
귒	Depth (m)	of		rapt Log	Strength Medium Medium High High Ex High	Spacing (m)	B - Bedding J - Joint	Туре	% See	RQD %	Test Results &
	` ,	Strata	EW HW EW SW SW R	G	Ex Low Low Medium High Ex High Wery High Wery High	0.05	S - Shear F - Fault	Ļ	S S	R.	Comments
29	0.1 0.25	ASPHALTIC CONCRETE FILL/ROADBASE: Gravelly SAND, fine to medium, grey-brown, fine igneous gravel, with silt, moist FILL/SAND: yellow-brown, fine to medium, with fine sandstone gravel, moist, apparently medium dense						A/E A/E S			PID<1 ppm PID<1 ppm 4,4,4 N = 8 PID<1 ppm
ĒĒ	1.61	SANDSTONE: medium to coarse	 					(AL)			PID<1 ppm PL(A) = 1.8
99	-2	grained, red-brown, medium to high strength, moderately weathered, slightly fractured, Hawkesbury Sandstone						С	100	100	PL(A) = 1.4 PL(A) = 0.6
							0.04 500 1				PL(A) = 0.5
65	-3					 	2.84m: B0°, pl, ro, cly vn				PL(A) = 0.7
64	3.9						3.75m: B5°, pl, ro, mi				PL(A) = 1
83	-4	SANDSTONE: medium to coarse grained, pale grey, medium to high strength, fresh, slighty fractured, Hawkesbury Sandstone					4.04m: B0°, pl, ro, cly co 5mm 4.08m: B0°, pl, ro, cly co 5mm 4.65m: B0°, pl, ro, cly co 5mm	С	100	99	PL(A) = 1
											PL(A) = 1.2
62	-6 6.26 ·	SANDSTONE: medium to coarse grained, yellow-brown, medium to high strength, moderately weathered, slightly fractured,					6.26m: B0°, pl, ro, cly vn 6.36m: Cs, 30mm	С	100	98	PL(A) = 0.9
-6	-7	Hawkesbury Sandstone									PL(A) = 1.6
09	7.11 · -8	Bore discontinued at 7.11m - Target depth reached									1 L(A) = 1.0
69	-9										
28											

RIG: Hanjin D8 DRILLER: Hagstrom LOGGED: KR CASING: HQ to 1.6m

TYPE OF BORING: Solid flight auger (TC-bit) to 1.61m, NMLC drilling to 7.11m **WATER OBSERVATIONS:** No free groundwater observed whilst augering

REMARKS:

SAMPLING & IN SITU TESTING LEGEND												
A Auger sample	G	Gas sample	PID	Photo ionisation detector (ppm)								
B Bulk sample	Р	Piston sample	PL(A)) Point load axial test ls(50) (MPa)								
BLK Block sample	U,	Tube sample (x mm dia.)	PL(D	Point load diametral test (s(50) (MPa)								
C Core drilling	WÎ	Water sample	pp `	Pocket penetrometer (kPa)								
D Disturbed sample	⊳	Water seep	S	Standard penetration test								
E Environmental comple	•	Motor level	1/	Chaar vana (kDa)								







BOREHOLE LOG

CLIENT: Taronga Conservation Society Australia

PROJECT: Taronga Wildlife Hospital, Sydney - Nutrition Centre **EASTING**: 337250

LOCATION: Bradleys Head Road, Mosman

SURFACE LEVEL: 71.6 AHD BORE No: WH8 EASTING: 337250 PROJECT No: 99931.00

NORTHING: 6253945

DATE: 13/1/2021 **SHEET** 1 OF 1

DIP/AZIMUTH: 90°/--

	5	Description	Degree of Weathering	ji	Rock Strength	Fracture	Discontinuities	Sa			n Situ Testing
R	Depth (m)	of	Degree of Weathering	raph	Strength Nedium Medium High Strigh Kary High Ex High Strig	Spacing (m)	B - Bedding J - Joint	Type	se.	RQD %	Test Results &
	()	Strata	EW HW EW SW SW SW SW SW SW SW SW SW SW SW SW SW	Ŋ	EX Low Low High High EX High	0.05	S - Shear F - Fault	È	Re co	X	Comments
14.	0.03 ⁻ 0.1 ⁷	ASPHALTIC CONCRETE FILL/ROADBASE: Gravelly SAND, fine to medium, grey-brown, fine igneous gravel, with silt, moist, apparently medium dense						A/E A/E			PID<1 ppm PID=1 ppm
02	· 1	FILL/SAND: fine to medium, brown, grey and yellow, with fine sandstone and igneous gravel, clay, silt, trace ash, apparently medium dense to dense						A/E* S/E A/E			PID<1 ppm 6,6,6 N = 12 PID<1 ppm PID<1 ppm
	· 2	\(\frac{4.20-1.45m: low plasticity,}{yellow-brown sandy clay fill band}\) SANDSTONE: medium to coarse grained, red-brown then pale grey						С	100	100	PL(A) = 1.1
. 69		and yellow, high strength, moderately to slightly weathered, unbroken, Hawkesbury Sandstone									PL(A) = 1.4
	· 3						>>				PL(A) = 1.1
-8-	-4 4.0	SANDSTONE: medium to coarse						С	100	96	
29	- 5	grained, pale grey, high then medium strength, fresh, slighty fractured, Hawkesbury Sandstone									PL(A) = 1.4
99							5.23m: B10°, pl, ro, cly co 1mm 5.32m: Bx2, 5°, pl, ro, cly co 1mm 5.7m: B5°, pl, ro cly co				PL(A) = 0.6
65	6 6.0	SANDSTONE: medium grained with 20-40% fine grained laminations, pale grey, medium to high strength, fresh, slightly fractured, Hawkesbury Sandstone					10mm 6.16m: B0°, pl, ro, cly co 2mm				PL(A) = 0.7
	-7						7.2m: Cs, 30mm	С	100	99	
.28	· 8										PL(A) = 0.9
63	8.51	8.30-8.51m: high strength band Bore discontinued at 8.51m					8.33m: B5°, pl, ro, cly co				PL(A) = 1.2
	-9	- Target depth reached									
62											

RIG: Hanjin D8 DRILLER: Hagstrom LOGGED: KR CASING: HQ to 1.5m

TYPE OF BORING: Solid flight auger (TC-bit) to 1.55m, NMLC drilling to 8.51m **WATER OBSERVATIONS:** No free groundwater observed whilst augering

REMARKS: *Blind duplicate taken at 0.9-1.0m (BD2/20210113).

		SAMPLING	& IN SITU TESTING	3 LEGE	ND
Α	Auger sample	G	Gas sample	PID	Photo ionisa
В	Bulk sample	Р	Piston sample	PL(A)	Point load a
DII	Diseles and all		Table in factor and a line in		Deint land of

LK Block sample

Core drilling

Disturbed sample

Environmental sample

Water seep

Water level

LEGEND
PID Photo ionisation detector (ppm)
PL(A) Point load axial test Is(50) (MPa)
PL(D) Point load diametral test Is(50) (MPa)
pp Pocket penetrometer (kPa)
S Standard penetration test
V Shear vane (kPa)







BOREHOLE LOG

CLIENT: Taronga Conservation Society Australia

PROJECT: Taronga Wildlife Hospital, Sydney - Nutrition Centre EASTING: 337218

LOCATION: Bradleys Head Road, Mosman

SURFACE LEVEL: 62.4 AHD BORE No: WH9

DIP/AZIMUTH: 90°/--

EASTING: 337218 **PROJECT No:** 99931.00 **NORTHING:** 6253889 **DATE:** 15/1/2021

SHEET 1 OF 2

	Description	Degree of Weathering	<u>.</u> 2	Rock Strength	Fracture	Discontinuities		•	•	In Situ Testino
Depth (m)	of	Weathering	rapt	Strength Near High Near Hi	Spacing (m)	B - Bedding J - Joint	Туре	».	RQD %	Test Result &
` ,	Strata	EW HW SW FR FR	Ō	Ex Lov Very I High Very I Very I	0.05	S - Shear F - Fault	7	လို့ လို့	RG %	Comments
0.05	\PAVERS /	-					A/E	1		PID<1 ppm
- 0.7	FILL/SAND: fine to medium, grey-brown, brown and dark brown, with silt, trace fine igneous, sandstone gravel and ash, moist SANDSTONE: medium to coarse						A/E*			PID=1 ppm PID=2 ppm PL(A) = 0.6
-1 - - - - -	grained, yellow-brown then pale grey, medium to high strength, slightly weathered, slightly fractured, Hawkesbury Sandstone						С	100	99	PL(A) = 0.8
-2 -2 - - - - - - - 2.53						1.85m: B0°, pl, ro, cly co 1mm 1.86m: B0°, pl, ro, cly co 1mm 2.36m: B0°, ir, ro, cly co				PL(A) = 0.9
- - - - 3	SANDSTONE: medium to coarse grained, pale grey then yellow-brown, medium strength with very low strength and clay					10mm 2.52m: B0°, pl, ro, cly co 10mm 2.64m: Ds, 30mm	С	100	68	DI (A)
3.41	bands, highly to moderately weathered, fractured, Hawkesbury Sandstone SANDSTONE: medium to coarse					2.67m: Cs, 50mm 2.72m: Ds, 60mm 2.78m: Cs, 20mm 3.1m: B0°, pl, ro, cly co				PL(A) = 0.7 PL(A) = 1
4.33	grained, yellow-brown and pale grey, medium to high strength, moderately weathered and fresh, slightly fractured, Hawkesbury Sandstone		***************************************			1mm 3.2m: B0°, pl, ro, mi 3.32m: B0°, pl, ro, cly vn 3.38m: B0°, pl, ro, cly vn 3.4m: Cs, 10mm 4.28m: CORE LOSS: 50mm	С	98	94	PL(A) = 0.7
• • • •						5.39m: Cs, 30mm				PL(A) = 0.
- - -6										PL(A) = 1.:
- - - - - 6.67							С	100	79	PL(A) = 0.9
-7 7	SANDSTONE: medium to coarse grained, pale grey and dark grey, moderately weathered and fresh, fractured, Hawkesbury Sandstone 6.70-8.40m: siltstone clasts and					6.74m: Ds, 30mm 6.84m: Cs, 20mm 6.86m: Ds, 40mm 7m: Ds, 80mm 7.18m: B5°, un, pl, sm,				PL(A) = 0.
- - - - - 8	bands					\cly vn -7.41m: B5°, ir, ro, cly co 1mm 7.92m: Ds, 80mm	С	100	97	PL(A) = 0.
8.3 - - - - - - 9	SANDSTONE: medium to coarse grained, pale grey, medium to high strength, fresh, slighltly fractured, Hawkesbury Sandstone	- 				8.65m: B0°, pl, ro, cly co 5mm				PL(A) = 0.
-										PL(A) = 1.

RIG: Hanjin D8 DRILLER: Hagstrom LOGGED: KR CASING: HQ to 1.6m

TYPE OF BORING: Solid flight auger (TC-bit) to 0.70m, NMLC drilling to 10.19m **WATER OBSERVATIONS:** No free groundwater observed whilst augering

REMARKS: *Blind duplicate taken at 0.4-0.5m (BD4/20210115).

SAMPLING & IN SITU TESTING LEGEND

Auger sample
B Bulk sample
BLK Block sample
C Core drilling
C Core drilling
D Disturbed sample
E Environmental sample

W Water sample
W Water level

PID Photo ionisation detector (ppm)
PL(A) Point load axial test Is(50) (MPa)
PL(D) Point load diametral test Is(50) (MPa)
pp Pocket penetrometer (KPa)
S Standard penetration test
V Shear vane (kPa)



BOREHOLE LOG

CLIENT: Taronga Conservation Society Australia

PROJECT: Taronga Wildlife Hospital, Sydney - Nutrition Centre **EASTING**: 337218

LOCATION: Bradleys Head Road, Mosman

SURFACE LEVEL: 62.4 AHD BORE No: WH9

EASTING: 337218 **PROJECT No:** 99931.00 **NORTHING:** 6253889 **DATE:** 15/1/2021

DIP/AZIMUTH: 90°/-- **SHEET** 2 OF 2

		Description	Degree of Weathering	<u>.</u>	Rock Strength ู้	Fracture	Discontinuities	1			n Situ Testing
뮙	Depth (m)	of	Wodinoring	raph	Strength Nedium Medium Welvery High Serv High Serv High Serv High Services	Spacing (m)	B - Bedding J - Joint	Туре	ore %	RQD %	Test Results &
	. ,	Strata	M M M W M M M M M M M M M M M M M M M M	9	Ex Low Low High Very Very Ex High	0.00	S - Shear F - Fault	Ļ	Rec	RC ,	Comments
-	10.19	Bore discontinued at 10.19m									PL(A) = 1.2
25		- Target depth reached									
[
ĖĖ	-11										
[
-51											
Ė	- 12										
-83											
[- 13										
ŧ											
- 49											
Ė											
	- 14										
-84											
ŧ	- 15										
<u> </u>											
4											
	- 16										
- 											
46											
ŧ											
	- 17										
45											
[]			1111								
	-18										
44											
[]			1111								
<u> </u>	- 19										
43			11111								
[

RIG: Hanjin D8 DRILLER: Hagstrom LOGGED: KR CASING: HQ to 1.6m

TYPE OF BORING: Solid flight auger (TC-bit) to 0.70m, NMLC drilling to 10.19m **WATER OBSERVATIONS:** No free groundwater observed whilst augering

REMARKS: *Blind duplicate taken at 0.4-0.5m (BD4/20210115).

SAMPLING & IN SITU TESTING LEGEND

Auger sample
B Bulk sample
BLK Block sample
C Core drilling
C Core drilling
D Disturbed sample
E Environmental sample


W Water sample
W Water level

PID Photo ionisation detector (ppm)
PL(A) Point load axial test Is(50) (MPa)
PL(D) Point load diametral test Is(50) (MPa)
pp Pocket penetrometer (kPa)
S Standard penetration test
V Shear vane (kPa)







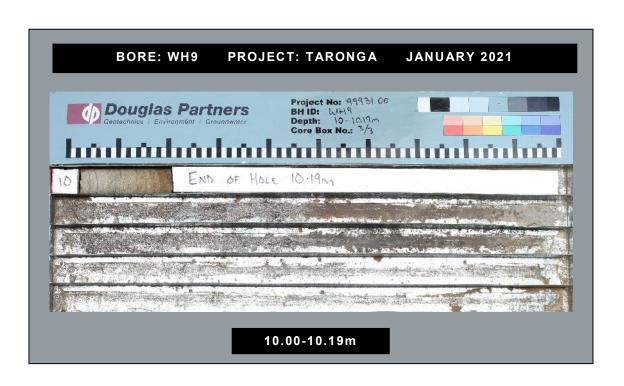



Douglas Partners Pty Ltd ABN 75 053 980 117 www.douglaspartners.com.au 96 Hermitage Road West Ryde NSW 2114 PO Box 472 West Ryde NSW 1685 Phone (02) 9809 0666 Fax (02) 9809 4095

Results of Dynamic Penetrometer Tests

ClientTaronga Conservation Society AustraliaProject No.99931.00ProjectTaronga Wildlife Hospital, Sydney - Nutrition CentreDate20-21/01/2021

Location Bradleys Head Road, MOSMAN Page No. 1 of 1

	1	ı	T				I	1	1
Test Locations	10	11	12						
RL of Test (AHD)	61.5*	62.9	62.3						
Depth (m)		Penetration Resistance							
		I			Blows/150 r	mm I	<u> </u>	1	1
0.00 – 0.15	7	3	3						
0.15 – 0.30	3	6	6						
0.30 - 0.45	21	2	4						
0.45 - 0.60	17	10/50	25						
0.60 - 0.75	22	D	40						
0.75 – 0.90	18		R						
0.90 – 1.05	17								
1.05 – 1.20	18								
1.20 – 1.35	21								
1.35 – 1.50	50/100								
1.50 – 1.65	R								
1.65 – 1.80									
1.80 – 1.95									
1.95 – 2.10									
2.10 – 2.25									
2.25 – 2.40									
2.40 – 2.55									
2.55 – 2.70									
2.70 – 2.85									
2.85 – 3.00									
3.00 – 3.15									
3.15 – 3.30									
3.30 – 3.45									

Test Method

Remarks

AS 12829.6.3.2, Cone Penetrometer

B = Bouncing, D = Discontinued, R = Refusal

Tested By KR Checked By SB

50 / 100 indicates 50 blows for 100 mm penetration, * Level approximate only - survey not available and interference from nearby structures prevented accurate dGPD reading.

 \square

Sampling Methods Douglas Partners On the sample of the s

Sampling

Sampling is carried out during drilling or test pitting to allow engineering examination (and laboratory testing where required) of the soil or rock.

Disturbed samples taken during drilling provide information on colour, type, inclusions and, depending upon the degree of disturbance, some information on strength and structure.

Undisturbed samples are taken by pushing a thinwalled sample tube into the soil and withdrawing it to obtain a sample of the soil in a relatively undisturbed state. Such samples yield information on structure and strength, and are necessary for laboratory determination of shear strength and compressibility. Undisturbed sampling is generally effective only in cohesive soils.

Test Pits

Test pits are usually excavated with a backhoe or an excavator, allowing close examination of the insitu soil if it is safe to enter into the pit. The depth of excavation is limited to about 3 m for a backhoe and up to 6 m for a large excavator. A potential disadvantage of this investigation method is the larger area of disturbance to the site.

Large Diameter Augers

Boreholes can be drilled using a rotating plate or short spiral auger, generally 300 mm or larger in diameter commonly mounted on a standard piling rig. The cuttings are returned to the surface at intervals (generally not more than 0.5 m) and are disturbed but usually unchanged in moisture content. Identification of soil strata is generally much more reliable than with continuous spiral flight augers, and is usually supplemented by occasional undisturbed tube samples.

Continuous Spiral Flight Augers

The borehole is advanced using 90-115 mm diameter continuous spiral flight augers which are withdrawn at intervals to allow sampling or in-situ testing. This is a relatively economical means of drilling in clays and sands above the water table. Samples are returned to the surface, or may be collected after withdrawal of the auger flights, but they are disturbed and may be mixed with soils from the sides of the hole. Information from the drilling (as distinct from specific sampling by SPTs or undisturbed samples) is of relatively low

reliability, due to the remoulding, possible mixing or softening of samples by groundwater.

Non-core Rotary Drilling

The borehole is advanced using a rotary bit, with water or drilling mud being pumped down the drill rods and returned up the annulus, carrying the drill cuttings. Only major changes in stratification can be determined from the cuttings, together with some information from the rate of penetration. Where drilling mud is used this can mask the cuttings and reliable identification is only possible from separate sampling such as SPTs.

Continuous Core Drilling

A continuous core sample can be obtained using a diamond tipped core barrel, usually with a 50 mm internal diameter. Provided full core recovery is achieved (which is not always possible in weak rocks and granular soils), this technique provides a very reliable method of investigation.

Standard Penetration Tests

Standard penetration tests (SPT) are used as a means of estimating the density or strength of soils and also of obtaining a relatively undisturbed sample. The test procedure is described in Australian Standard 1289, Methods of Testing Soils for Engineering Purposes - Test 6.3.1.

The test is carried out in a borehole by driving a 50 mm diameter split sample tube under the impact of a 63 kg hammer with a free fall of 760 mm. It is normal for the tube to be driven in three successive 150 mm increments and the 'N' value is taken as the number of blows for the last 300 mm. In dense sands, very hard clays or weak rock, the full 450 mm penetration may not be practicable and the test is discontinued.

The test results are reported in the following form.

 In the case where full penetration is obtained with successive blow counts for each 150 mm of, say, 4, 6 and 7 as:

> 4,6,7 N=13

In the case where the test is discontinued before the full penetration depth, say after 15 blows for the first 150 mm and 30 blows for the next 40 mm as:

15, 30/40 mm

Sampling Methods

The results of the SPT tests can be related empirically to the engineering properties of the soils.

Dynamic Cone Penetrometer Tests / Perth Sand Penetrometer Tests

Dynamic penetrometer tests (DCP or PSP) are carried out by driving a steel rod into the ground using a standard weight of hammer falling a specified distance. As the rod penetrates the soil the number of blows required to penetrate each successive 150 mm depth are recorded. Normally there is a depth limitation of 1.2 m, but this may be extended in certain conditions by the use of extension rods. Two types of penetrometer are commonly used.

- Perth sand penetrometer a 16 mm diameter flat ended rod is driven using a 9 kg hammer dropping 600 mm (AS 1289, Test 6.3.3). This test was developed for testing the density of sands and is mainly used in granular soils and filling.
- Cone penetrometer a 16 mm diameter rod with a 20 mm diameter cone end is driven using a 9 kg hammer dropping 510 mm (AS 1289, Test 6.3.2). This test was developed initially for pavement subgrade investigations, and correlations of the test results with California Bearing Ratio have been published by various road authorities.

Soil Descriptions Douglas Partners

Description and Classification Methods

The methods of description and classification of soils and rocks used in this report are generally based on Australian Standard AS1726:2017, Geotechnical Site Investigations. In general, the descriptions include strength or density, colour, structure, soil or rock type and inclusions.

Soil Types

Soil types are described according to the predominant particle size, qualified by the grading of other particles present:

Туре	Particle size (mm)
Boulder	>200
Cobble	63 - 200
Gravel	2.36 - 63
Sand	0.075 - 2.36
Silt	0.002 - 0.075
Clay	<0.002

The sand and gravel sizes can be further subdivided as follows:

Туре	Particle size (mm)
Coarse gravel	19 - 63
Medium gravel	6.7 - 19
Fine gravel	2.36 – 6.7
Coarse sand	0.6 - 2.36
Medium sand	0.21 - 0.6
Fine sand	0.075 - 0.21

Definitions of grading terms used are:

- Well graded a good representation of all particle sizes
- Poorly graded an excess or deficiency of particular sizes within the specified range
- Uniformly graded an excess of a particular particle size
- Gap graded a deficiency of a particular particle size with the range

The proportions of secondary constituents of soils are described as follows:

In fine grained soils (>35% fines)

III line grained soils (>35% lines)						
Term	Proportion	Example				
	of sand or					
	gravel					
And	Specify	Clay (60%) and				
		Sand (40%)				
Adjective	>30%	Sandy Clay				
With	15 – 30%	Clay with sand				
Trace	0 - 15%	Clay with trace				
		sand				

In coarse grained soils (>65% coarse)

- with clavs or silts

- with clays of site)	
Term	Proportion of fines	Example
And	Specify	Sand (70%) and Clay (30%)
Adjective	>12%	Clayey Sand
With	5 - 12%	Sand with clay
Trace	0 - 5%	Sand with trace
		clay

In coarse grained soils (>65% coarse)

- with coarser fraction

With coalsel fraction						
Term	Proportion	Example				
	of coarser					
	fraction					
And	Specify	Sand (60%) and				
		Gravel (40%)				
Adjective	>30%	Gravelly Sand				
With	15 - 30%	Sand with gravel				
Trace	0 - 15%	Sand with trace				
		gravel				

The presence of cobbles and boulders shall be specifically noted by beginning the description with 'Mix of Soil and Cobbles/Boulders' with the word order indicating the dominant first and the proportion of cobbles and boulders described together.

Soil Descriptions

Cohesive Soils

Cohesive soils, such as clays, are classified on the basis of undrained shear strength. The strength may be measured by laboratory testing, or estimated by field tests or engineering examination. The strength terms are defined as follows:

Description	Abbreviation	Undrained shear strength (kPa)
Very soft	VS	<12
Soft	S	12 - 25
Firm	F	25 - 50
Stiff	St	50 - 100
Very stiff	VSt	100 - 200
Hard	Н	>200
Friable	Fr	-

Cohesionless Soils

Cohesionless soils, such as clean sands, are classified on the basis of relative density, generally from the results of standard penetration tests (SPT), cone penetration tests (CPT) or dynamic penetrometers (PSP). The relative density terms are given below:

Relative Density	Abbreviation	Density Index (%)
Very loose	VL	<15
Loose	L	15-35
Medium dense	MD	35-65
Dense	D	65-85
Very dense	VD	>85

Soil Origin

It is often difficult to accurately determine the origin of a soil. Soils can generally be classified as:

- Residual soil derived from in-situ weathering of the underlying rock;
- Extremely weathered material formed from in-situ weathering of geological formations.
 Has soil strength but retains the structure or fabric of the parent rock;
- Alluvial soil deposited by streams and rivers;

- Estuarine soil deposited in coastal estuaries;
- Marine soil deposited in a marine environment;
- Lacustrine soil deposited in freshwater lakes;
- Aeolian soil carried and deposited by wind;
- Colluvial soil soil and rock debris transported down slopes by gravity;
- Topsoil mantle of surface soil, often with high levels of organic material.
- Fill any material which has been moved by man.

Moisture Condition - Coarse Grained Soils

For coarse grained soils the moisture condition should be described by appearance and feel using the following terms:

- Dry (D) Non-cohesive and free-running.
- Moist (M) Soil feels cool, darkened in colour.

Soil tends to stick together.

Sand forms weak ball but breaks easily.

Wet (W) Soil feels cool, darkened in colour.

Soil tends to stick together, free water forms when handling.

Moisture Condition - Fine Grained Soils

For fine grained soils the assessment of moisture content is relative to their plastic limit or liquid limit, as follows:

- 'Moist, dry of plastic limit' or 'w <PL' (i.e. hard and friable or powdery).
- 'Moist, near plastic limit' or 'w ≈ PL (i.e. soil can be moulded at moisture content approximately equal to the plastic limit).
- 'Moist, wet of plastic limit' or 'w >PL' (i.e. soils usually weakened and free water forms on the hands when handling).
- 'Wet' or 'w ≈LL' (i.e. near the liquid limit).
- 'Wet' or 'w >LL' (i.e. wet of the liquid limit).

Rock Descriptions Douglas Partners The second control of the sec

Rock Strength

Rock strength is defined by the Unconfined Compressive Strength and it refers to the strength of the rock substance and not the strength of the overall rock mass, which may be considerably weaker due to defects.

The Point Load Strength Index $Is_{(50)}$ is commonly used to provide an estimate of the rock strength and site specific correlations should be developed to allow UCS values to be determined. The point load strength test procedure is described by Australian Standard AS4133.4.1-2007. The terms used to describe rock strength are as follows:

Strength Term	Abbreviation	Unconfined Compressive Strength MPa	Point Load Index * Is ₍₅₀₎ MPa
Very low	VL	0.6 - 2	0.03 - 0.1
Low	L	2 - 6	0.1 - 0.3
Medium	M	6 - 20	0.3 - 1.0
High	Н	20 - 60	1 - 3
Very high	VH	60 - 200	3 - 10
Extremely high	EH	>200	>10

^{*} Assumes a ratio of 20:1 for UCS to $ls_{(50)}$. It should be noted that the UCS to $ls_{(50)}$ ratio varies significantly for different rock types and specific ratios should be determined for each site.

Degree of Weathering

The degree of weathering of rock is classified as follows:

Term	Abbreviation	Description		
Residual Soil	RS	Material is weathered to such an extent that it has soil properties. Mass structure and material texture and fabric of original rock are no longer visible, but the soil has not been significantly transported.		
Extremely weathered	XW	Material is weathered to such an extent that it has soil properties. Mass structure and material texture and fabric of original rock are still visible		
Highly weathered	HW	The whole of the rock material is discoloured, usually by iron staining or bleaching to the extent that the colour of the original rock is not recognisable. Rock strength is significantly changed by weathering. Some primary minerals have weathered to clay minerals. Porosity may be increased by leaching, or may be decreased due to deposition of weathering products in pores.		
Moderately weathered	MW	The whole of the rock material is discoloured, usually by iron staining or bleaching to the extent that the colour of the original rock is not recognisable, but shows little or no change of strength from fresh rock.		
Slightly weathered	SW	Rock is partially discoloured with staining or bleaching along joints but shows little or no change of strength from fresh rock.		
Fresh	FR	No signs of decomposition or staining.		
Note: If HW and MW cannot be differentiated use DW (see below)				
Distinctly weathered	DW	Rock strength usually changed by weathering. The rock may be highly discoloured, usually by iron staining. Porosity may be increased by leaching or may be decreased due to deposition of weathered products in pores.		

Rock Descriptions

Degree of Fracturing

The following classification applies to the spacing of natural fractures in diamond drill cores. It includes bedding plane partings, joints and other defects, but excludes drilling breaks.

Term	Description
Fragmented	Fragments of <20 mm
Highly Fractured	Core lengths of 20-40 mm with occasional fragments
Fractured	Core lengths of 30-100 mm with occasional shorter and longer sections
Slightly Fractured	Core lengths of 300 mm or longer with occasional sections of 100-300 mm
Unbroken	Core contains very few fractures

Rock Quality Designation

The quality of the cored rock can be measured using the Rock Quality Designation (RQD) index, defined as:

RQD % = <u>cumulative length of 'sound' core sections ≥ 100 mm long</u> total drilled length of section being assessed

where 'sound' rock is assessed to be rock of low strength or stronger. The RQD applies only to natural fractures. If the core is broken by drilling or handling (i.e. drilling breaks) then the broken pieces are fitted back together and are not included in the calculation of RQD.

Stratification Spacing

For sedimentary rocks the following terms may be used to describe the spacing of bedding partings:

Term	Separation of Stratification Planes
Thinly laminated	< 6 mm
Laminated	6 mm to 20 mm
Very thinly bedded	20 mm to 60 mm
Thinly bedded	60 mm to 0.2 m
Medium bedded	0.2 m to 0.6 m
Thickly bedded	0.6 m to 2 m
Very thickly bedded > 2 m	

Symbols & Abbreviations Douglas Partners

Introduction

These notes summarise abbreviations commonly used on borehole logs and test pit reports.

Drilling or Excavation Methods

C Core drilling
R Rotary drilling
SFA Spiral flight augers
NMLC Diamond core - 52 mm dia
NQ Diamond core - 47 mm dia

NQ Diamond core - 47 mm dia HQ Diamond core - 63 mm dia PQ Diamond core - 81 mm dia

Water

Sampling and Testing

A Auger sample
 B Bulk sample
 D Disturbed sample
 E Environmental sample

U₅₀ Undisturbed tube sample (50mm)

W Water sample

pp Pocket penetrometer (kPa)
PID Photo ionisation detector
PL Point load strength Is(50) MPa
S Standard Penetration Test

V Shear vane (kPa)

Description of Defects in Rock

The abbreviated descriptions of the defects should be in the following order: Depth, Type, Orientation, Coating, Shape, Roughness and Other. Drilling and handling breaks are not usually included on the logs.

Defect Type

B Bedding plane
Cs Clay seam
Cv Cleavage
Cz Crushed zone
Ds Decomposed seam

F Fault
J Joint
Lam Lamination
Pt Parting
Sz Sheared Zone

V Vein

Orientation

The inclination of defects is always measured from the perpendicular to the core axis.

h horizontal
v vertical
sh sub-horizontal
sv sub-vertical

Coating or Infilling Term

cln clean
co coating
he healed
inf infilled
stn stained
ti tight
vn veneer

Coating Descriptor

ca calcite
cbs carbonaceous
cly clay
fe iron oxide
mn manganese
slt silty

Shape

cu curved
ir irregular
pl planar
st stepped
un undulating

Roughness

po polished
ro rough
sl slickensided
sm smooth
vr very rough

Other

fg fragmented bnd band qtz quartz

Symbols & Abbreviations

Graphic Symbols for Soil and Rock					
General		Sedimentary	Rocks		
	Asphalt		Boulder conglomerate		
	Road base		Conglomerate		
A. A. A. Z B. B. B. L	Concrete		Conglomeratic sandstone		
	Filling		Sandstone		
Soils		. — . — . —	Siltstone		
	Topsoil	• • • • • • • •	Laminite		
* * * * * * * * * * * * * * * * * * * *	Peat		Mudstone, claystone, shale		
	Clay		Coal		
	Silty clay		Limestone		
/:/:/:/ <u>;</u>	Sandy clay	Metamorphic	Rocks		
	Gravelly clay	~~~~	Slate, phyllite, schist		
-/-/-/- -/-/-/-/-	Shaly clay	- + + + + +	Gneiss		
	Silt		Quartzite		
	Clayey silt	Igneous Roc	ks		
	Sandy silt	+ + + + + + + + + + + + + + + + + + + +	Granite		
	Sand	<	Dolerite, basalt, andesite		
	Clayey sand	× × × × × × × × × × × × × × × × × × ×	Dacite, epidote		
	Silty sand	\vee \vee \vee	Tuff, breccia		
	Gravel		Porphyry		
	Sandy gravel				
	Cobbles, boulders				

_			_	_
Ar	pe	ndi	İΧ	D

Photographs of Existing Shotcrete to the West of the Main Guard House



Photo 1 - Towards the north, looking south



Photo 2 - Towards the south, looking north



Shotcrete Wall Photos	PROJECT:	99931.00	
Taronga Wildlife Hospital, Sydney	PLATE No:	S1	
- Nutrition Centre	REV:	0	
CLIENT: Taronga Conservation Soc.	DATE:	16-Feb-21	

Appendix E

Laboratory Test Results

Client Reference: 99931.00, Taronga Zoo Wildlife Hospital

Misc Inorg - Soil					
Our Reference		260047-9	260047-13	260047-15	260047-17
Your Reference	UNITS	WH4	WH6	WH7	WH8
Depth		2.4-2.5	0.9-1.0	1.4-1.5	1.45-1.55
Date Sampled		14/01/2021	14/01/2021	14/01/2021	14/01/2021
Type of sample		SOIL	SOIL	SOIL	SOIL
Date prepared	-	21/01/2021	21/01/2021	21/01/2021	21/01/2021
Date analysed	-	21/01/2021	21/01/2021	21/01/2021	21/01/2021
pH 1:5 soil:water	pH Units	5.0	7.6	9.0	8.5
Total Organic Carbon (Walkley Black)	mg/kg	5,600	[NA]	2,000	[NA]
Electrical Conductivity 1:5 soil:water	μS/cm	[NA]	48	[NA]	120
Chloride, Cl 1:5 soil:water	mg/kg	[NA]	<10	[NA]	<10
Sulphate, SO4 1:5 soil:water	mg/kg	[NA]	10	[NA]	57

Envirolab Reference: 260047 Revision No: R01