


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Penshurst Public School (2861)
Region : Sydney
State Electorate : Oatley
Local Government Area : Hurstville

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

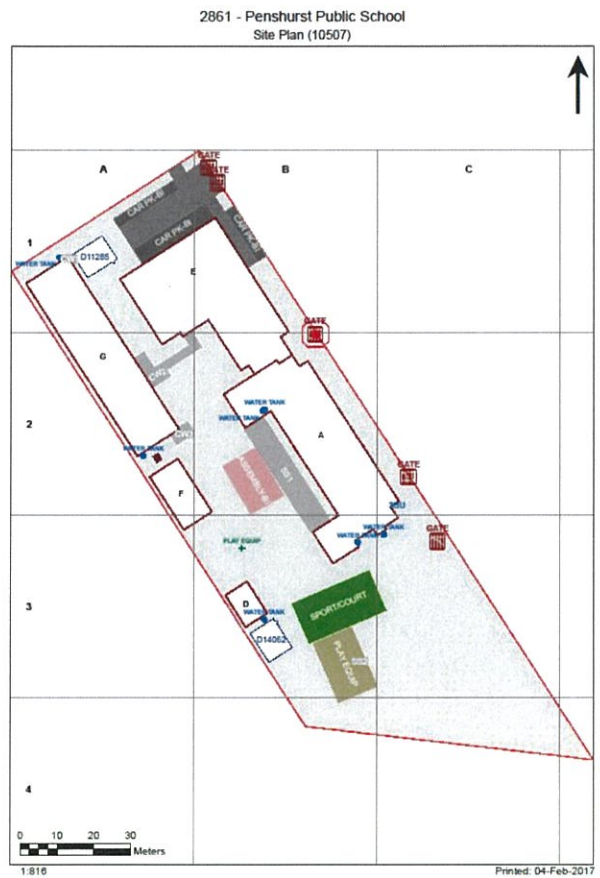

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning/Library - 1924 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids	No Asbestos Found					
Ceiling Void	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	2861/B00A/Ceiling Void/S12				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

Interior**B00A - R0001 - Withdrawal Space - 1hb**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	

B00A - R0002 - Home Base

No Asbestos

B00A - R0003 - Home Base

No Asbestos

B00A - R0006 - Home Base

Chalk Board	Flat AC Sheeting	11m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R0007/Chalk Board/S6				Chrysotile (white asbestos)	

B00A - R0007 - Home Base

Chalk Board	Flat AC Sheeting	11m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R0007/Chalk Board/S6				Chrysotile (white asbestos)	

B00A - R0008 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	

B00A - R0009 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	2861/B00A/R0034/Wall Linings Internal/S1					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2861/B00A/R0034/Wall Linings Internal/S1					

B00A - R0011 - Movement

No Asbestos

B00A - R0012 - General Assistant/Bulk Store

No Asbestos

B00A - R0013 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2861/B00A/R0026/Wall Linings Internal/S2					

B00A - R0014 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2861/B00A/R0026/Wall Linings Internal/S2					

B00A - R0015 - Movement

No Asbestos

B00A - R0016 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2861/B00A/R0034/Wall Linings Internal/S1					

B00A - R0023 - Security Store

No Asbestos

B00A - R0024 - Staff Toilet

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
No Asbestos						
B00A - R0025 - Toilets - Girls						
Wall Linings Internal	Flat AC Sheeting 2861/B00A/R0026/Wall Linings Internal/S2					No Asbestos Detected
B00A - R0026 - Toilets - Boys						
Wall Linings Internal	Flat AC Sheeting 2861/B00A/R0026/Wall Linings Internal/S2					No Asbestos Detected
B00A - R0027 - Movement						
No Asbestos						
B00A - R0028 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting 2861/B00A/R1021/Ceiling Structures/Linings/S5	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R0030 - Movement						
Wall Linings Internal	Flat AC Sheeting 2861/B00A/R0034/Wall Linings Internal/S1					No Asbestos Detected
B00A - R0031 - Stairs						
No Asbestos						
B00A - R0032 - Special Programs Room						
Ceiling Structures/Linings	Flat AC Sheeting 2861/B00A/R1021/Ceiling Structures/Linings/S5	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 2861/B00A/R0034/Wall Linings Internal/S1					No Asbestos Detected
B00A - R0033 - Practical Activities - 1hb						
No Asbestos						
B00A - R0034 - Withdrawal Space - 1hb						
Wall Linings Internal	Flat AC Sheeting 2861/B00A/R0034/Wall Linings Internal/S1					No Asbestos Detected
B00A - R0035 - Library Office/Workroom						
No Asbestos						
B00A - R0036 - Communications Room						
No Asbestos						
B00A - R0037 - Practical Activities - 1hb						
No Asbestos						
B00A - R0038 - Withdrawal Space - 1hb						
No Asbestos						
B00A - R0040 - Home Base						
No Asbestos						
B00A - R0041 - Movement						
No Asbestos						
B00A - R0042 - Movement						
No Asbestos						
B00A - R0043 - Stairs						
No Asbestos						
B00A - R0044 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting 2861/B00A/R0045/Ceiling Structures/Linings/S10	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00A - R0045 - Reading Area						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	115m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2861/B00A/R0045/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00A - R1001 - Withdrawal Space - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		
B00A - R1004 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		
B00A - R1007 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		
B00A - R1008 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		
B00A - R1009 - Practical Activities - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		
B00A - R1011 - Uniform Shop						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		
B00A - R1012 - Home Base Store						
No Asbestos						
B00A - R1019 - Home Base Store						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
2861/B00A/R0034/Wall Linings Internal/S1						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		
B00A - R1020 - Home Base Store						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		
B00A - R1021 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	124m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		
B00A - R1022 - Withdrawal Space - 1hb						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
2861/B00A/R0034/Wall Linings Internal/S1						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		
B00A - R1023 - Practical Activities - 1hb						
No Asbestos						
B00A - R1024 - Home Base Store						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2861/B00A/R1021/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)		
B00A - R1025 - Home Base Store						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00A - R1026 - Withdrawal Space - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00A - R1027 - Practical Activities - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00A - R1028 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00A - R1029 - Stairs						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00A - R1030 - Withdrawal Space - 1hb						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2861/B00A/R0034/Wall Linings Internal/S1					
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00A - R1031 - Practical Activities - 1hb						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2861/B00A/R0034/Wall Linings Internal/S1					
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00A - R1032 - Home Base						
No Asbestos						
B00A - R1033 - Home Base						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2861/B00A/R0034/Wall Linings Internal/S1					
Ceiling Structures/Linings	Flat AC Sheeting	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00A - R1034 - Withdrawal Space - 1hb						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2861/B00A/R0034/Wall Linings Internal/S1					
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00A - R1035 - Practical Activities - 1hb						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2861/B00A/R0034/Wall Linings Internal/S1					
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
B00A - R1036 - Special Programs Room						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	2861/B00A/R0034/Wall Linings Internal/S1					
Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2861/B00A/R1021/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1037 - Stairs						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pre-School Facilities - 1924 - Brick/Block (Brick/Block)

Exterior

Wall Cladding	Flat AC Sheeting 2861/B00D/Wall Cladding/S4					No Asbestos Detected
Underfloor Void	Non Accessible Area - No Manhole to access underfloor void					
Ceiling Void	\C Fragments/Debris 2861/B00D/Ceiling Void/S11	2m2	North	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)						

Interior

B00D - R0001 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 2861/B00D/R0005/Wall Linings Internal/S3					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00D - R0002 - Home Base - Pre

Ceiling Structures/Linings	Flat AC Sheeting 2861/B00D/R0002/Ceiling Structures/Linings/S9	46m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)						

B00D - R0005 - Access Shower/Toilet

Wall Linings Internal	Flat AC Sheeting 2861/B00D/R0005/Wall Linings Internal/S3					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Administration - 1999 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00E - R0001 - Disabled Toilet**

No Asbestos

B00E - R0002 - Sports Store

No Asbestos

B00E - R0003 - General Assistant/Bulk Store

No Asbestos

B00E - R0004 - Hall Chair Store

No Asbestos

B00E - R0005 - Staff Toilet

No Asbestos

B00E - R0006 - Communal Space

No Asbestos

B00E - R0007 - Raised Platform

No Asbestos

B00E - R0008 - Staff Toilet

No Asbestos

B00E - R0009 - Cleaning Supplies

No Asbestos

B00E - R0010 - Movement

No Asbestos

B00E - R0011 - P.E. Store

No Asbestos

B00E - R0012 - Movement

No Asbestos

B00E - R0013 - Movement

No Asbestos

B00E - R0014 - Cleaning Supplies

No Asbestos

B00E - R0015 - Canteen

No Asbestos

B00E - R0016 - Canteen Office/Store

No Asbestos

B00E - R0017 - Main Switch Board

No Asbestos

B00E - R0018 - Communications Room

No Asbestos

B00E - R0019 - Distribution Board

No Asbestos

Note: No inspection of live electrical installation.

B00E - R0020 - Movement

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0021 - Interview

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0022 - Security Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0023 - Staff Toilet

No Asbestos

B00E - R0024 - Staff Toilet

No Asbestos

B00E - R0025 - Staff Toilet

No Asbestos

B00E - R0026 - Staff Toilet

No Asbestos

B00E - R0027 - Clerical Office

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0028 - Duplicating Workroom

No Asbestos

B00E - R0029 - Disabled Toilet

No Asbestos

B00E - R0030 - Sick Bay

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0031 - Staff Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0032 - Staff Room Annexe

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0033 - Deputy Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0034 - Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0035 - Movement

No Asbestos

B00E - R0036 - Movement

No Asbestos

B00E - R0037 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1918 - Timber (Timber)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Void	Non Accessible Area - No Access - Projector and wires make access to manhole impossible

Interior

B00F - R0001 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	
	2861/B00F/R0001/Floor Coverings Res/Textile/S7	No Asbestos Detected

B00F - R0002 - Home Base

No Asbestos

B00F - R0003 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles	
	2861/B00F/R0003/Floor Coverings Res/Textile/S8	No Asbestos Detected

B00F - R0004 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Special Purpose Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00G - R0001 - Special Programs Room - Type 2

No Asbestos

B00G - R0002 - Home Base Store

No Asbestos

B00G - R0003 - Home Base

No Asbestos

B00G - R0004 - Home Base Store

No Asbestos

B00G - R0005 - Practical Activities

No Asbestos

B00G - R0006 - Withdrawal Space - 2hb

No Asbestos

B00G - R0007 - Home Base

No Asbestos

B00G - R0008 - Home Base Store

No Asbestos

B00G - R0009 - Practical Activities

No Asbestos

B00G - R0010 - Home Base

No Asbestos

B00G - R0011 - Home Base Store

No Asbestos

B00G - R0012 - Practical Activities

No Asbestos

B00G - R0013 - Withdrawal Space - 2hb

No Asbestos

B00G - R0014 - Home Base

No Asbestos

B00G - R0015 - Home Base Store

No Asbestos

B00G - R0016 - Practical Activities - 1hb

No Asbestos

B00G - R0017 - Home Base

No Asbestos

B00G - R0018 - Home Base Store

No Asbestos

B00G - R0019 - Withdrawal Space - 1hb

No Asbestos

B00G - R0020 - Practical Activities - 1hb

No Asbestos

B00G - R0021 - Special Programs Room

No Asbestos

B00G - R0022 - Special Programs Store

No Asbestos

B00G - R0023 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11285 - Learning Unit - Standard With P.A.A. : Placement Date - 25/07/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14062 - Learning Unit - Standard With P.A.A. : Placement Date - 23/11/2012

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017