


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Darlington Public School (1735)
Region : Sydney
State Electorate : Newtown
Local Government Area : Sydney

Initial Survey : Noel Arnold & Associates : 05 - May - 2008
Reviewed By : Parsons Brinckerhoff : 28 - Feb - 2017

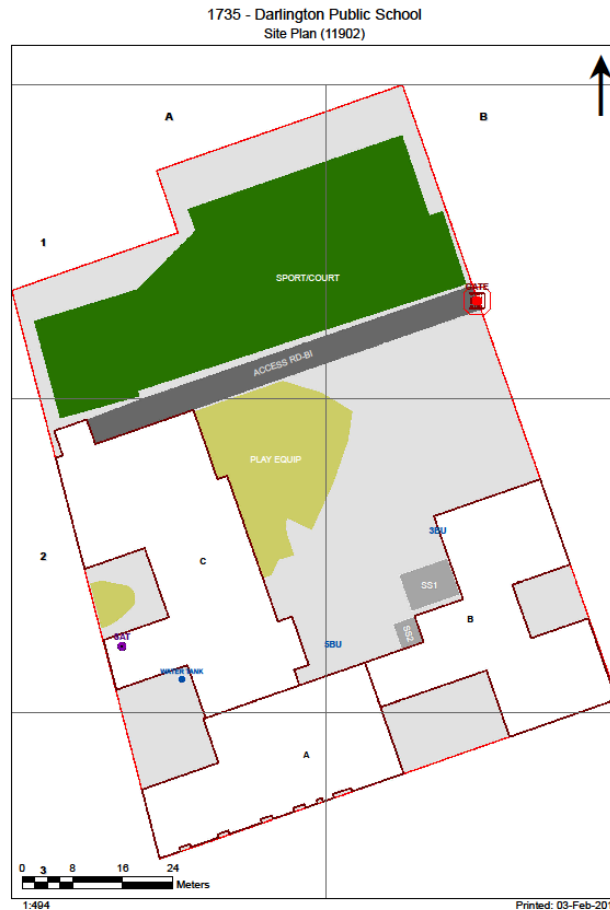

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1990 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior**B00A - R0002 - General Storeroom (27.02 m2)**

No Asbestos

B00A - R0003 - General Storeroom (10.32 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0004 - Interview (9.88 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0005 - General Storeroom (8.97 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0006 - General Storeroom (15.02 m2)

Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0007 - Interview (11.76 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0008 - Deputy Principal (11.82 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0009 - Sick Bay (8.41 m2)

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0010 - Staff Room Annexe (12 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0011 - Principal (18.05 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0012 - Clerical Office/Workroom (20.81 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0013 - Deputy Principal (3.52 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0013/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00A - R0014 - Entry Vestibule (11.88 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R0015 - Movement (48.59 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R0016 - Clerical Office (18.42 m2)						
Ceiling Structures/Linings	Vermiculite					
1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0017 - Duplicating Workroom (17.46 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00A - R0018 - Distribution Board (0.93 m2)						
No Asbestos						Note: No inspection of live electrical installation.
B00A - R0019 - Movement (1.58 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R0020 - General Storeroom (5.27 m2)						
No Asbestos						
B00A - R0021 - Staff Toilet (6.06 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0021/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
B00A - R0022 - Staff Toilet (6.02 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0021/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
B00A - R0023 - Staff Shower/Change (5.98 m2)						
No Asbestos						
B00A - R0024 - General Storeroom (14.58 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0025 - Canteen (34.16 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0027/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00A - R0026 - Staff Toilet (3.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0027/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00A - R0027 - General Storeroom (5.06 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0027/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00A - R0029 - Toilets - Girls (24.89 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0021/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
B00A - R0030 - Toilets - Boys (27.96 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	28m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0021/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
B00A - R0031 - Movement (5.43 m2)						
No Asbestos						
B00A - R0032 - Security Store (11.7 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R0034 - Stairs (3.91 m2)						
No Asbestos						
B00A - R0035 - Practical Activities - 1hb (14.44 m2)						
No Asbestos						
B00A - R0036 - Home Base (68.07 m2)						
No Asbestos						
B00A - R0037 - Movement (9.49 m2)						
No Asbestos						
B00A - R1001 - Home Base (54.49 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R1002 - Home Base (81.08 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1003 - Reading Area (169.24 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R1004 - Library Office/Workroom (16.14 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R1005 - Communications Room (12.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1006 - Library Office/Workroom (4.9 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R1007 - Distribution Board (0.93 m2)						
No Asbestos					Note: No inspection of live electrical installation.	
B00A - R1008 - Movement (21.34 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R1009 - Toilets - Boys (5.03 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0021/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
B00A - R1010 - Toilets - Girls (5.03 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0021/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1011 - Cleaning Supplies (8.61 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R1012 - Movement (78.63 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R1013/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00A - R1013 - Toilets - Boys (16.86 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R1013/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R1014 - Toilets - Girls (15.04 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R1013/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R0009/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00A - R1015 - Disabled Toilet (3.53 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R1013/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00A - R1016 - Movement (30.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R1013/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00A - R1017 - Movement (14.21 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00A - R1018 - Staff Toilet (6.29 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R0021/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)
B00A - R1019 - Staff Toilet (6.58 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R0021/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)
B00A - R1020 - Stairs (5.3 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Other-After School Care - 1990 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00B - R0001 - Security Store (8.11 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0002 - Home Base Store (21.36 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0003 - Staff Room Annexe (9.39 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0004 - Withdrawal Space - 1hb (9.32 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0005 - Home Base (52.41 m2)

Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00B - R0006 - Practical Activities - 1hb (14.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R0027/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00B - R0007 - Movement (67.92 m2)

No Asbestos

B00B - R0008 - Cleaning Distributed Store (5.13 m2)

No Asbestos

B00B - R0009 - General Storeroom (8.83 m2)

No Asbestos

B00B - R0010 - Sports Store (6.54 m2)

No Asbestos

B00B - R0011 - Main Switch Board (4.63 m2)

No Asbestos

B00B - R0012 - Toilets - Boys/Girls (2.54 m2)

No Asbestos

B00B - R0013 - Staff Toilet (2.74 m2)

No Asbestos

B00B - R0014 - Out Of School Hours Care Centre (114.45 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0015 - Cleaning Distributed Store (1.04 m2)

No Asbestos

B00B - R0016 - Security Store (11.95 m2)

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0017 - Practical Activities - 1hb (15.51 m2)						
No Asbestos						
B00B - R0018 - Home Base (71.18 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00B - R0019 - Movement (25.77 m2)						
No Asbestos						
B00B - R0020 - Home Base (72.69 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00B - R0021 - Practical Activities - 1hb (24.99 m2)						
No Asbestos						
B00B - R0022 - Movement (31.47 m2)						
No Asbestos						
B00B - R0023 - Practical Activities - 1hb (10.3 m2)						
Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0024 - Home Base (71.75 m2)						
Ceiling Structures/Linings	Vermiculite					
	1735/B00A/R0009/Ceiling Structures/Linings/S3					Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00B - R0025 - Stairs (9.89 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R1013/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00B - R1002 - Practical Activities - 1hb (12.3 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R0027/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00B - R1003 - Practical Activities - 1hb (14.73 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R0027/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00B - R1004 - Home Base (70.83 m2)						
No Asbestos						
B00B - R1006 - Cleaning Supplies (15.66 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R1013/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B00B - R1007 - Practical Activities - 1hb (16.12 m2)						
No Asbestos						
B00B - R1008 - Home Base (54.65 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00B - R1009 - Distribution Board (0.97 m2)						
No Asbestos						
Note: No inspection of live electrical installation.						
B00B - R1010 - Home Base (55.77 m2)						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
B00B - R1011 - Practical Activities - 1hb (15.48 m2)						
No Asbestos						
B00B - R1012 - Stairs (16.64 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R1013/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting					
	1735/B00B/R1012/Wall Linings Internal/S7				No Asbestos Detected	

B00B - R1013 - Movement (52.81 m2)

No Asbestos

B00B - R1014 - Home Base (104.61 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - General Learning/Communal Facilities - 1990 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00C/Eaves Linings/S10			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					

Interior**B00C - R0001 - External Movement (2.88 m2)**

No Asbestos

B00C - R0002 - Movement (67.39 m2)

Ceiling Structures/Linings	Flat AC Sheeting	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R1013/Ceiling Structures/Linings/S6			Chrysotile (white asbestos)		

B00C - R0003 - Practical Activities - 1hb (20.07 m2)

Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R0027/Floor Coverings Res/Textile/S5			Chrysotile (white asbestos)		

B00C - R0004 - Home Base (67.25 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0005 - Movement (45.95 m2)

Ceiling Structures/Linings	Flat AC Sheeting	46m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R1013/Ceiling Structures/Linings/S6			Chrysotile (white asbestos)		

B00C - R0006 - Staff Kitchen (29.16 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1735/B00C/R0008/Floor Coverings Res/Textile/S8			No Asbestos Detected		

B00C - R0007 - Home Base Store (4.84 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0008 - Practical Activities - 1hb (26.74 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	1735/B00C/R0008/Floor Coverings Res/Textile/S8			No Asbestos Detected		

B00C - R0010 - Toilets - Boys/Girls (14.54 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R0021/Partition Walls (Cubicles)/S4			Chrysotile (white asbestos)		

B00C - R0011 - Staff Toilet (8.23 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R1013/Ceiling Structures/Linings/S6			Chrysotile (white asbestos)		

B00C - R0013 - General Storeroom (21.33 m2)

Ceiling Structures/Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	1735/B00A/R1013/Ceiling Structures/Linings/S6			Chrysotile (white asbestos)		

Floor Coverings Res/Textile	Vinyl Sheet					
	1735/B00C/R0008/Floor Coverings Res/Textile/S8			No Asbestos Detected		

B00C - R0014 - Garden Store (18.94 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R1013/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
1735/B00C/R0008/Floor Coverings Res/Textile/S8					No Asbestos Detected	
B00C - R0016 - Practical Activities - 1hb (15.88 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0027/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00C - R0017 - Home Base (68.16 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00C - R0018 - Practical Activities - 1hb (16.06 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
1735/B00C/R0008/Floor Coverings Res/Textile/S8					No Asbestos Detected	
B00C - R0019 - Home Base (66.5 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00C - R0020 - Distribution Board (0.92 m2)						
No Asbestos				Note: No inspection of live electrical installation.		
B00C - R0021 - Toilets - Boys/Girls (27.89 m2)						
No Asbestos						
B00C - R0022 - Security Store (13.38 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00A/R0027/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00C - R0023 - Movement (25.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00C/R0023/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00C - R0024 - Movement (9.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
1735/B00C/R0023/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
B00C - R0025 - Communal Space (141.69 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00C - R0029 - General Storeroom - Pre (14.14 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00C - R0030 - Home Base (93.85 m2)						
Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
B00C - R0031 - External Movement (1.12 m2)						
No Asbestos						
B00C - R0032 - Raised Platform (25.13 m2)						
No Asbestos						
B00C - R0033 - External Movement (7.27 m2)						
No Asbestos						
B00C - R0034 - Practical Activities - Pre (91.41 m2)						
No Asbestos						
B00C - R0035 - General Storeroom - Pre (3.18 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00C - R0036 - Laundry - Pre (3.16 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

1735_ASB_150514_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017