

The Sandstone Precinct

Heritage Conditions


Date
24 September 2017

Revision Number
02




EB: Bridge Street/LG level

Existing plan

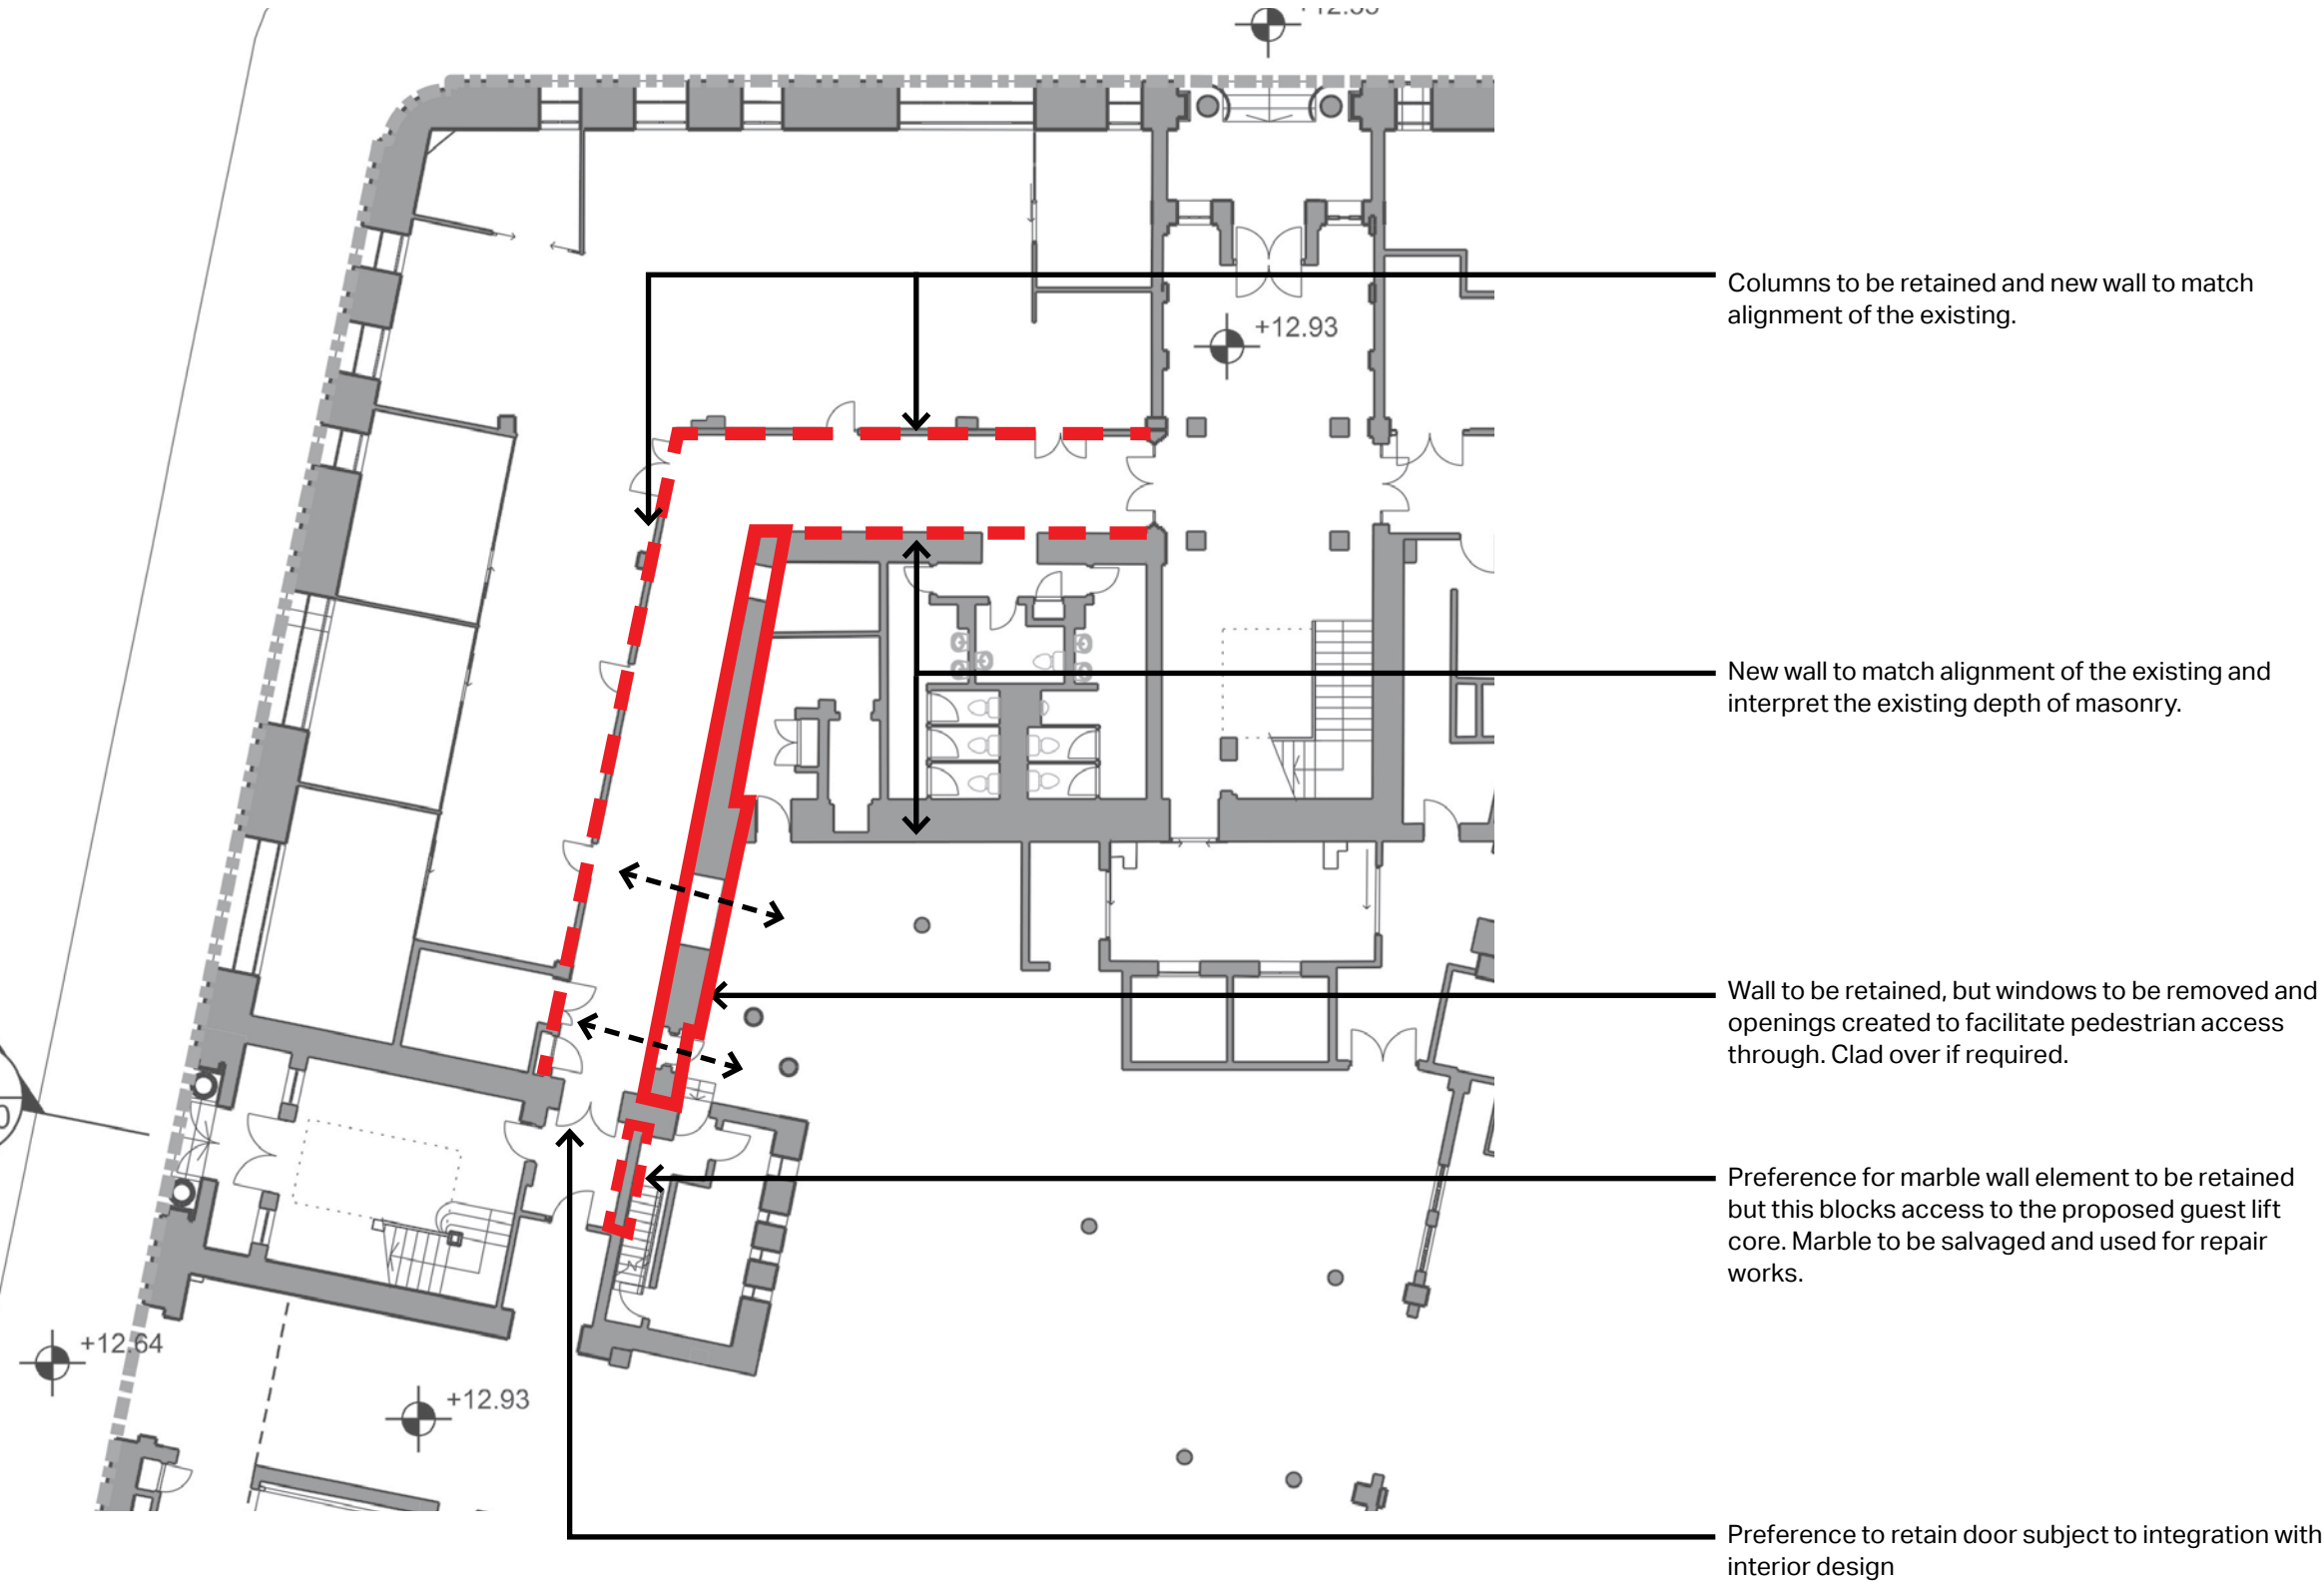

EB: Farrer Place/G level

Existing plan

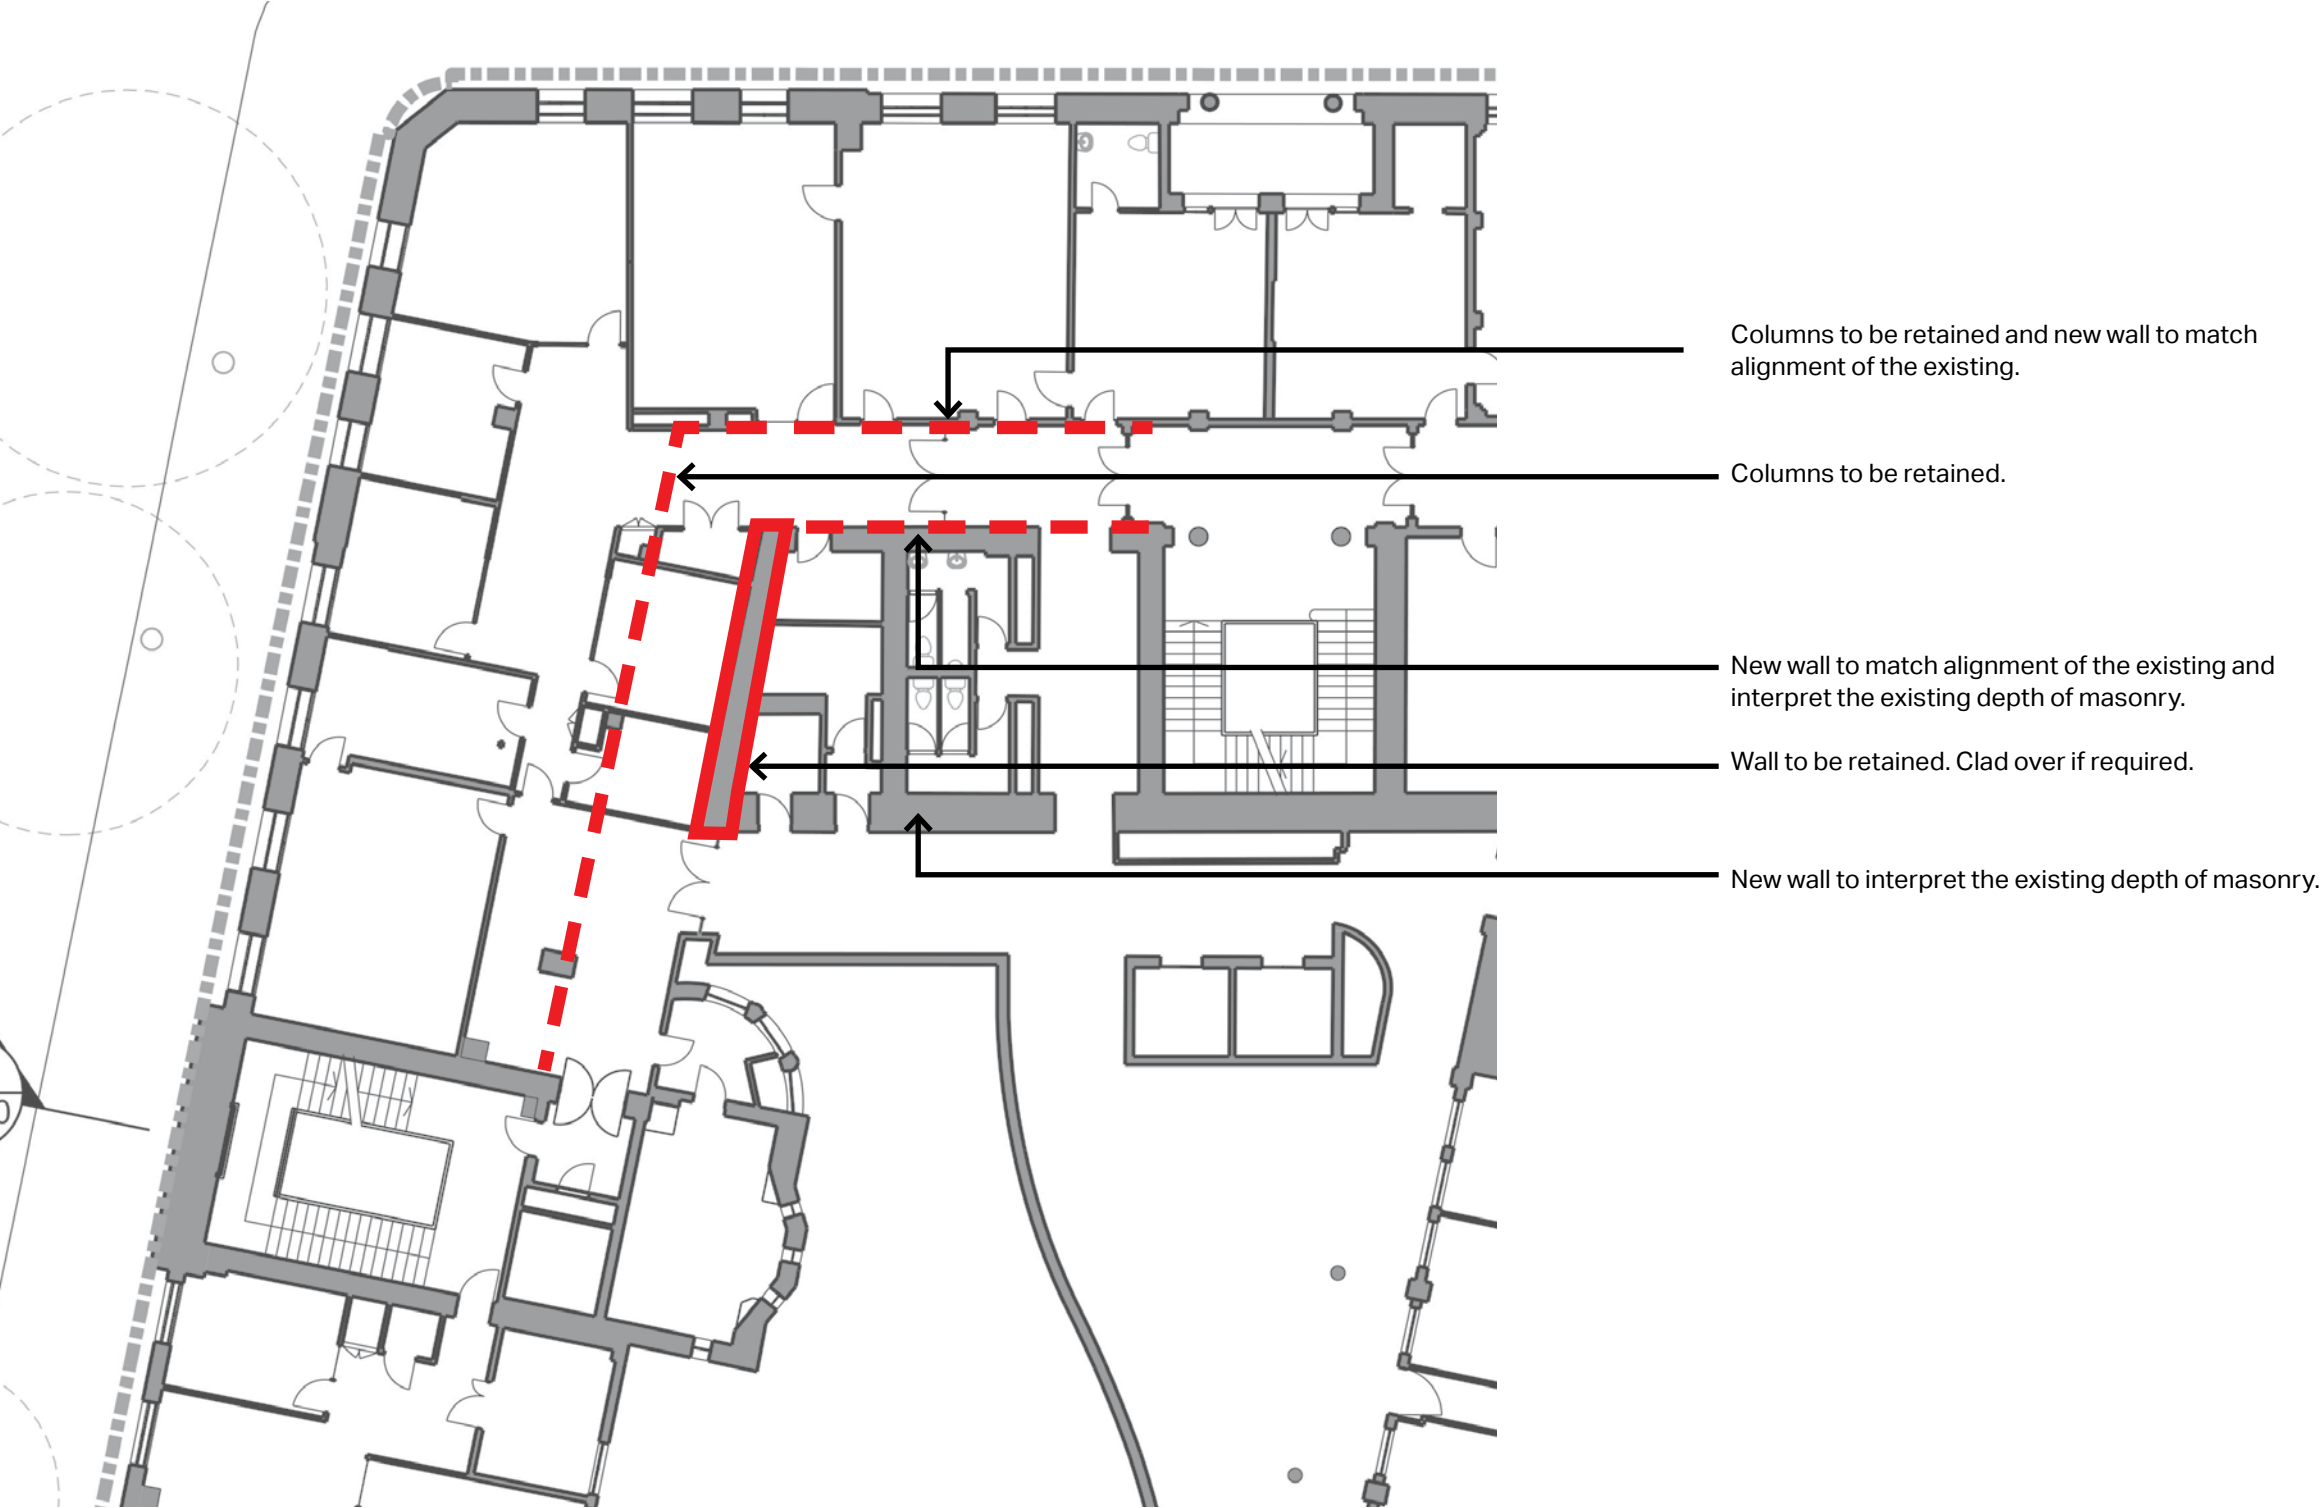

Columns to be retained and new wall to match alignment of the existing.

Columns to be retained.


New wall to match alignment of the existing and interpret the existing depth of masonry.

Wall to be retained. Clad over if required.

New wall to interpret the existing depth of masonry.

EB: Farrer Place/G level

Existing plan

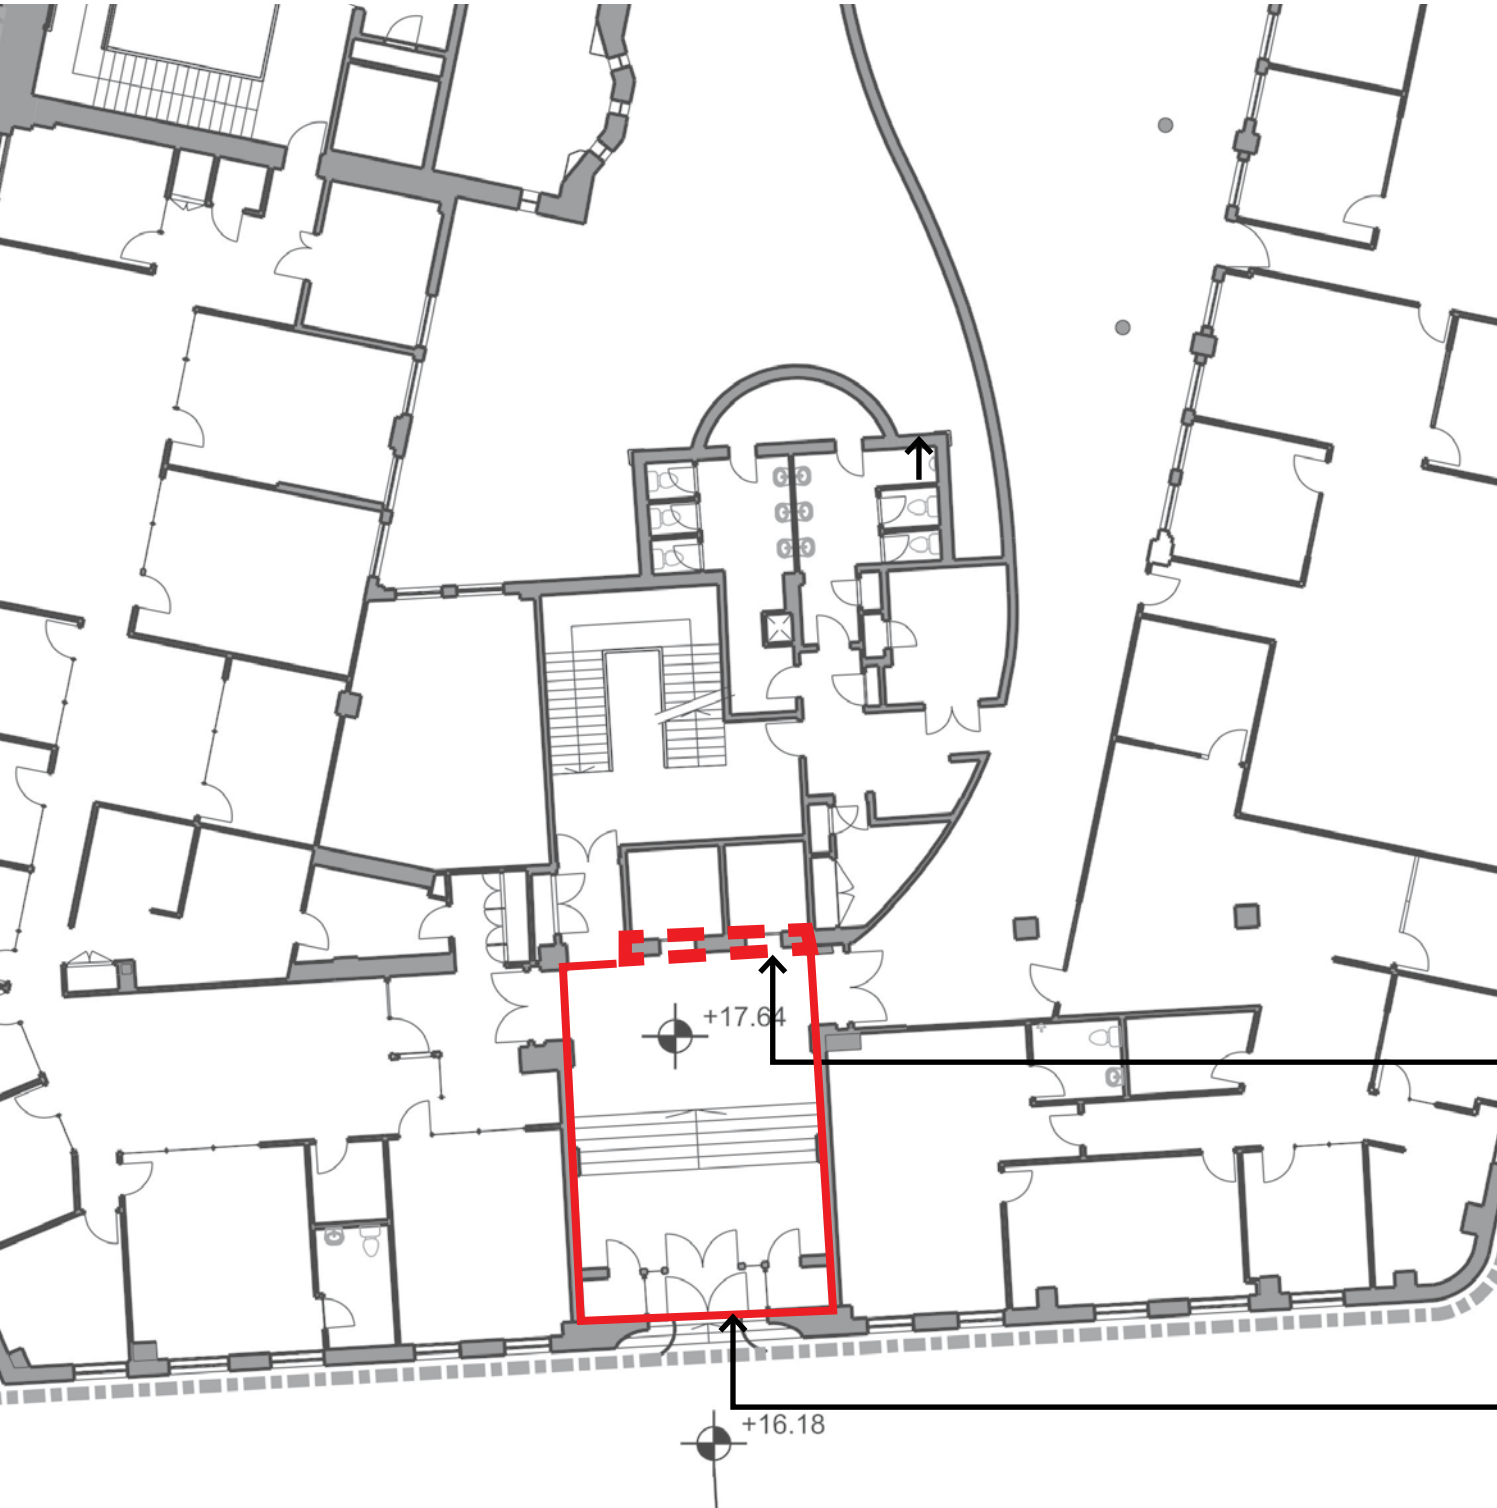

- Existing lift surround removed to enable clear access to the central sculpture courtyard. Marble and trachyte to be salvage and reused for on site repair works.
- Floor and ceiling to be clearly delineated between existing and new. Bulkhead element to be maintained.
- Last row of columns to be read in order to terminate the vestibule as a 'room'.



All other original elements of the vestibule to be retained

EB: Farrer Place/G level

Proposed plan



Materiality of infill to be investigated and details shown of the interface to the existing columns in order to minimise interventions.

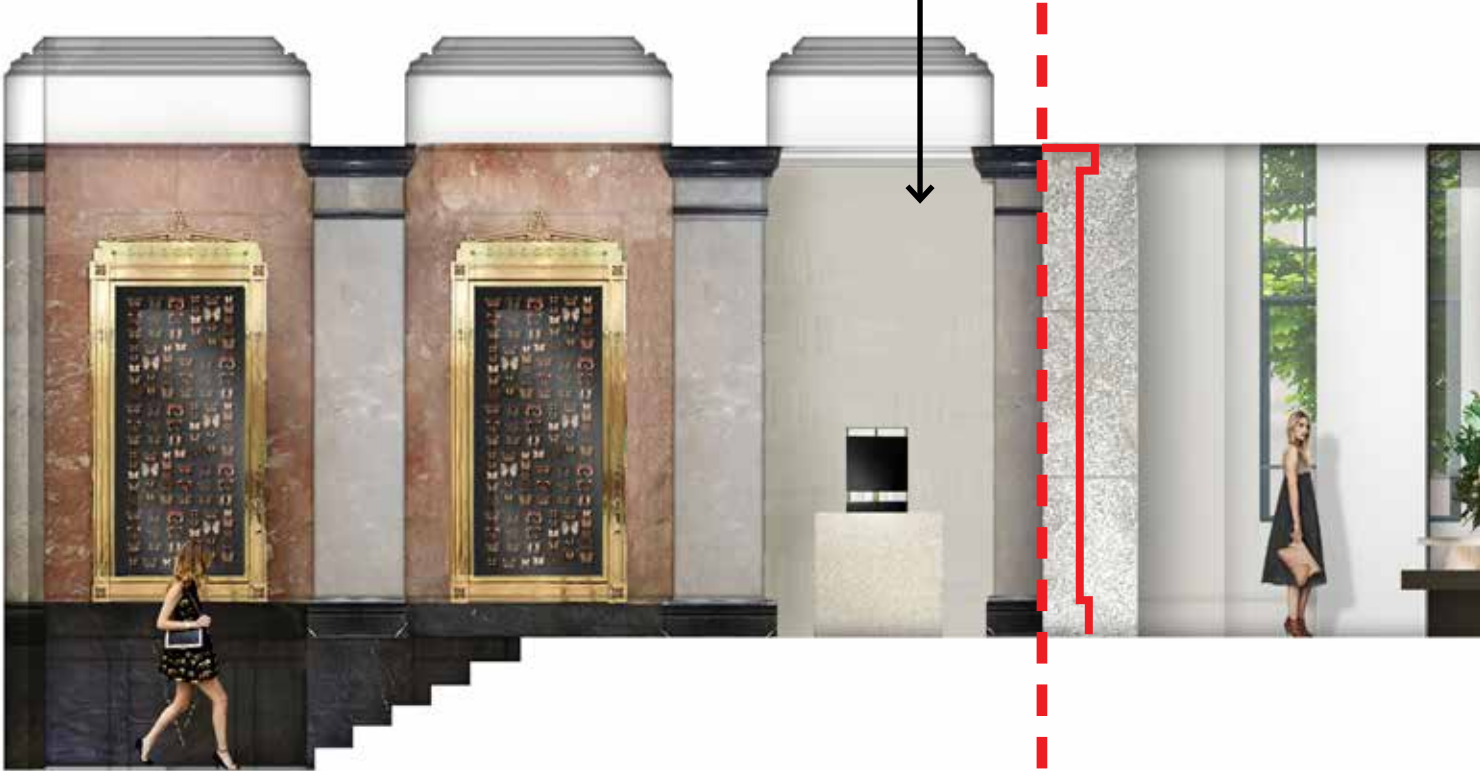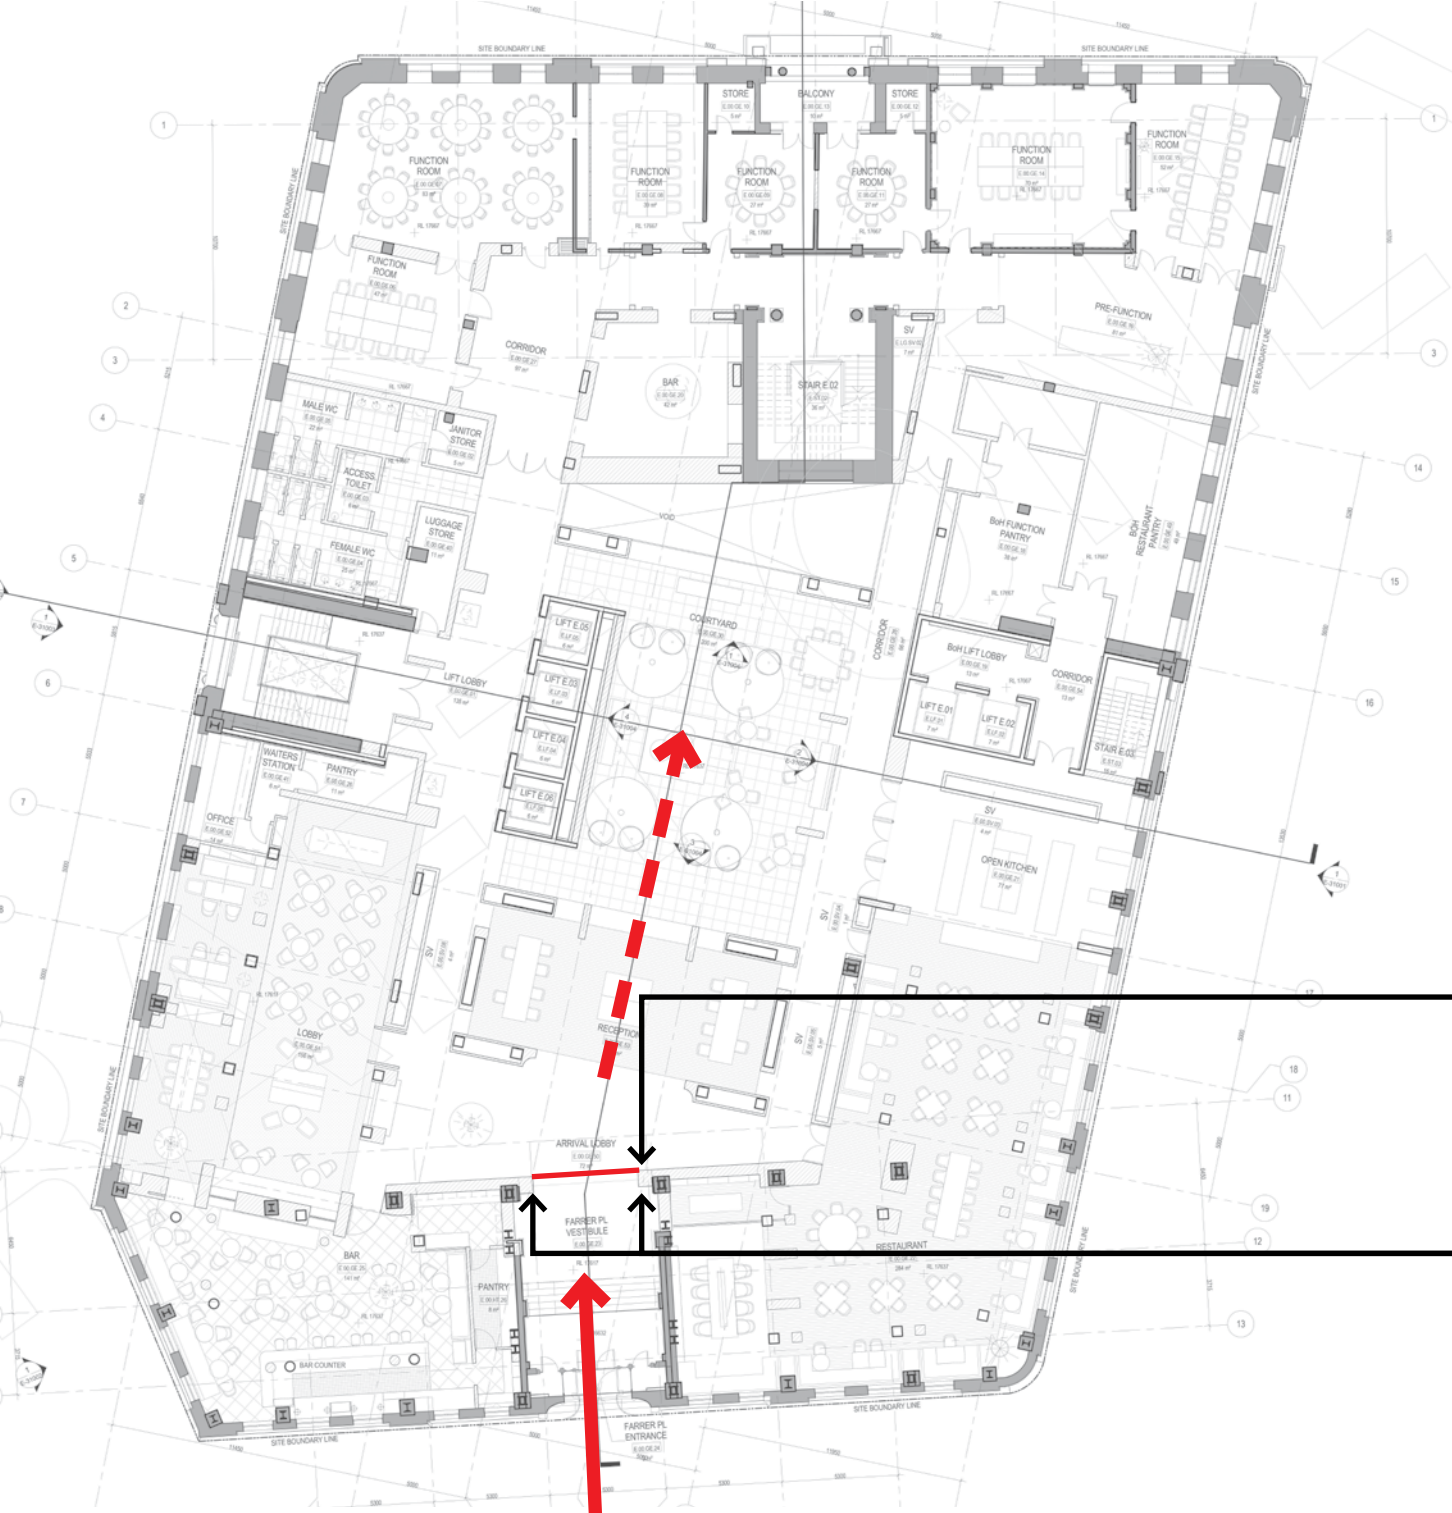

Farrer Place heritage vestibule

Arrival area

Change in floor finish clearly marked to delineate the heritage vestibule from the new reception area.

Existing columns to be 'completed' in order to terminate the vestibule. The 'completed' column element should draw on the existing form and proportions but not seek to imitate. The design to investigate a material that does not attempt to perfectly match the existing but is complementary, e.g. scagliola with an appropriate pigment. Avoid the use of nibs as currently shown.

EB: Farrer Place/G level

Proposed section

