

**PRELIMINARY GEOTECHNICAL
ASSESSMENT
'THE HAYMARKET'
STAGE 1 DEVELOPMENT
APPLICATION (DA) – SSDA2
(SICEEP)**

GEOTLCOV24303AG-AD
6 March 2013

6 March 2013

Lend Lease
The Bond
30 Hickson Road,
MILLERS POINT, NSW 2000

Attention: Warwick Bowyer

Dear Sir,

RE: Preliminary Geotechnical Assessment

Sydney International Convention Exhibition and Entertainment Precinct (SICEEP)

“The Haymarket” Stage 1 Development Application (DA) – SSDA2

Coffey Geotechnics Pty Ltd (Coffey) is pleased to present the results of a geotechnical assessment carried out for the proposed Sydney International Convention, Exhibition and Entertainment Precinct (SICEEP), southern precinct “The Haymarket” Stage 1 Development Application (DA) – SSDA2 in the following report.

Coffey understands that “The Haymarket” development is to include a mix of land uses including commercial office, residential; including student accommodation, retail and public open space. Residential podium and tower forms (up to 40 storeys) are proposed. Generally, car parking is proposed to be above grade within the podium. New infrastructure services (including diversions and augmentations) will be provided to service new developments. In addition, it is likely that excavation works associated with remediation and archaeological works will also be required.

Coffey Geotechnics has assessed the proposed development scheme in the context of the existing geotechnical conditions on the site and concludes that the site is suitable for its intended use.

While the site contains a number of geotechnical challenges including the presence of The Great Sydney Dyke, a high groundwater table, acid sulphate soils and rock at depth, Coffey is satisfied that these challenges can be adequately addressed through the utilisation of industry standard design and construction techniques and practices.

If you have any questions regarding our report please contact the undersigned on 9406 1000.

For and on behalf of Coffey Geotechnics Pty Ltd



Dan Butterworth

Engineering Geologist

Distribution: Original held by Coffey Geotechnics Pty Ltd
 1 copy held by Coffey Geotechnics Pty Ltd
 1 copy to Lend Lease

CONTENTS

1	INTRODUCTION	1
2	PROJECT OVERVIEW	1
2.1	General	1
2.2	Background	2
2.3	Site Description	2
2.4	Planning Approvals Strategy	3
3	THE HAYMARKET SITE AND PROPOSED DEVELOPMENT	5
4	DESK STUDY INFORMATION	5
4.1	Geology and Site History	5
4.2	Previous Geotechnical Investigations	5
5	PRELIMINARY GEOTECHNICAL MODEL	7
5.1	General Soil and Rock Profiles	7
5.2	Igneous Dyke	9
5.3	Fault and Shear Zones	9
5.4	Groundwater	9
6	PRELIMINARY DISCUSSION AND RECOMMENDATIONS	10
6.1	Excavations	10
6.1.1	Excavation Conditions	10
6.1.2	Bulk Excavation Batter Slopes	10
6.1.3	Excavation Support Requirements	10
6.1.4	Groundwater Conditions	11
6.1.5	Excavation Induced Ground Movements	12
6.2	Building Foundations	12
6.2.1	Expected Arrangements and Issues	12
6.2.2	Preliminary Foundation Design	13
6.3	Contingency Planning	14
6.4	Soil Aggressivity	14

CONTENTS

6.5	Seismic Design	15
6.6	Conclusion	15
6.7	Limitations and Further Geotechnical Investigations	15

Important Information About Your Coffey Report

Figures

Figure 1: Proposed Development Layout and Previous Borehole Locations

Figure 2: Inferred Base of Fill / Top of Alluvial Soil Contours

Figure 3: Inferred top of rock contours (Unit 4a – Class V and Class IV Sandstone)

Figure 4: Section A-A, Inferred Geological Conditions

Figure 5: Section B-B, Inferred Geological Conditions

Figure 6: Section C-C, Inferred Geological Conditions

1 INTRODUCTION

At the request of Lend Lease Lend Lease, Coffey Geotechnics Pty Ltd (Coffey) has carried out a preliminary geotechnical assessment for the proposed Sydney International Convention, Exhibition and Entertainment Precinct (SICEEP), southern precinct 'The Haymarket' Stage 1 Development Application (DA) – SSDA2. The objectives of the geotechnical assessment include:

- Development of a preliminary geotechnical model for the site based on site investigations carried out by Coffey, or information gathered by others for previous investigations;
- Assessment of the proposed development scheme in the context of the geotechnical conditions on the site and confirm that the site is, or can be made suitable for its intended use; and
- Provide preliminary assessment and recommendations for the following aspects in context of the proposed development(s) scheme:
 - Excavation conditions and support requirements;
 - Suitable building footing types and preliminary geotechnical parameters;
 - Groundwater conditions and dewatering requirements;
 - Expected soil aggressivity to buried structural elements;
 - Contingency planning for unexpected finds during works (both groundwater and soil);
 - Expected seismic design parameters; and
 - Presence of the Great Sydney Dyke and likely management requirements/considerations.

A contamination assessment and acid sulphate soils management plan are being carried out by Coffey concurrently with this assessment and will be reported separately.

2 PROJECT OVERVIEW

2.1 General

This report supports a State Significant Development Application (SSD 12_5752) submitted to the Minister for Planning and Infrastructure pursuant to Part 4 of the *Environmental Planning and Assessment Act 1979* (EP&A Act).

The Application seeks approval for the establishment of building envelopes and design parameters for a new neighbourhood and a community hub (referred to as The Haymarket) as part of the Sydney international convention, exhibition and entertainment precinct (SICEEP Project) at Darling Harbour.

The project will develop The Haymarket into one of Sydney's most innovative residential and working districts. Through the delivery of the overall project, Darling Harbour will also become home to Australia's largest convention and exhibition facilities, Sydney's largest red carpet entertainment venue, and a hotel complex of up to 900 rooms. The SICEEP Project importantly forms a critical element of the NSW Government's aspiration to "make NSW number one again".

2.2 Background

The existing convention, exhibition and entertainment centre facilities at Darling Harbour were constructed in the 1980s and have provided an excellent service for Sydney and NSW. The facilities however have limitations in their ability to service the contemporary exhibition and convention industry which has led to a loss in events being held in Sydney. The NSW Government considers that a precinct-wide renewal and expansion is necessary and is accordingly committed to Sydney reclaiming its position on centre stage for hosting world-class events with the creation of the Sydney international convention, exhibition and entertainment precinct.

Following an extensive and rigorous Expressions of Interest and Request for Proposals process, Darling Harbour Live (formerly known as 'Destination Sydney' - a consortium comprising AEG Ogden, Lend Lease, Capella Capital and Spotless) was announced by the NSW Government in December 2012 as the preferred proponent to transform Darling Harbour and create the new Sydney international convention, exhibition and entertainment Precinct.

Key features of the Darling Harbour Live Preferred Master Plan include:

- Delivering world-class convention, exhibition and entertainment facilities, including:
 - Up to 40,000m² exhibition space;
 - Over 8,000m² of meeting rooms space, across 40 rooms;
 - Overall convention space capacity for more than 12,000 people;
 - A ballroom capable of accommodating 2,000 people; and
 - A premium, red-carpet entertainment facility with a capacity of 8,000 persons.
- Providing up to 900 hotel rooms in a hotel complex at the northern end of the precinct.
- A vibrant and authentic new neighbourhood at the southern end of the precinct, called 'The Haymarket', home to an IQ Hub focused on the creative industries and high-tech businesses, apartments, student accommodation, shops, cafes and restaurants.
- Renewed and upgraded public domain, including an outdoor event space for up to 25,000 people at an expanded Tumbalong Park.
- Improved pedestrian connections linking to the proposed Ultimo Pedestrian Network drawing people between Central, Chinatown and Cockle Bay Wharf as well as east-west between Ultimo/Pymont and the City.

2.3 Site Description

The SICEEP Site is located within a 60 hectare waterfront precinct on the south-western edge of the Sydney Central Business District known as Darling Harbour that provides a mix of functions including recreational, tourist, entertainment and business. With an area of approximately 20 hectares, the SICEEP Site is generally bound by the Light Rail Line to the west, Harbourside Shopping Centre and Cockle Bay to the north, Darling Quarter, the Chinese Garden and Harbour Street to the east, and Hay Street to the south.

The SICEEP Site has been divided into three distinct redevelopment areas (from north to south) – Bayside, Darling Central and The Haymarket. The Application Site area relates to The Haymarket as shown below.




2.4 Planning Approvals Strategy

In response to separate contractual agreements with the NSW Government and staging requirements, Lend Lease (Haymarket) Pty Ltd is proposing to submit a number of separate development applications for key elements of the overall Project.

This staged development application involves the establishment of building envelopes and design parameters for a new neighbourhood and a community hub (The Haymarket) within the southern part of the SICEEP Site. Detailed development applications will accordingly follow, seeking approval for specific aspects of The Haymarket in accordance with the approved staged development application.

Separate development applications will be lodged for the PPP component of the SICEEP Project (comprising the convention centre, exhibition centre, entertainment facility and associated public domain upgrades) and Hotel complex. An overview of the preferred masterplan is provided below.

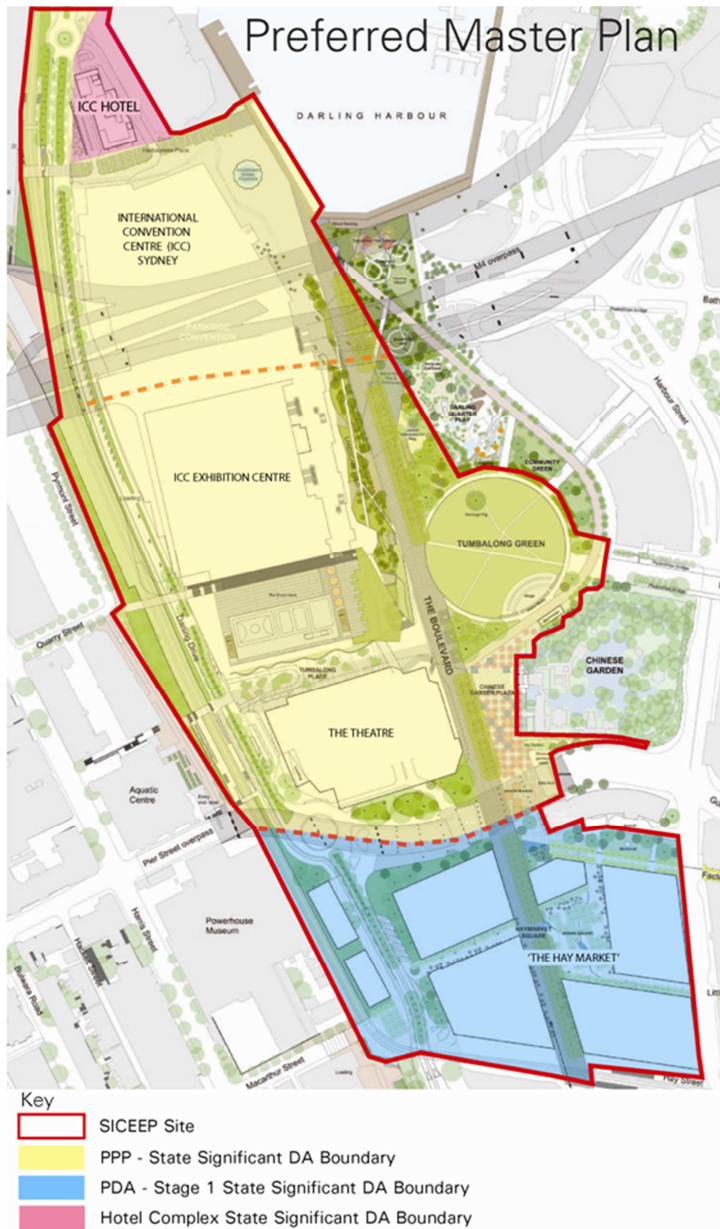

3 THE HAYMARKET SITE AND PROPOSED DEVELOPMENT

Figure 1 shows "The Haymarket" site footprint which comprises an area of approximately 6 hectares, located towards the southern end of Darling Harbour, Sydney. The irregularly shaped site is bound by Harbour Street to the east, Pier Street Overpass to the north and Hay Street to the west. A light rail corridor forms the western site boundary.

The site is currently occupied by the Sydney Entertainment Centre (SEC) towards the eastern site boundary with a multi storey car park, Darling Drive road alignment and monorail line towards the western boundary.

Coffey understands that "The Haymarket" development is to include a mix of land uses including commercial office, residential including student accommodation, retail and public open space. Residential podium and tower forms (up to 40 storeys) are proposed. Generally, car parking is proposed to be above grade within the podium. New infrastructure services (including diversions and augmentations) will be provided to service new developments.

An outline of the proposed development footprint(s) is shown in Figure 1.

Based on review of the indicative architectural design drawings supplied by Lend Lease, the proposed development will not have deep basements, with excavation expected to be limited to half basement, footing excavations and for underground services installation. In addition, it is likely that excavation works associated with remediation and archaeological works will also be required.

Buildings are expected to generally be founded on piles.

4 DESK STUDY INFORMATION

4.1 Geology and Site History

Based on Macquarie's Map of 1822, the site is located over what was originally known as Cockle Bay. The bay and its tributaries extended almost 1km inland from the southern boundary of the present harbour. The present shoreline has been formed progressively by infilling since the 1820's. The fill deposits are underlain by slope wash and alluvial deposits, which are underlain by residual soil and Hawkesbury Sandstone bedrock of the Triassic Age.

After reclamation in the 1820's, factory buildings and roadways were developed progressively within the site. In the 1930's, most of the site was demolished to allow construction of a council depot. In 1949, the site was redeveloped into City Markets No.4. Subsequently in the 1980's, the City Market structures were demolished and the site was redeveloped with a multi-storey car park and the Sydney Entertainment Centre. Further details on historical land use of the site can be found in our environmental desk study report GEOTLCOV24303AA-AC, dated 13 July 2011.

An igneous dyke known as "The Great Sydney Dyke" intrudes the Hawkesbury Sandstone through the site in a northwest to southeast direction. The GPO fault zone with associated sub parallel shear zones is inferred to be present within the site, striking approximately north east/south west.

4.2 Previous Geotechnical Investigations

Coffey has extensive existing geotechnical information within the site and immediate environs. This includes site investigations carried out by Coffey and information gathered by others for previous

projects. Borehole data from the references listed in Table 1 was used to assess the geotechnical/geological conditions of the site.

Table 1 – Results of Previous Investigations Used in Preparation of this Report

Ref No.	Description of Previous Project
R1	Department of Main Roads, "North Western Expressway Project", 1971*
R2	Coffey & Partners Pty Ltd, "Haymarket Redevelopment – Report on Preliminary Foundation Investigation", May 1978 (S6063-AA)
R3	Coffey & Partners Pty Ltd, "Haymarket Redevelopment – Parking Station Foundation Investigation", July 1979 (S6269-AB)
R4	Coffey & Partners Pty Ltd, "Proposed Haymarket Carpark – Additional Foundation Investigation", June 1980 (S6269/2-AA)
R5	Arup Geotechnics, "Darling Harbour Redevelopment – Site Investigation Report", November 1984
R6	Coffey & Partners Pty Ltd, "Darling Harbour Development Maritime Structures Geotechnical Investigation Zones 1 to 6" May 1985 (S7559/1-AE)*
R7	Coffey & Partners Pty Ltd, "Darling Harbour Development Project Convention Centre – Geotechnical Investigation" June 1985 (S7559/3-AD)
R8	Arup Geotechnics, "Darling Harbour Development Western Boulevard – Site Investigation Report", December 1985
R9	Coffey & Partners Pty Ltd, "Darling Harbour Light Monorail Geotechnical Investigation", May 1986 (S7769/1-AG)
R10	Coffey & Partners Pty Ltd, "Studio City Development – Geotechnical investigation", July 1988 (S8283/1-AH)
R11	City of Sydney, City Engineer's Department, "William Henry Street Bridge – Eastern Approach", July 1967
R12	Coffey Geosciences Pty Ltd, "Geotechnical Investigation Proposed Multi-storey Development – Bullecourt Place, Ultimo", December 2001 (S21012/1-AS)
R13	Arup Geotechnics, "Darling Harbour Development – Western Boulevard Sewer Tunnel", December 1985
R14	Coffey & Partners Pty Ltd, "Merino Central Two Project, Pyrmont – Geotechnical Investigation", November 1986 (S7960/1-AC)
R15	Jeffery and Katauskas Pty Ltd, "Geotechnical Investigation Proposed Refurbishment of Woolstores", April 1986
R16	Arup Geotechnics, "Darling Harbour Development – Pier Street, Harbour/Day Streets" April 1986
R17	Coffey Geotechnics Pty Ltd, "Sydney International Convention and Entertainment Centre – Geotechnical Investigation Report", August 2011 (GEOTLCOV24303AA-AE)
R18	Coffey Geotechnics Pty Ltd, "Proposed Sydney International Convention, Exhibition and Entertainment Precinct (SICEEP)", May 2012 (GEOTLCOV24303AC-AD)
R19	Coffey Environments Pty Ltd, "Supplementary Site Investigation – Sydney International Conference, Exhibition and Entertainment Precinct, Darling Harbour" August 2012 (GEOTLCOV24303AD-AA)

Ref No.	Description of Previous Project
R20	Coffey Environments Pty Ltd, "Supplementary Site Investigation: Factual Report – Sydney International Conference, Exhibition and Entertainment Precinct, Darling Harbour" January 2013 (GEOTLCOV24303AF_R0-01a)

5 PRELIMINARY GEOTECHNICAL MODEL

The geotechnical conditions at the site are complex, comprising the following main features:

- Variable fill;
- An in-filled palaeochannel, incised into the Sandstone bedrock and orientated roughly north/south;
- An igneous dyke intrusion through the Sandstone bedrock, striking north west/south east;
- Sheared zones and joints in the Sandstone bedrock, associated with the 'GPO' Fault regionally mapped as striking north north east/south south west beyond the eastern site boundary; and
- High groundwater levels.

5.1 General Soil and Rock Profiles

The material infilling the palaeochannel that has been incised in the Sandstone bedrock comprises man-made fill and alluvium / estuarine deposits. Based on the available borehole information, an overview of the respective subsurface strata is presented in Table 2, with material types divided into geotechnical units for the purposes of this report.

Table 2 – Overview of Subsurface Conditions and Geotechnical Units

Unit	Material Description
1	<p>Fill – comprising heterogeneous mixtures of sand, sandy gravel, clay and sandy clay/silt with cobbles and occasional boulder sized rock fragments. Concrete and Asphalt materials were encountered at shallow depths at most of the borehole locations.</p> <p>The density/consistency of the fill is variable, and may range from loose to dense or very soft to stiff. Due to its variability and likely non-uniform placement procedure, it would be classified as "uncontrolled fill".</p>
2	Alluvium and Estuarine Deposits – comprising clayey sands and clays with occasional shell layers and organic matters. These materials range from very loose to medium dense or very soft to very stiff in consistency. Some of the underlying residual soil (Unit 3) may have been disturbed and mixed within the alluvium.
3	Residual Soil – derived from weathering of the underlying sandstone rock, and generally comprising clayey sand or sandy clay having stiff consistency. In many places, however, this unit is relatively thin or absent due to the geological erosion process.
4	Bedrock – comprising Sandstone ranging from extremely weathered to fresh with low to medium strength shale bands (up to 1.2m thick). This unit has been subdivided based on strength, fracturing, and defects in accordance with Pells et al (1998) as follows:

Unit	Material Description
	<ul style="list-style-type: none"> • 4a – Class V and Class IV Sandstone • 4b – Class III Sandstone • 4c – Class II Sandstone or better <p>Class V Sandstone is extremely low to low strength with significant amounts of defects while Class II Sandstone or better is generally medium and high rock strength with limited defects.</p> <p>It should be noted that the buried bedrock surface is likely to vary as a series of sub-horizontal benches and sub-vertical cliff lines, in a similar fashion to the variations in level that can be observed on the Sydney harbour foreshores.</p>
5A	Clay – comprising high plasticity clay derived from completely weathered dyke material. This unit is found within the dyke to significant depths as recorded in the past investigations. This material was not encountered during the current investigations.
5B	Dolerite – highly weathered to fresh dyke material found within the dyke shown in Figure 2 from observations made during previous investigations.

Note: Rock classified in accordance with Pells et al (1998) "Foundations on Sandstone and Shale in the Sydney Region" Aust. Geomech. Jnl, Dec 1998.

Table 3 presents a summary of the depths of occurrence and thickness of each geotechnical unit observed at the site based on the findings of previous investigations by Coffey and others.

Table 3 – Depth of Occurrence and Thickness of Geotechnical Units

Unit	Material / Origin	Depth to Top of Unit (m)	Thickness of Unit (m)	Elevation at Top of Unit (mAHD)
1	Fill	0	0.4 to 4.5	2.4 to 3.8
2	Alluvium/Estuarine	0.4 to 6.5	1.5 to 14.5 (Where proven)	1.2 to -1.5
3	Residual Soil	4.6 to 9.8	0.4 to 4.2	-1.8 to -11.7
4a	Class V and IV Sandstone	5.6 to 13.3	0.1 to 3	-3.2 to -13.2
4b	Class III Sandstone	7.2 to 20.8	4.8 to >9.6	-3.9 to -15.8
4c	Class II Sandstone or better	12.9 to 23.5	Not Proven	-12.2 to -20.8

Note: Rock classified in accordance with Pells et al (1998) "Foundations on Sandstone and Shale in the Sydney Region" Aust. Geomech. Jnl, Dec 1998.

Based on the information obtained from past investigations referenced in Section 3, Coffey has inferred subsurface contours for the base of fill / top of alluvial deposits (Figure 2) and top of extremely weathered/highly weathered bedrock (Class V and Class IV) (Figure 3).

The inferred rock contours indicate a highly irregular rock profile to be present, particularly at the northern part of the site and the centreline of the inferred palaeochannel. The difference in rock level is expected to be about 14m across the width of The Haymarket site footprint, deepening from the western edge and the eastern edge towards middle of the site.

Three cross sections have been drawn through the site and are presented as Figure 4 to Figure 6.

5.2 Igneous Dyke

The approximate location of the igneous intrusion known as the 'Great Sydney Dyke' is shown on Figure 2 and Figure 3. The dyke comprises extremely weathered dolerite with stiff clay properties to depths of between about RL-16m to RL-24m. Below these depths better quality dolerite is likely to occur.

Based on available previous borehole information, the dyke was found to have a width ranging from about 3m to 8m, with an average width of typically 4.5m. It should be noted that the dyke may thin, thicken, side step or branch. The location and shape of dyke as presented on Figure 2 and Figure 3 should be taken as approximate only.

The sandstone/dyke interface is expected to be vertical to sub vertical. Typically sandstone on either side of dyke is altered and fractured by the intrusion.

Information gathered during a web search (source: development application documents for City West Cable Tunnel project) indicates that the dyke was observed in excavations near the corner of Thomas Street and Hay Street and that seepage flow from within the surrounding sandstone was highly saline, with iron, manganese and sulphate. It is also suggested in these documents that it is likely that the dyke zone is connected to groundwater in the Darling Harbour sediments.

5.3 Fault and Shear Zones

Besides the dyke, shear zones and isolated joints sub parallel to the GPO fault zone are also inferred to be present within the site. The approximate known location of the main GPO fault zone extends from the Circular Quay area to the intersection of Bathurst Street and Harbour Street (i.e. about 400m north of site) with an approximate strike of NNE. The approximate inferred alignment of the GPO fault zone is shown in Figure 2 and Figure 3.

5.4 Groundwater

The results of monitoring undertaken during previous investigations indicate groundwater levels to be between RL1.7m and RL-1.3m. No discernible influence of tidal levels within Cockle Bay to the north and groundwater levels at The Haymarket site was noted over the course of the monitoring.

Groundwater is likely to be encountered within the Unit 2 Alluvium and the Unit 1 Fill that has been placed to raise site levels from what was probably low lying swampy ground. Groundwater may also be encountered within the bedrock in joints and bedding partings.

6 PRELIMINARY DISCUSSION AND RECOMMENDATIONS

Based on the findings of our geotechnical assessment, and experience on similar projects, the proposed development is considered feasible from a geotechnical perspective. The proposed development should present a low risk to surrounding structures provided appropriate additional site investigation, design assessments, and construction monitoring normally associated with this type of development are carried out.

6.1 Excavations

6.1.1 Excavation Conditions

Based on the architectural concept drawings supplied by Lend Lease, the proposed development will not have deep basements, with excavation expected to be limited to half basement, footing excavations and for underground services installation. Such excavations are therefore expected to be within Unit 1 Fill and Unit 2 Alluvium/Estuarine Deposits. The proposed buildings are generally expected to be founded on piles.

6.1.2 Bulk Excavation Batter Slopes

The stability of excavations in Unit 1 Fill will be influenced by the presence of the underlying low strength Unit 2 soils (even if Unit 1 fill is replaced by Engineered Fill) and groundwater. As a result there will be a significant risk of excavation instability if relatively steep temporary batter slopes are adopted without site specific investigation and geotechnical input during both design and construction. For preliminary design we recommend the following temporary batters and shoring:

- Above the Groundwater Table, Excavations in Unit 1 or Engineered Fill: flatter than 2H:1V; and
- Below the Groundwater Table or into Unit 2 Soils: adopt shoring.

Instability due to bottom heave is not anticipated for shallow excavations. However, further assessment should be carried out for deeper excavations if proposed.

6.1.3 Excavation Support Requirements

Depending on project requirements for a sufficiently watertight, and/or stiff retention system the following options could be considered.

- Driven sheet piles;
- Contiguous pile wall; or
- Secant pile wall.

For a sheet piled wall, overlapping or interlocking sheets would be vibrated or driven into the ground around the proposed basement perimeter prior to excavation. The steel sheet piles could be used to provide formwork for the permanent basement walls, but this would preclude their recovery. Sheet piles would likely refuse on the weathered bedrock, and groundwater seepage would be expected to occur through the clutches and toe of the wall.

Contiguous pile walls may be practicable where the fill or natural soils are cohesive and excavations do not extend to significant depth below the groundwater table. Contiguous pile walls are not watertight

because of the installation tolerance of the piles. It may be difficult to achieve a watertight permanent wall where contiguous piles are adopted.

Secant piling involves drilling “soft” piles using low strength concrete at centres of 1.5 pile diameters. Normal strength “hard” piles are then drilled between, cutting into the soft piles to form a relatively water tight seal. Unless bored carefully, secant piles can deviate off vertical centre during installation creating gaps between the piles and result in groundwater seepage and ground loss.

For the preliminary design of retaining walls the parameters in Table 4 should be adopted.

Table 4: Preliminary Retaining Wall Design Parameters

Unit	Description	Bulk Unit Weight (kN/m ³)	Effective Cohesion (kPa)	Friction Angle (degree)
1	Fill	20	0	30
2	Alluvium/Estuarine	18	0	26
3 & 5A	Residual Soil/weathered dyke	20	5	28
4a	Class V and IV Sandstone	21	30	35

Retaining walls should be designed for appropriate hydrostatic and surcharge loads.

Where cantilevered walls are not practicable, lateral stability could be provided by anchors installed progressively as the excavation proceeds. Anchors may need to be installed beneath adjacent properties and would need the permission of adjacent property owners. Where installation of anchors is not practicable, internal strutting or bracing may be required to provide lateral stability.

Excavations associated with installation of utilities are expected to be relatively shallow. Where it is not practicable to adopt temporary batters as recommended in Section 6.1.2 above due to land take restrictions, or where excavations are below standing groundwater levels; lateral excavation support should be provided using a temporary shoring box, internal strutting or similar.

6.1.4 Groundwater Conditions

Where excavations are proposed to extend below standing groundwater levels, extensive dewatering of the alluvial soils is not desirable as this could lead to consolidation settlement of the fill and alluvium and may need special permits to discharge off site. Cut-off walls will be required during excavation works and the final basement walls should be designed as tanked to maintain standing groundwater levels and prevent groundwater ingress into the basement.

Where excavations for the purpose of utilities, remediation and archaeological works are to extend below standing groundwater levels, localised dewatering will be required. Where inflow rates are relatively low and cohesive soils are encountered, sump and pump techniques may be practicable. However, where higher inflow rates occur, installation and operation of drilled wells or jetted spear points around the excavation perimeter would be required.

The detailed assessment and design of groundwater management is beyond the scope of this report and should be addressed by a hydrogeological investigation.

6.1.5 Excavation Induced Ground Movements

Walls retaining soil strength material will laterally deflect up to 1% of the retained height, depending on the stiffness of the retaining wall system.

The potentially damaging effects of stress redistribution in the vicinity of excavations should be assessed as part of the detailed design. Lateral displacements of retaining walls due to stress redistribution may also result in settlement. For preliminary assessment of impacts we recommend that potential settlement be assumed to be equal to predicted lateral displacements. Typically, ground movements (lateral displacement and settlement) are greatest at the excavation face and decrease to negligible values at a distance of up to 3 times the excavation depth.

For preliminary impact assessment purposes the above guidelines on displacements may be used. If such movements cannot be tolerated for sensitive features, then retaining walls should be designed for higher earth pressures. Depending on the specific retention system, basement excavation details and the nature of adjacent structures, a more detailed analysis will be required. Coffey has specialist capability in applying numerical modelling techniques to the estimation of ground movements.

6.2 Building Foundations

6.2.1 Expected Arrangements and Issues

The Haymarket is understood to comprise construction of various multi-storey buildings expected to be between 4 storeys and 40 storeys as shown on Figure 1.

Based on the nature of subsurface conditions; comprising a variable thickness of fill and alluvial/estuarine soils, we expect that footings for this development may comprise cased bored piles or continuous flight auger (CFA) piles socketed into the underlying sandstone bedrock, or pad/strip footings where rock is shallow.

Stress relief effects due to the palaeochannel formation process are likely to have caused opening and weathering of defects (bedding planes and joints). Therefore, poor foundation conditions may occur near the current rock surface level. Depending on the proposed bulk excavation level relative to the current rock level, significant clay seams may be encountered and these may affect both bearing capacity and settlement of pad footings.

Difficulties in construction of deep piles at SEC have been reported (e.g. Malcom D.J., 1997) when the dyke is in contact with recent marine and alluvial sediments. An indurated sandstone or ironstone capping layer at the boundary of recent sediments and the underlying, lower strength, dyke could pose construction difficulties for driven piles. Possible difficulties to cased bored and CFA piling include drilling in very strong Dolerite/altered Sandstone (i.e. Sandstone could be significantly altered to a distance of several meters on either side of dyke), collapse of dyke material and management of groundwater.

As mentioned in previous sections, the igneous dyke may thin, thicken, sidestep or branch. Foundation construction difficulties may occur if the dyke is encountered at previously unknown locations. Geotechnical verification during construction will be required to mitigate the risks associated with the potentially complex foundation conditions. In the vicinity of the Dyke, column loads need to be

supported on reinforced beams spanning the dyke and founded on the adjacent sandstone. Depending on the proximity of the footings and the condition of the sandstone which may have been adversely affected by the dyke material, it may be necessary to reduce rock design parameters.

6.2.2 Preliminary Foundation Design

Design end bearing pressures and shaft adhesion for piled foundations are provided in Table 5 for both Limit State and Working Stress design methods. Where Limit State design parameters are used, a geotechnical strength reduction factor Φ_g of 0.75 should be applied and the Serviceability Limit State deflections should be checked using the elastic properties presented in Table 5.

If piles are required to resist uplift, the shaft adhesion values in Table 5 should be reduced by a factor of 0.7, in addition to adopting a Φ_g value of 0.6. A cone pull out check should also be carried out assuming a cone angle of 70°.

The allowable end bearing pressures provided in Table 5 are based on a settlement criterion of up to 1% of the pile diameter. Ultimate capacities (for better quality rocks) are significantly higher, however, can only be mobilised under large settlements. Use of limit state design of piles using ultimate capacities, appropriate reduction factors and settlement calculations is likely to allow higher load capacities to be adopted.

Table 5 – Preliminary Design Parameters for Footings and Bored Piles

Unit	Working Stress Design Values ⁽¹⁾		Limit State Design Values ⁽²⁾		
	Allowable End Bearing Pressures (MPa) ³	Allowable Shaft Adhesion ^{3,4} (kPa)	Ultimate End Bearing (MPa) ³	Ultimate Shaft Adhesion ^{3,4} (kPa)	Elastic Modulus (MPa)
3 (Residual Soil)	-	-	-	-	40
4a (Class V and IV Sandstone)	1 to 3.5	75 to 150	3 to 10	150 to 250	100
4b (Class III Sandstone)	5 to 6	500 to 600	20 to 40	800 to 1,000	1000
4c (Class II Sandstone or better)	8 to 12	800 to 1,200	60 to 120	1,500 to 2,000	1500

(1) Structure specific assessments should be carried out to assess design values, particularly if the values at the upper end

of the ranges provided are to be adopted.

- (2) These values are based on Pells et al. (1998), for presumptive settlement limits of up to 1% footing width or pile diameter. Higher design values may be possible based on first principle engineering design (refer to limit state design values) and appropriate settlement and differential settlement assessment.
- (3) Design values for specific structures should be selected from within the ranges provided in the table depending on factors such as rock quality, particularly rock strength. Lower values than the ranges provided in the table may apply for shear / fracture affected zones adjacent to the dyke. Appropriate values should be confirmed by additional investigation and with construction stage verification by a geotechnical engineer.
- (4) Shaft Adhesion should be ignored for pad or strip footings.

The values in Table 5 assume that an appropriate level of foundation verification and testing is carried out. This may include additional cored boreholes both at the design and construction phase to assess the variability in rock quality. Pile load testing may be required; particularly if relatively high shaft adhesion and end bearing values are adopted.

6.3 Contingency Planning

Subsurface conditions at the site are expected to be highly variable in terms of unit thickness/material type and consistency. Based on the expected variable nature of subsurface conditions, some form of contingency planning is recommended should adverse conditions be encountered such as soft soils and/or higher groundwater levels than those observed during previous investigations at the site.

Contingency planning should include allowance for items such as:

- Importation of granular fill for construction of access roads and temporary working platforms for heavy plant such as cranes and piling rigs;
- Removal and replacement of existing fill where required;
- Shoring and dewatering of excavations where groundwater / soft saturated soils are encountered;
- Permissions for discharge of water to stormwater where dewatering is required;
- Permissions from adjacent property owner(s) where anchoring of excavations is required; and
- Redesign of footings to accommodate variable ground conditions associated with features such as the Great Sydney Dyke or the GPO fault zone joint swarm.

6.4 Soil Aggressivity

The majority of chemical test results from previous investigations at the site indicate “non-aggressive” to “mildly aggressive” conditions for buried concrete and steel structural elements when assessed in accordance with AS 2159-2009. However, a number of chemical test results would classify as “mildly aggressive” to “severely aggressive” based on resistivity values.

Further soils and groundwater aggressivity testing should be carried out at the site to allow greater site coverage and better understanding of chemical conditions to assist detailed design.

Acid sulphate soils have been encountered on sites within the Darling Harbour area. An acid sulphate soils management plan is being carried out by Coffey concurrently with this assessment and will be reported separately.

6.5 Seismic Design

Based on our interpretation of site conditions and review of AS1170.4-2007, we recommend the following parameters be adopted for seismic design:

- Seismic Hazard Factor (Z) 0.08
- Sub-Soil Class C_e

6.6 Conclusion

Coffey understands that "The Haymarket" development is to include a mix of land uses including commercial office, residential including student accommodation, retail and public open space. Residential podium and tower forms (up to 40 storeys) are proposed. Generally, car parking is proposed to be above grade within the podium. New infrastructure services (including diversions and augmentations) will be provided to service new developments. In addition, it is likely that additional excavation works associated with remediation and archaeological works will also be required.

Coffey has assessed the proposed development scheme in the context of the existing geotechnical conditions on the site and have concluded that the site is suitable for its intended use.

While the site contains a number of geotechnical challenges including the presence of The Great Sydney Dyke, high groundwater table, acid sulphate soils and rock at depth, Coffey is satisfied that these challenges can be adequately addressed through the utilisation of industry standard design and construction techniques and practices.

6.7 Limitations and Further Geotechnical Investigations

The preliminary geotechnical assessment and recommendations presented in this report are based on a desk study of previous investigations by Coffey and others. Ground conditions can vary over relatively short distances and site specific investigation for the various individual structures for the development and construction stage geotechnical assessments should be undertaken to manage geotechnical risk.

The attached document entitled "Important Information about your Coffey Report" provides additional information on the uses and limitations of this report.

For and on behalf of Coffey Geotechnics Pty Ltd



Dan Butterworth

Engineering Geologist

Important information about your **Coffey Report**

As a client of Coffey you should know that site subsurface conditions cause more construction problems than any other factor. These notes have been prepared by Coffey to help you interpret and understand the limitations of your report.

Your report is based on project specific criteria

Your report has been developed on the basis of your unique project specific requirements as understood by Coffey and applies only to the site investigated. Project criteria typically include the general nature of the project; its size and configuration; the location of any structures on the site; other site improvements; the presence of underground utilities; and the additional risk imposed by scope-of-service limitations imposed by the client. Your report should not be used if there are any changes to the project without first asking Coffey to assess how factors that changed subsequent to the date of the report affect the report's recommendations. Coffey cannot accept responsibility for problems that may occur due to changed factors if they are not consulted.

Subsurface conditions can change

Subsurface conditions are created by natural processes and the activity of man. For example, water levels can vary with time, fill may be placed on a site and pollutants may migrate with time. Because a report is based on conditions which existed at the time of subsurface exploration, decisions should not be based on a report whose adequacy may have been affected by time. Consult Coffey to be advised how time may have impacted on the project.

Interpretation of factual data

Site assessment identifies actual subsurface conditions only at those points where samples are taken and when they are taken. Data derived from literature and external data source review, sampling and subsequent laboratory testing are interpreted by geologists, engineers or scientists to provide an opinion about overall site conditions, their likely impact on the proposed development and recommended actions. Actual conditions may differ from those inferred to exist, because no professional, no matter how qualified, can reveal what is hidden by

earth, rock and time. The actual interface between materials may be far more gradual or abrupt than assumed based on the facts obtained. Nothing can be done to change the actual site conditions which exist, but steps can be taken to reduce the impact of unexpected conditions. For this reason, owners should retain the services of Coffey through the development stage, to identify variances, conduct additional tests if required, and recommend solutions to problems encountered on site.

Your report will only give preliminary recommendations

Your report is based on the assumption that the site conditions as revealed through selective point sampling are indicative of actual conditions throughout an area. This assumption cannot be substantiated until project implementation has commenced and therefore your report recommendations can only be regarded as preliminary. Only Coffey, who prepared the report, is fully familiar with the background information needed to assess whether or not the report's recommendations are valid and whether or not changes should be considered as the project develops. If another party undertakes the implementation of the recommendations of this report there is a risk that the report will be misinterpreted and Coffey cannot be held responsible for such misinterpretation.

Your report is prepared for specific purposes and persons

To avoid misuse of the information contained in your report it is recommended that you confer with Coffey before passing your report on to another party who may not be familiar with the background and the purpose of the report. Your report should not be applied to any project other than that originally specified at the time the report was issued.

Important information about your **Coffey** Report

Interpretation by other design professionals

Costly problems can occur when other design professionals develop their plans based on misinterpretations of a report. To help avoid misinterpretations, retain Coffey to work with other project design professionals who are affected by the report. Have Coffey explain the report implications to design professionals affected by them and then review plans and specifications produced to see how they incorporate the report findings.

Data should not be separated from the report*

The report as a whole presents the findings of the site assessment and the report should not be copied in part or altered in any way.

Logs, figures, drawings, etc. are customarily included in our reports and are developed by scientists, engineers or geologists based on their interpretation of field logs (assembled by field personnel) and laboratory evaluation of field samples. These logs etc. should not under any circumstances be redrawn for inclusion in other documents or separated from the report in any way.

Geoenvironmental concerns are not at issue

Your report is not likely to relate any findings, conclusions, or recommendations about the potential for hazardous materials existing at the site unless specifically required to do so by the client. Specialist equipment, techniques, and personnel are used to perform a geoenvironmental assessment.

Contamination can create major health, safety and environmental risks. If you have no information about the potential for your site to be contaminated or create an environmental hazard, you are advised to contact Coffey for information relating to geoenvironmental issues.

Rely on Coffey for additional assistance

Coffey is familiar with a variety of techniques and approaches that can be used to help reduce risks for all parties to a project, from design to construction. It is common that not all approaches will be necessarily dealt with in your site assessment report due to concepts proposed at that time. As the project progresses through design towards construction, speak with Coffey to develop alternative approaches to problems that may be of genuine benefit both in time and cost.


Responsibility

Reporting relies on interpretation of factual information based on judgement and opinion and has a level of uncertainty attached to it, which is far less exact than the design disciplines. This has often resulted in claims being lodged against consultants, which are unfounded. To help prevent this problem, a number of clauses have been developed for use in contracts, reports and other documents. Responsibility clauses do not transfer appropriate liabilities from Coffey to other parties but are included to identify where Coffey's responsibilities begin and end. Their use is intended to help all parties involved to recognise their individual responsibilities. Read all documents from Coffey closely and do not hesitate to ask any questions you may have.


* For further information on this aspect reference should be made to "Guidelines for the Provision of Geotechnical information in Construction Contracts" published by the Institution of Engineers Australia, National headquarters, Canberra, 1987.

Figures

PLOT DATE: 26/02/2013 11:58:47 AM DWG FILE: F:\GEO\TECHNICAL\PROJECTS\GEO\COV24303AG\LEND LEASE - THE HAYMARKET & FIGURES\GEO\COV24303AG.DWG

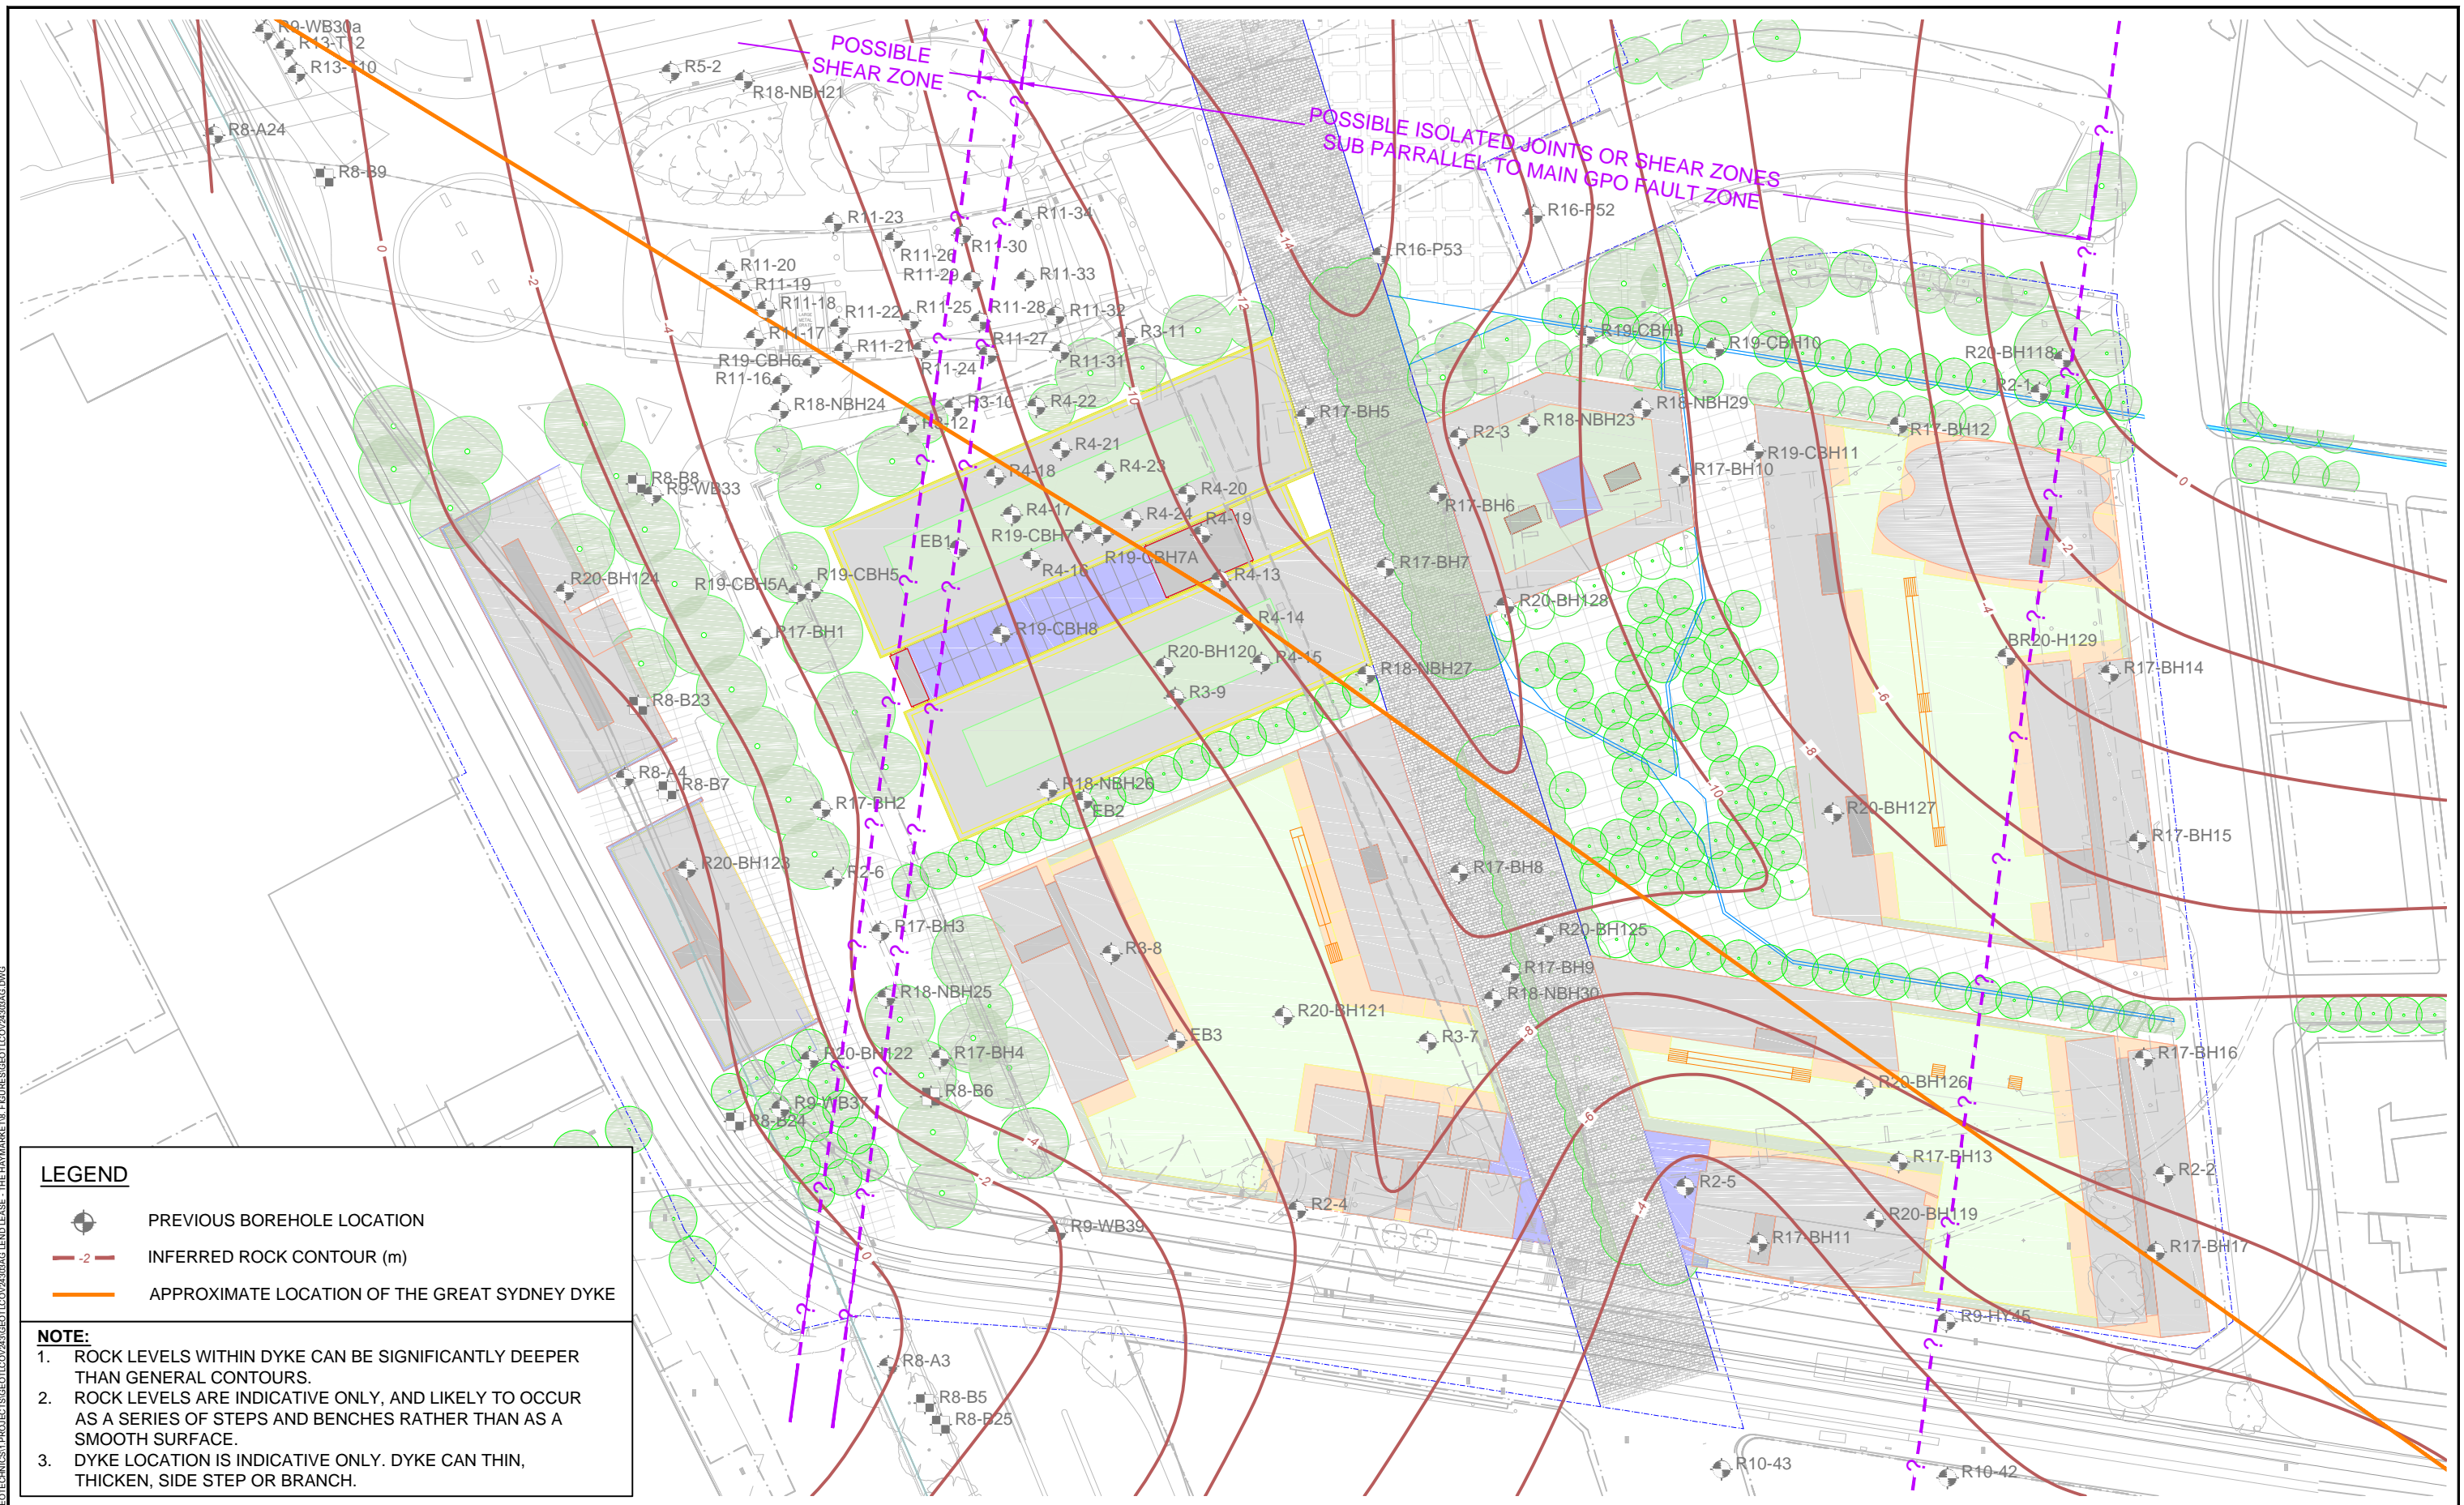


revision	description	drawn	approved	date

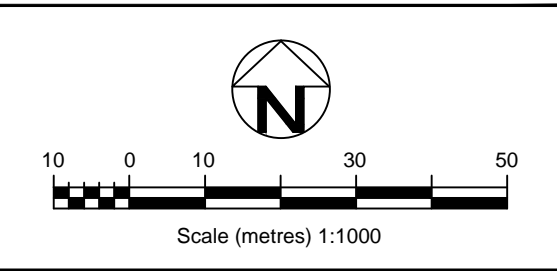

drawn	DB / AW
approved	PJW
date	26 / 02 / 13
scale	AS SHOWN
original size	A3



client:	LEND LEASE	
project:	SYDNEY INTERNATIONAL CONVENTION EXHIBITION AND ENTERTAINMENT PRECINCT (SICEEP) 'THE HAYMARKET' - STAGE 1 DA-SSDA2	
title:	INFERRED TOP OF ROCK CONTOURS (UNIT 4a - CLASS V & IV SANDSTONE)	
project no:	GEOTLCOV24303AG	figure no: FIGURE 3

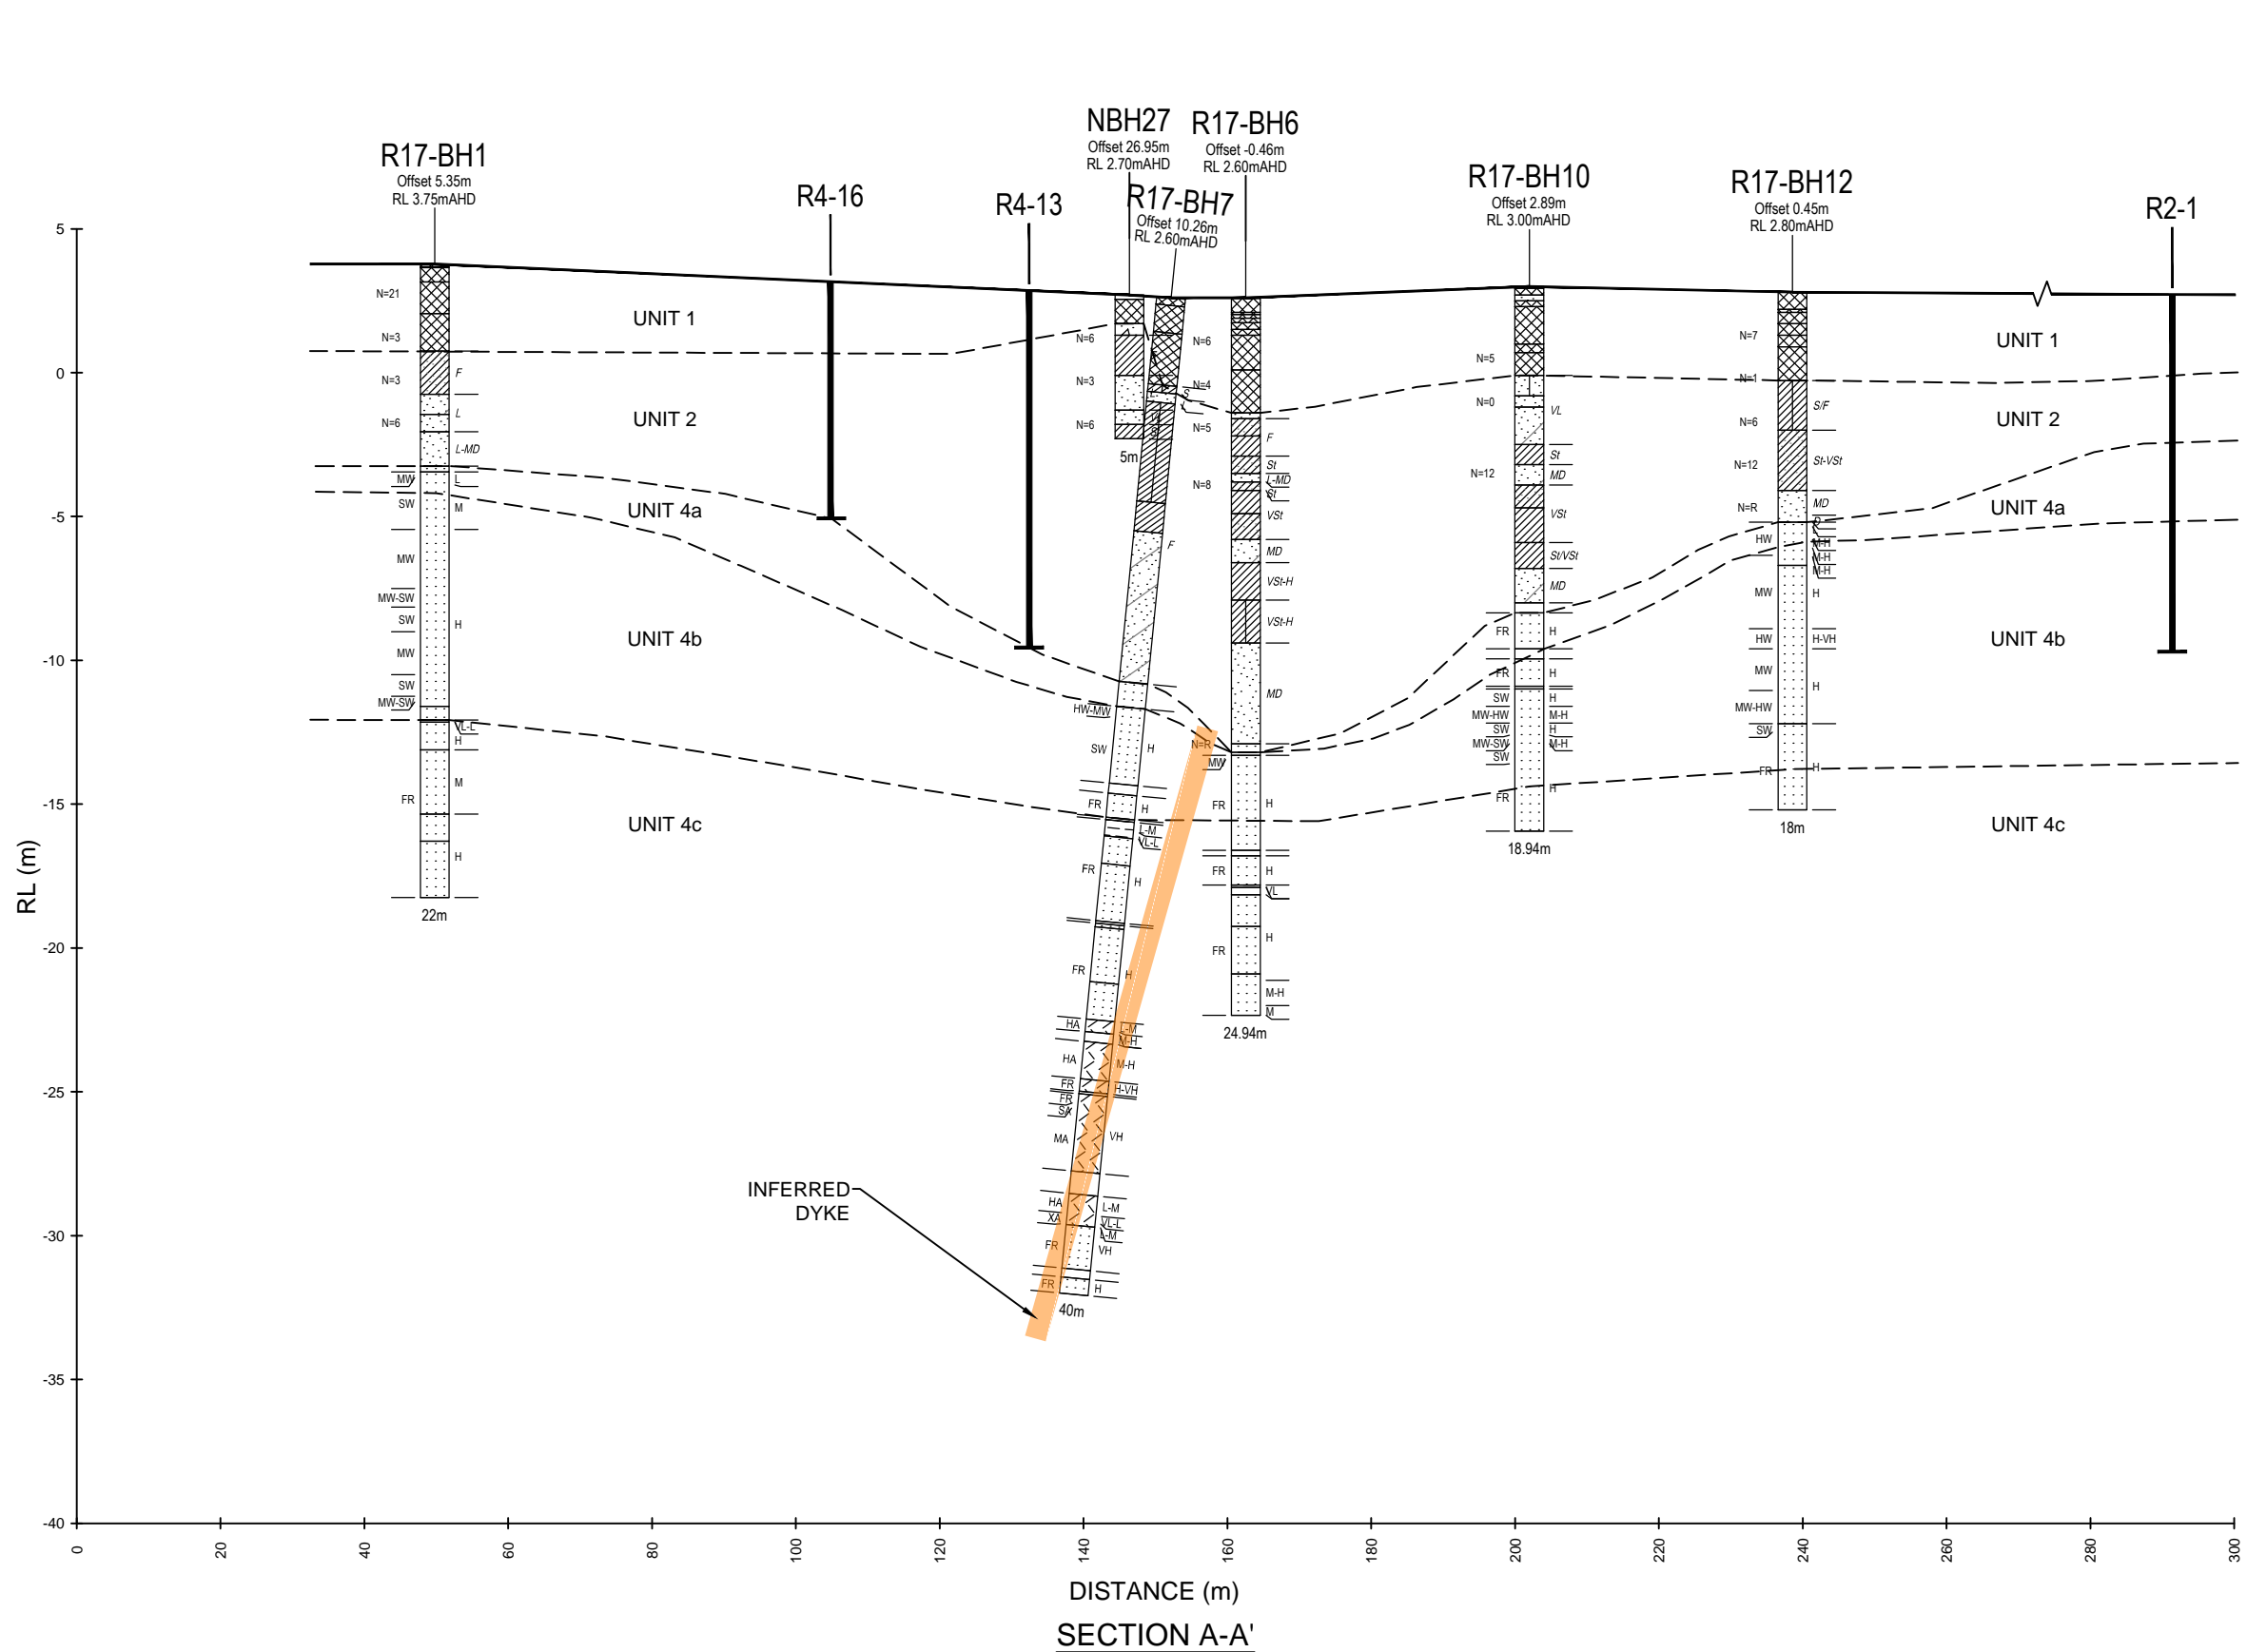


LEGEND

- FILL
- CLAYEY SAND
- SANDSTONE
- SHALE
- CLAY
- SANDY CLAY
- SAND
- SILTY CLAY
- SILTY SAND
- DOLERITE
- IV* ROCK CLASSIFICATION (PELLS ET AL, 1998)
- DX* WEATHERING (SEE EXPLANATION SHEETS)
- WATER LEVEL
- N*=17** STANDARD PENETRATION TEST RESULT
- UNIT 1 FILL
- UNIT 2 ALLUVIUM / ESTUARINE
- UNIT 3 ALLUVIUM SOIL
- UNIT 4a CLASS V / IV SANDSTONE
- UNIT 4b CLASS III SANDSTONE
- UNIT 4c CLASS II SANDSTONE

SECTION A-A'

revision	description	drawn	approved	date

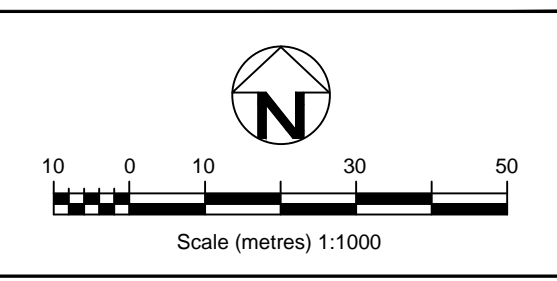


drawn	DB / AW
approved	PJW
date	26 / 02 / 13
scale	AS SHOWN
original size	A3



client:	LEND LEASE	
project:	SYDNEY INTERNATIONAL CONVENTION EXHIBITION AND ENTERTAINMENT PRECINCT (SICEEP) 'THE HAYMARKET' - STAGE 1 DA-SSDA2	
title:	SECTION A-A' INFERRED GEOLOGICAL CONDITIONS	
project no:	GEOTLCOV24303AG	figure no: FIGURE 4

PLOT DATE: 26/02/2013 11:48:51 AM DWS FILE: F:\GEO\GEO\PROJECTS\GEO\COV24303AG\LEND LEASE - THE HAYMARKET & FIGURES\GEO\COV24303AG.DWG

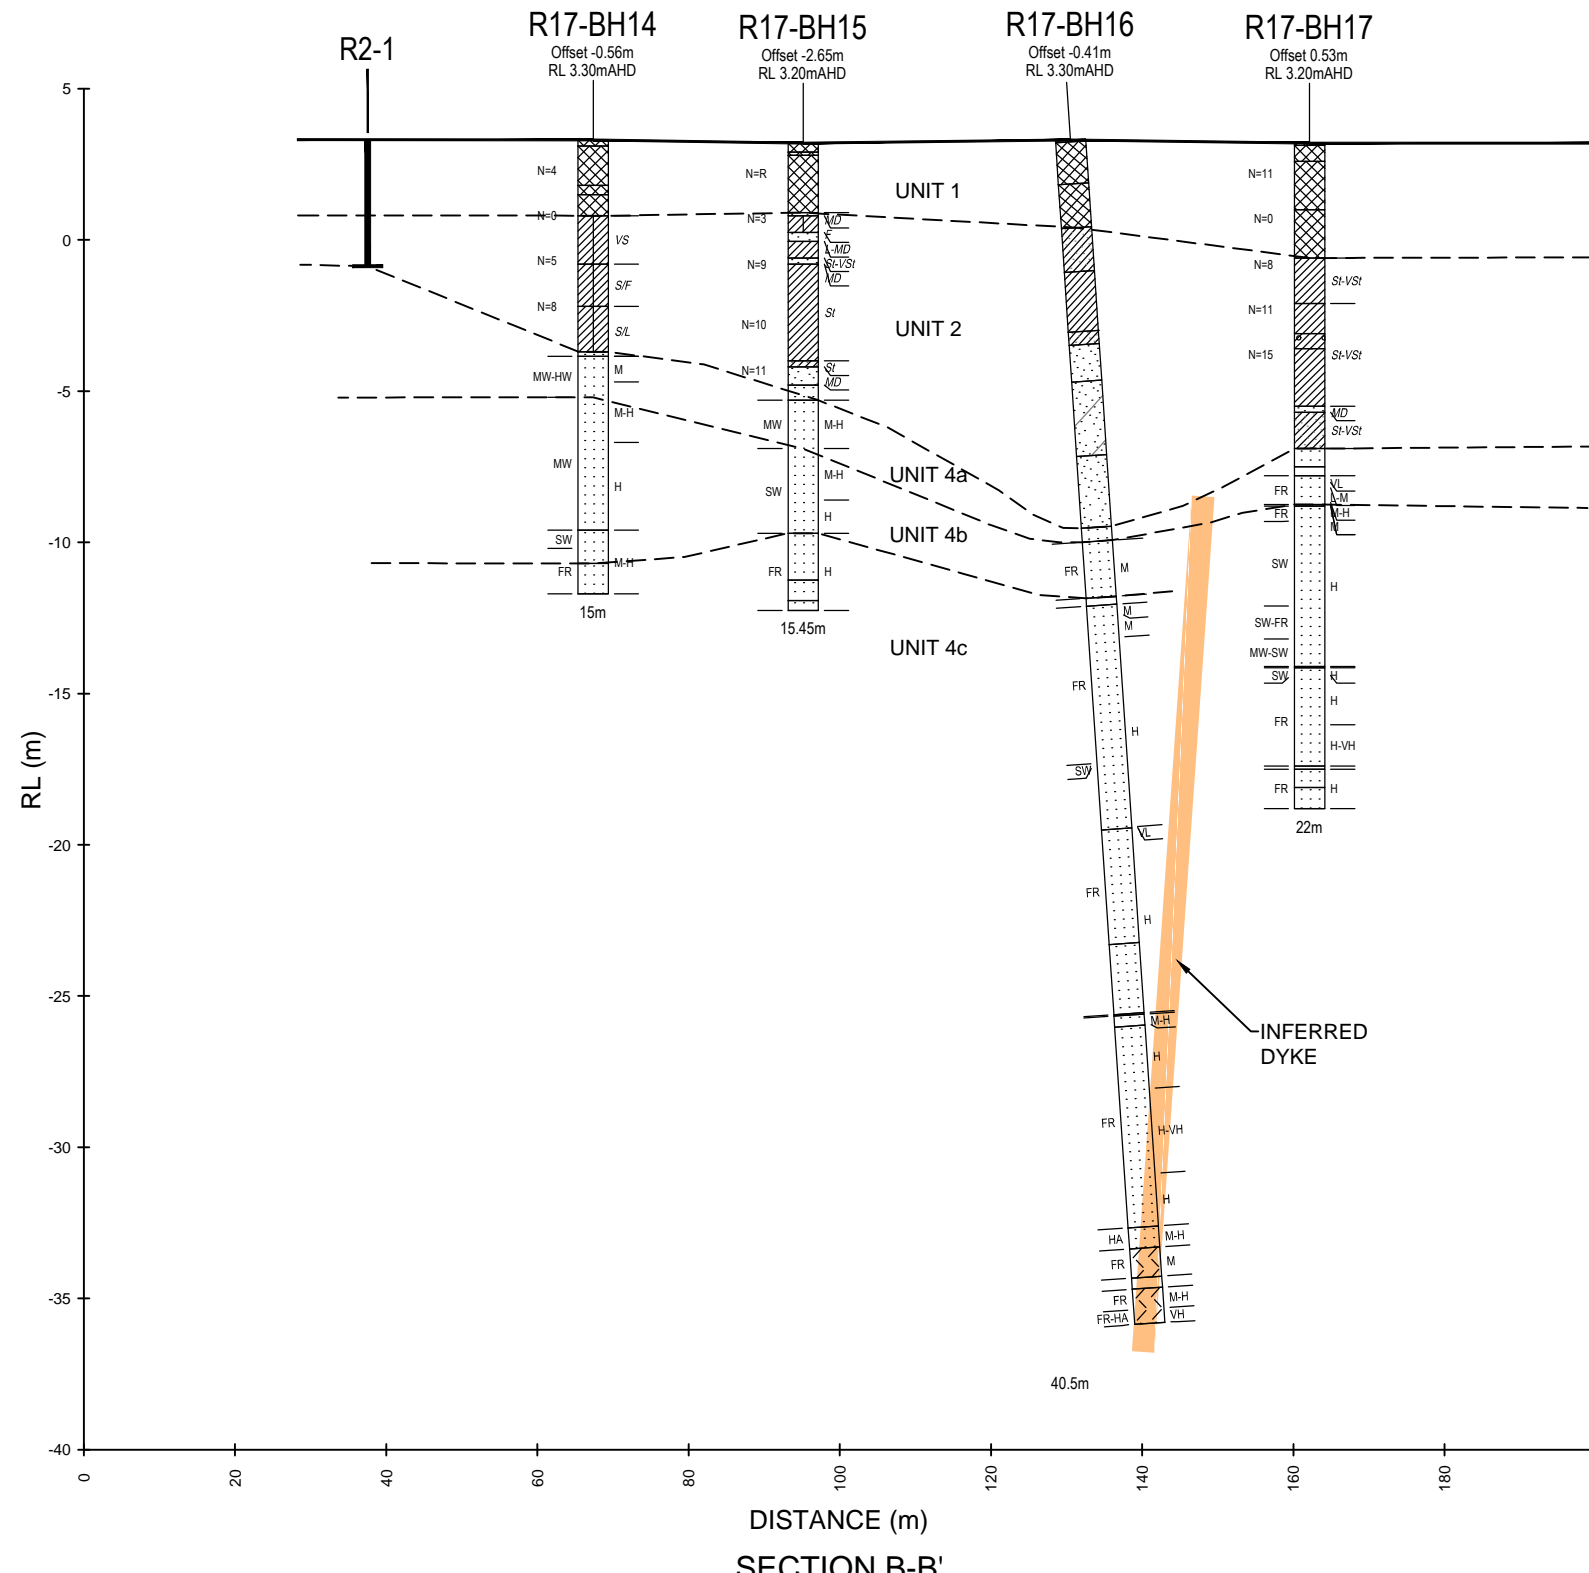


LEGEND

- FILL
- CLAYEY SAND
- SANDSTONE
- SHALE
- CLAY
- SANDY CLAY
- SAND
- SILTY CLAY
- SILTY SAND
- DOLERITE
- IV* ROCK CLASSIFICATION (PELLS ET AL., 1998)
- DX** WEATHERING (SEE EXPLANATION SHEETS)
- WATER LEVEL
- N*=17** STANDARD PENETRATION TEST RESULT
- UNIT 1 FILL
- UNIT 2 ALLUVIUM / ESTUARINE
- UNIT 3 ALLUVIUM SOIL
- UNIT 4a CLASS V / IV SANDSTONE
- UNIT 4b CLASS III SANDSTONE
- UNIT 4c CLASS II SANDSTONE

SECTION B-B'

PLOT DATE: 26/02/2013 11:58:54 AM DWS FILE: F:\GEO\GEO\PROJECTS\GEO\COV24303AG\LEND LEASE - THE HAYMARKET & FIGURES\GEO\COV24303AG.DWG

revision	description	drawn	approved	date

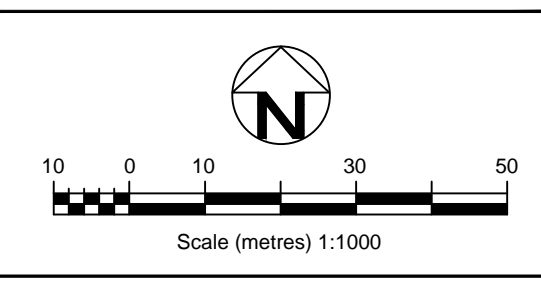

drawn	DB / AW
approved	PJW
date	26 / 02 / 13
scale	AS SHOWN
original size	A3



client:	LEND LEASE	
project:	SYDNEY INTERNATIONAL CONVENTION EXHIBITION AND ENTERTAINMENT PRECINCT (SICEEP) 'THE HAYMARKET' - STAGE 1 DA-SSDA2	
title:	SECTION B-B' INFERRED GEOLOGICAL CONDITIONS	
project no:	GEOTLCOV24303AG	figure no: FIGURE 5

