Document Control

Job No: 219285

Principal Author:	Issue.	Revision	Date
Michael Moutrie	-	Original for Landcom submission	16-04-2020
Reviewed:	А	Original for DA submission	05-05-2020
Howard Moutrie			

report

Statement of Compliance Access for People with a Disability

Tallawong Station Precinct South

Cudgegong Rd The Ponds

Accessible Building Solutions 124 Upper Washington Drive

Bonnet Bay NSW 2226

P (office) 0415 255 163 P (Howard) 0414 876 539 P (Michael) 0450 334 995 E <u>michael@absaccess.com.au</u>



accessible building solutions

Report

Report Type:	Statement of Compliance - BCA Access Provisions
Development:	Tallawong Station Precinct South

Introduction:

This report has been prepared to accompany a Development Application and has been based on the following drawings prepared by Turner Architects:

DA 110-06 DA 110-07	Overall Basement 03 & 02 Plan Overall Basement 02 & 01 Plan
DA 110-08	Overall Basement 01, Mezzanine & Level 1 Plan
DA 110-010	Overall Mezzanines, Level 01 & Level 2 Plan
DA 110-020	Overall Level 01, 02 & 03 Plan
DA 110-030	Overall Level 01, 02, 03 & 04 Plan
DA 110-040	Overall Level 02, 03, 04 & 05 Plan
DA 110-050	Overall Level 03, 04, 05 & 06 Plan
DA 110-060	Overall Level 04, 05, 06 & 07 Plan
DA 110-070	Overall Level 05, 06, 07 & 08 Plan
DA 110-080	Overall Level 06, 07, 08 & Roof Plan
DA 110-090	Overall Level 07, 08 & Roof Plan
DA 110-100	Overall Level 08 & Roof Plan
DA 110-110	Overall Roof Level
DA 400 Series	Livable and Adaptable Unit Plans

Limitations and Copyright information:

This report is not to be used for any other purpose than its original intention. The assessment is based on the provided drawings and compliance relies upon the implementation of all the recommendations listed in this report and the works constructed in accordance with AS1428.1-2009 and other latest, relevant standards and regulations applicable at the time of construction.

Assessment is based on the classification/use of the building. If the Class of the building changes to any other building Class, this access report will have to be updated accordingly.

All dimensions mentioned in the report are CLEAR dimensions and are not to be reduced by projecting skirting, kerbs, handrails, lights, fire safety equipment, door handles less than 900mm above FFL (finished floor level) or any other fixtures/fit out elements. Only some numerical requirements from relevant AS (Australian Standards) have been noted in the report, however for further details and for construction purposes refer to the relevant AS, a copy of which can be purchased from SAI Global.

This report and the drawings in this report are a copyright of Accessible Building Solutions and can only be used for the purposes of this particular project and can only be modified by Accessible Building Solutions. This document may also contain Standards Australia Ltd copyrighted material which may not be reproduced.

This report does not assess compliance matters related to WHS, Structural design, Services design, Parts of DDA other than those related to APS or Parts of BCA or Parts of Australian Standards other than those directly referenced in this report.

ABS gives no warranty or guarantee that this report is correct or complete and will not be liable for any loss arising from the use of this report. We are not to be held responsible if LHA comes to a different conclusion about compliance with the Livable Housing Guidelines. At this point of time only LHA is able to confirm whether a project has met all the requirements needed to be awarded a particular Quality Mark.

A report issued for DA (development application) is not suitable for use for CC (construction certificate application).

Job No 219285

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226 ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust Page 2 of 38

- P (office) 0415 255 163
- P (Michael) 0450 334 995
- E michael@absaccess.com.au

Assessment:

Assessment Criteria DA

This assessment has been undertaken to the extent necessary to issue development consent under the Environmental Planning and Assessment Act. Generally, assessment has been in regard to the capability of the proposal to achieve compliance where there is insufficient information to fully assess if compliance has been achieved. The project documentation should incorporate the requirements as listed in this report to ensure compliance.

Note: At design/drawing stage there is not enough information provided to ensure full compliance as a lot of access requirements depend on fittings and finishes. Where this report lists "capable of compliance" it means that there is nothing to stop full compliance as long as fittings and finishes are completed to the relevant standard.

Compliance is required with the following:

- The Access provisions of the BCA
- The Access To Premises Standard
- AS1428 suite of Standards
- AS2890.6 for car parking
- AS1735.12 for lifts
- AS4299 Adaptable Housing
- SEPP 65 Part 4Q
- Council's DCP relating to Access for People with a Disability

Assessment

The building work comprises of 4 basements under 17 buildings consisting of retail, commercial and residential units.

Under the BCA the building is classified as follows,

- Class 2 (building containing more than 2 SOUs i.e. sole-occupancy units)
- Class 5 (office building for professional or commercial use)
- Class 6 (shops, sale of goods and services by retail)
- Class 7a (car park)
- Class 10a (playground)

Job No 219285

Page 3 of 38

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust **P** (office) 0415 255 163 **P** (Michael) 0450 334 995

The following tables assess compliance with the relevant parts of the BCA and Standards **BCA Assessment for Buildings A, B, C, D & E**

	BCA Part D3 Access for People with a Disability BCA D3.1 Requirements for Access for people with a disability SOU refers to Sole Occupancy Unit
Requirement Compliance	
Comments	Access has been provided from the main pedestrian entry to the entry doors of all SOUs on all levels by means of a lift. Access has been provided to communal open space. Details to be verified at CC stage of works.
Requirement	To and within all areas that are normally used by the occupants.
Compliance Comments	Complies. Details to be verified at CC stage of works.
Requirement Compliance	Class 7a To and within any level containing accessible carparking spaces. Complies.
Comments	Access has been provided to the basement level containing the accessible car parking spaces by means of a lift. Details to be verified at CC stage of works.
Requirement	Class 10a Non-habitable building located in an accessible area intended for use by public and associated sanitary facility, change room or shelter. To and within an accessible sanitary facility, a change room facility and public shelter or similar.
Compliance Comments	Complies. Details to be verified at CC stage of works.
Requirement	 In areas required to be accessible, the following is to be provided: Width of accessways shall be min 1M clear, and to be increased for door circulation, turning areas and passing areas as required by AS 1428.1 Doors shall provide a clear opening of 850mm with a step free threshold and the required circulation spaces, hardware and luminance contrast as required by AS 1428.1 The separation of doors in airlocks shall comply with AS 1428.1 Door mats, floor grates and the abutment of different finishes shall comply with BCA and AS 1428.1 In accessible sole occupancy units, the light switches shall be 30x30mm min size at a height to match the door handles. GPOs shall be located between 600 and 1100mm above the floor and 500mm from an internal corner.
Compliance Comments	Capable of compliance. All of the above listed requirements are achievable and to be assessed for compliance at verified at CC stage of works.

Job No 219285

_

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226 ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust Page 4 of 38

- **P** (office) 0415 255 163 **P** (Michael) 0450 334 995
- E michael@absaccess.com.au

	BCA Part D3.2 Access to buildings
Requirement	 Accessway is required from; Main pedestrian entry at the site boundary for new buildings Main pedestrian entry door for existing buildings Any other accessible building connected by a pedestrian link Accessible car parking spaces Complies.
Comments	Access has been provided from the main pedestrian entry at the site boundary by means of a pathway / ramp. Access has been provided from accessible car parking spaces by means of a lift. Details to be verified at CC stage of works.
Requirement	 Accessway is required through: Main entry and Not less than 50% of all pedestrian entrances and in building with floor area over 500m², non-accessible entry and accessible entry to be not more than 50M apart.
Compliance Comments	Capable of compliance. An accessible entrance is provided to each building. Details to be verified at CC stage of works.
Requirement	 Where Accessible pedestrian entry has multiple doorways At least 1 to be accessible if 3 provided At least 50% to be accessible, if more than 3 provided Where doorway has multiple leaves, at least 1 leaf is to have clear opening of 850mm (excluding automatic doors).
Compliance Comments	Capable of compliance. Where multiple leaf doorways have been used, at least 1 operable leaf is required to provide a clear opening of 850mm with the door circulations spaces as per AS1428.1. Where single hinged doors have been used, the door leaf is required to provide a clear opening of 850mm with the door circulations spaces as per AS1428.1. This is achievable and the door selections are to be verified at CC stage of works.
	BCA Part D3.3 Parts of buildings required to be accessible
Requirement	Every Ramp (excluding fire-isolated ramp) to be compliant with AS1428.1 and slip resistance of ramp and landings compliant with BCA Table D2.14
Compliance Comments	Capable of compliance. Detailed features of the ramp will be assessed with the requirements of AS1428.1 at the CC stage of works.
Requirement Compliance	Every Walkway to be compliant with AS1428.1 Capable of compliance.
Comments	Detailed features of the walkways will be assessed with the requirements of AS1428.1 at the CC stage of works.
	Note: all walkways shall have a barrier or continue for a further 600mm in a different material on each side of the walkway.

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 5 of 38

Requirement	Step / Kerb ramp if provided is to be compliant with AS1428.1 and Slip resistance of ramp and landings compliant with BCA Table D2.14
Compliance	Capable of compliance.
Comments	Detailed features of the ramp will be assessed with the requirements of AS1428.1 at the CC stage of works.
Requirement Compliance	Every Stairway (excluding fire-isolated stairway) is to be compliant with AS1428.1 and slip resistance of treads, landings and nosing strips compliant with BCA Table D2.14 Capable of compliance.
Comments	
Comments	Where non-fire-isolated stairways have been provided, the features of the stairway will be assessed with the requirements of AS1428.1 at the CC stage of works.
Requirement	Every Fire-isolated Stairway is to be compliant with the relevant sections of AS1428.1 & slip resistance of treads, landings and nosing strips compliant with BCA Table D2.14
Compliance	Capable of compliance.
Comments	Where fire-isolated stairways have been provided, the features of the stairway will be assessed with the relevant requirements of AS1428.1 at the CC stage of works.
Requirement	Passing spaces requirement It is a requirement to provide passing spaces in accessways complying with AS1428.1 at maximum 20 M intervals, where a direct line of sight is not available. Space required is width of 1800mmx2800mm (in the direction of travel). Chamfer of 400x400mm is permitted at corners.
Compliance	N/A
Comments	There are no accessways over 20 M lengths in the development where a direct line of sight is not available.
Requirement	Turning spaces requirement It is a requirement to provide turning spaces in accessways complying with AS1428.1 within 2M of the end of accessways where it is not possible to continue travelling and at every 20M intervals. Space required is width of 1540mm x 2070mm (in the direction of travel).
Compliance	Capable of compliance
Comments	Details to be verified at CC stage of works.
	Small building concession In a Class 5, 6, 7b or 8 building containing not more than 3 storeys, a lift / ramp is not required to provide access to levels other than the entrance level if the floor area of the levels other than the entrance level is not more than 200m ² .
Compliance	N/A
Comments	
Requirement	Carpet specifications Carpet if used in areas required to be accessible are to be provided with pile height or thickness not more than 11mm and carpet backing not more than 4mm bringing the total height to a maximum of 15mm.
Compliance	Capable of compliance
Comments	Only applies to carpets provided in the common use areas and commercial use areas.
	Carpet selections generally take place at CC stage of works. Selection of carpets as specified above will lead to compliance and these selection details are to be verified at CC stage of works.

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 6 of 38

	BCA Part D3.4 Exemption
Requirement	Access is not required to be provided in the following areas :
	 where access would be inappropriate because of the use of the area where area would need a health and acfeturials
	 where area would pose a health and safety risk any path which exclusively provides access to an exempted area
Compliance	For information only.
Comments	Areas such as lift machine rooms, fire services room, and mechanical rooms in the development are exempted from providing access under this clause due to WHS concerns.
Dogućnomo nat	BCA Part D3.5 Accessible Carparking
Requirement	Parking Service Accessible carparking space need not be provided when a parking service is provided
	and direct access to any of the carparking spaces is not available to the public.
Compliance	N/A
Comments	
Requirement	Accessible car parking spaces shall have pavement marking in accordance with AS 2890.6.
Compliance	Complies.
Comments	Note: the pavement marking shall have the appropriate slip resistance for the location.
Requirement	In situations where not more than 5 carparking spaces have been provided The car parking space need not be designated, so as to restrict the use of the carparking space only for people with a disability.
Compliance	N/A
Comments	Class 2
Requirement	There are no carparking requirements for a Class 2 under the BCA. If adaptable housing has been mandated by the Council, carparking spaces will be required under the requirements of AS4299- Adaptable housing
Compliance	N/A The parking for the adaptable units is assessed later in this report.
Comments	The parking for the adaptable drifts is assessed later in this report.
Requirement	Class 5, 7, 8 or 9c - 1 space per 100 carparking spaces Class 6
	- 1 space per 50 carparking spaces (up to 1000 spaces) and additional 1 space per additional 100 spaces provided
Compliance	Complies.
Comments	Total number of spaces provided = 300 combined Class 5 & 6 spaces Total number of Accessible car parking spaces required= 6 Total number of Accessible car parking spaces provided= 6 Car parking spaces are to comply with the requirements of AS2890.6. This is to be verified at the CC stage of works.

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 7 of 38

- P (office) 0415 255 163 P (Michael) 0450 334 995 E michael@absaccess.com.au

	BCA Part D3.6 Signage
Requirement	Braille and Tactile signage is required to identify Accessible & Ambulant Sanitary facilities, Fire Exits, areas with Hearing Augmentation and the location of Accessible entrances and toilets
Compliance	Capable of compliance.
Comments	
Requirement	 BCA Part D3.8 Tactile indicators (TGSIs) TGSIs are required when approaching; Stairways other than fire-isolated stairways and stairways within a SOU of a Class 2 building or a non-accessible SOU of a Class 3 building
Compliance	 Escalators / passenger conveyor / moving walk Ramp (other than fire-isolated ramps / kerb or step or swimming pool ramps) Under an overhead obstruction of <2M if no barrier is provided When accessway meets a vehicular way adjacent to a pedestrian entry (if no kerb / kerb ramp provided at the location) Compliance is required with AS1428.4.1 including Luminance contrast and slip resistance requirements for all TGSIs. Capable of compliance.
Comments	 In the proposal, TGSIs are required in the following locations: At top and bottom landings of stairways and 1:14 ramps, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard At mid landings of stairway and 1:14 ramp, <u>300-400mm</u> depth or min 6 discrete cones are required <u>only where handrails are not continuous</u> or landing is more than 3M Where accessway meets a vehicular way, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard. Under the stairway to warn of overhead obstruction, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard. Under the stairway to stair of overhead obstruction, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard.
	BCA Part D3.11 Limitations on Ramps
Requirement	A series of connecting ramps cannot have a vertical height of 3.6M
Compliance	A landing for a step ramp cannot overlap a landing for another ramp
Compliance Comments	
Comments	The series of connecting ramps do not exceed a vertical height of 3.6M Details to be verified at CC stage of works.

Page 8 of 38

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

	BCA Part D3.12 Glazing on Accessways
Requirement	Glazing requirements - Where there is no chair rail, handrail or transom, all frameless or fully glazed doors, sidelights and any glazing capable of being mistaken for a doorway or opening are required to have a glazing strip as per requirements of
	AS1428.1
Compliance	Capable of compliance
Comments	Applies to full length glazing used in common use areas such as lift lobbies and common passageways and in all commercial use areas. Glazing strip selections are to be verified at CC stage of works.

BCA Part F Accessible Sanitary Facilities **BCA F2.4 Accessible sanitary facilities** Requirement Accessible unisex toilet is to be provided in accessible part of building such that; It can be entered without crossing an area reserved for 1 sex only Where male and female sanitary facilities are provided at different locations, Accessible unisex toilet is only required at one of the locations Even distribution of LH and RH facilities If no lift is required to be provided to a level, then accessible facility is not required on that level. Compliance Capable of compliance Comments Common use unisex accessible toilet facilities will be provided in the development. Details to be verified at CC stage of works. Requirement Accessible unisex toilet are to be designed in accordance with AS1428.1 Compliance Capable of compliance Comments The width and length requirements depend on selected fixtures. Minimum size of an accessible toilet is required to be 1.9M x 2.7M after tiling works. To be verified at CC stage of works. Requirement Ambulant use male / female toilets are to be provided if an additional toilet to the Accessible unisex toilet is provided. Compliance Capable of compliance Comments Ambulant facilities will be provided Details to be verified at CC stage of works. Requirement Ambulant use toilets are to be designed in accordance with AS1428.1. Compliance Complies with the width and length requirements Comments Minimum size of an accessible toilet is required to be 900mm to 920mm width x 1.62M (dependent on WC pan and location of door to the cubicle) To be verified at CC stage of works.

Job No 219285

124 Upper Washington Drive,

Bonnet Bay NSW 2226

Accessible Building Solutions ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 9 of 38

P (office) 0415 255 163 P (Michael) 0450 334 995

_	BCA F2.4(a) Accessible unisex sanitary compartments
Requirement	Class 2 At least 1 when sanitary compartments are provided in common areas.
Compliance	N/A No common use sanitary facilities have been proposed in the development.
Comments	
Requirement	Class 5, 6, 7, 8 or 9 (excluding ward area of 9a health-care) 1 on every storey containing sanitary compartments.
0 "	Where more than 1 bank of sanitary compartments on a level, at 50% of banks
Compliance Comments	Capable of compliance
Comments	To be verified at CC stage of works.
Requirement	Class 10a (excluding 10a attached to another class of building and excluding a sanitary compartment dedicated to a single caravan/ camping site) 1 at each bank containing sanitary compartments.
Compliance	N/A No common use sanitary facilities have been proposed in the development.
Comments	
	BCA F2.4(b) Requirements for Accessible unisex showers as per AS1428.1-2009
Requirement	Class 2
Compliance	At least 1 when showers are provided in common areas.
Comments	No common use shower facilities have been proposed in the development.
Requirement Compliance	Class 5, 6, 7, 8 or 9 (excluding ward area of 9a health-care) When BCA requires provision of 1 or more showers, then 1 for every 10 showers. N/A
Comments	No common use shower facilities have been proposed in the development.
Poquiromont	
Requirement	Class 10a (excluding 10a attached to another class of building and excluding a sanitary compartment dedicated to a single caravan/ camping site) Where provided, 1 for every 10 showers.
Compliance	N/A
Comments	No common use shower facilities have been proposed in the development.

Page 10 of 38

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

	BCA F2.9 Accessible Adult Change Facilities
Requirement	Class 6
	Where the building is a shopping centre having a design occupancy of not less than
0	3,500 people and containing a minimum of 2 sole occupancy units
Compliance	N/A
Comments	No accessible adult change facilities are required in the development.
	BCA Part E Lift Installations
Requirement	In an accessible building, every passenger lift must comply with Tables E3.6(a) and E3.6(b).
Compliance	Capable of compliance
Comments	 Lift floor dimensions (excluding stairway platform lift) are listed below. Lifts traveling 12M or under, floor size, 1100mm wide x 1400mm deep Lifts travelling more than 12M, floor size 1400mm wide x 1600mm deep Details to be verified at CC stage of works.
Requirement	If the effective height of the building is over 12M, at least one of the lifts is required to be a stretcher lift, which is to accommodate a raised stretcher with clear space of not less than 600 x 2000mm long x 1400mm high above FFL.
Compliance	Capable of compliance
Comments	Details to be verified at CC stage of works.

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 11 of 38

The following tables assess compliance with the relevant parts of the BCA and Standards **BCA Assessment for Buildings F, G, H, J & K**

	BCA Part D3 Access for People with a Disability BCA D3.1 Requirements for Access for people with a disability SOU refers to Sole Occupancy Unit
Requirement	
Compliance	Complies.
Comments	Access has been provided from the main pedestrian entry to the entry doors of all SOUs on all levels by means of a lift. Access has been provided to communal open space. Details to be verified at CC stage of works.
Requirement	Class 7a To and within any level containing accessible carparking spaces.
Compliance	Complies.
Comments	Access has been provided to the basement level containing the accessible car parking spaces by means of a lift. Details to be verified at CC stage of works.
Requirement	 In areas required to be accessible, the following is to be provided: Width of accessways shall be min 1M clear, and to be increased for door circulation, turning areas and passing areas as required by AS 1428.1 Doors shall provide a clear opening of 850mm with a step free threshold and the required circulation spaces, hardware and luminance contrast as required by AS 1428.1 The separation of doors in airlocks shall comply with AS 1428.1 Door mats, floor grates and the abutment of different finishes shall comply with BCA and AS 1428.1 In accessible sole occupancy units, the light switches shall be 30x30mm min size at a height to match the door handles. GPOs shall be located between 600 and 1100mm above the floor and 500mm from an internal corner.
Compliance	Capable of compliance.
Comments	All of the above listed requirements are achievable and to be assessed for compliance at verified at CC stage of works.

Job No 219285

_

Page 12 of 38

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226 ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust **P** (office) 0415 255 163 **P** (Michael) 0450 334 995

	BCA Part D3.2 Access to buildings
Requirement	 Accessway is required from; Main pedestrian entry at the site boundary for new buildings Main pedestrian entry door for existing buildings Any other accessible building connected by a pedestrian link Accessible car parking spaces Complies.
Comments	Access has been provided from the main pedestrian entry at the site boundary by means of a pathway / ramp. Access has been provided from accessible car parking spaces by means of a lift. Details to be verified at CC stage of works.
Requirement	 Accessway is required through: Main entry and Not less than 50% of all pedestrian entrances and in building with floor area over 500m², non-accessible entry and accessible entry to be not more than 50M apart.
Compliance Comments	Capable of compliance. An accessible entry has been provided to each building. Details to be verified at CC stage of works.
Requirement	 Where Accessible pedestrian entry has multiple doorways At least 1 to be accessible if 3 provided At least 50% to be accessible, if more than 3 provided Where doorway has multiple leaves, at least 1 leaf is to have clear opening of 850mm (excluding automatic doors).
Compliance Comments	Capable of compliance. Where multiple leaf doorways have been used, at least 1 operable leaf is required to provide a clear opening of 850mm with the door circulations spaces as per AS1428.1. Where single hinged doors have been used, the door leaf is required to provide a clear opening of 850mm with the door circulations spaces as per AS1428.1. This is achievable and the door selections are to be verified at CC stage of works.
	BCA Part D3.3 Parts of buildings required to be accessible
Requirement	Every Ramp (excluding fire-isolated ramp) to be compliant with AS1428.1 and slip resistance of ramp and landings compliant with BCA Table D2.14
Compliance Comments	Capable of compliance. Detailed features of the ramp will be assessed with the requirements of AS1428.1 at the CC stage of works.
Requirement Compliance	Every Walkway to be compliant with AS1428.1 Capable of compliance.
Comments	Detailed features of the walkways will be assessed with the requirements of AS1428.1 at the CC stage of works.
	Note: all walkways shall have a barrier or continue for a further 600mm in a different material on each side of the walkway.

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 13 of 38

Requirement	Step / Kerb ramp if provided is to be compliant with AS1428.1 and Slip resistance of ramp and landings compliant with BCA Table D2.14
Compliance	Capable of compliance.
Comments	Detailed features of the ramp will be assessed with the requirements of AS1428.1 at the CC stage of works.
Requirement	Every Stairway (excluding fire-isolated stairway) is to be compliant with AS1428.1 and slip resistance of treads, landings and nosing strips compliant with BCA Table D2.14
Compliance	Capable of compliance.
Comments	Where non-fire-isolated stairways have been provided, the features of the stairway will be assessed with the requirements of AS1428.1 at the CC stage of works.
Requirement	Every Fire-isolated Stairway is to be compliant with the relevant sections of AS1428.1 & slip resistance of treads, landings and nosing strips compliant with BCA Table D2.14
Compliance	Capable of compliance.
Comments	Where fire-isolated stairways have been provided, the features of the stairway will be assessed with the relevant requirements of AS1428.1 at the CC stage of works.
Requirement	Passing spaces requirement It is a requirement to provide passing spaces in accessways complying with AS1428.1 at maximum 20 M intervals, where a direct line of sight is not available. Space required is width of 1800mmx2800mm (in the direction of travel). Chamfer of 400x400mm is permitted at corners.
Compliance	N/A
Comments	There are no accessways over 20 M lengths in the development where a direct line of sight is not available.
Requirement	Turning spaces requirement It is a requirement to provide turning spaces in accessways complying with AS1428.1 within 2M of the end of accessways where it is not possible to continue travelling and at every 20M intervals. Space required is width of 1540mm x 2070mm (in the direction of travel).
Compliance	Capable of compliance
Comments	Details to be verified at CC stage of works.
Requirement	Carpet specifications Carpet if used in areas required to be accessible are to be provided with pile height or thickness not more than 11mm and carpet backing not more than 4mm bringing the total height to a maximum of 15mm.
Compliance	Capable of compliance
Comments	Only applies to carpets provided in the common use areas.
	Carpet selections generally take place at CC stage of works. Selection of carpets as specified above will lead to compliance and these selection details are to be verified at CC stage of works.

Page 14 of 38

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

	BCA Part D3.4 Exemption
Requirement	Access is not required to be provided in the following areas :
	where access would be inappropriate because of the use of the area
	where area would pose a health and safety risk
Compliance	 any path which exclusively provides access to an exempted area For information only.
Comments	
Comments	Areas such as lift machine rooms, fire services room, and mechanical rooms in the development are exempted from providing access under this clause due to WHS concerns.
	BCA Part D3.5 Accessible Carparking
Requirement	Parking Service
	Accessible carparking space need not be provided when a parking service is provided and direct access to any of the carparking spaces is not available to the public.
Compliance	N/A
Comments	
Requirement	Accessible car parking spaces shall have pavement marking in accordance with AS 2890.6.
Compliance	Complies.
Comments	Note: the pavement marking shall have the appropriate slip resistance for the location.
Requirement	In situations where not more than 5 carparking spaces have been provided The car parking space need not be designated, so as to restrict the use of the carparking space only for people with a disability.
Compliance	N/A
Comments Requirement	Class 2
	There are no carparking requirements for a Class 2 under the BCA. If adaptable housing has been mandated by the Council, carparking spaces will be required under the requirements of AS4299- Adaptable housing
Compliance	N/A The parking for the adaptable units is assessed later in this report.
Comments	
	BCA Part D3.6 Signage
Requirement	Braille and Tactile signage is required to identify Accessible & Ambulant Sanitary facilities, Fire Exits, areas with Hearing Augmentation and the location of Accessible entrances and toilets
Compliance	Capable of compliance.
Comments	

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 15 of 38

	BCA Part D3.8 Tactile indicators (TGSIs)
Requirement	 TGSIs are required when approaching; Stairways other than fire-isolated stairways and stairways within a SOU of a Class 2 building or a non-accessible SOU of a Class 3 building Escalators / passenger conveyor / moving walk Ramp (other than fire-isolated ramps / kerb or step or swimming pool ramps) Under an overhead obstruction of <2M if no barrier is provided When accessway meets a vehicular way adjacent to a pedestrian entry (if no kerb / kerb ramp provided at the location) Compliance is required with AS1428.4.1 including Luminance contrast and slip resistance requirements for all TGSIs.
Compliance	Capable of compliance.
Comments	 In the proposal, TGSIs are required in the following locations: At top and bottom landings of stairways and 1:14 ramps, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard At mid landings of stairway and 1:14 ramp, 300-400mm depth or min 6 discrete cones are required only where handrails are not continuous or landing is more than 3M Where accessway meets a vehicular way, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard. Under the stairway to warn of overhead obstruction, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard. Under the stairway to warn of overhead obstruction, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard.
Requirement	 BCA Part D3.11 Limitations on Ramps A series of connecting ramps cannot have a vertical height of 3.6M
0 "	A landing for a step ramp cannot overlap a landing for another ramp
Compliance Comments	Complies
Comments	The series of connecting ramps do not exceed a vertical height of 3.6M Details to be verified at CC stage of works.
Requirement	BCA Part D3.12 Glazing on Accessways Glazing requirements- Where there is no chair rail, handrail or transom, all frameless
	or fully glazed doors, sidelights and any glazing capable of being mistaken for a doorway or opening are required to have a glazing strip as per requirements of AS1428.1
Compliance	doorway or opening are required to have a glazing strip as per requirements of
Compliance Comments	doorway or opening are required to have a glazing strip as per requirements of AS1428.1

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 16 of 38

	BCA Part F Accessible Sanitary Facilities BCA F2.4 Accessible sanitary facilities
Requirement	 Accessible unisex toilet is to be provided in accessible part of building such that; It can be entered without crossing an area reserved for 1 sex only Where male and female sanitary facilities are provided at different locations, Accessible unisex toilet is only required at one of the locations Even distribution of LH and RH facilities
	If no lift is required to be provided to a level, then accessible facility is not required on that level.
Compliance	N/A No common use sanitary facilities have been proposed in the development.
Comments	To be verified at CC stage of works.
Requirement	Ambulant use male / female toilets are to be provided if an additional toilet to the Accessible unisex toilet is provided.
Compliance Comments	N/A. No sanitary facilities in addition to the accessible toilet have been provided in the development.
Requirement	BCA F2.4(a) Accessible unisex sanitary compartments Class 2
	At least 1 when sanitary compartments are provided in common areas.
Compliance Comments	N/A No common use sanitary facilities have been proposed in the development.
Requirement	BCA F2.4(b) Requirements for Accessible unisex showers as per AS1428.1-2009 Class 2
Compliance	At least 1 when showers are provided in common areas.
Comments	No common use shower facilities have been proposed in the development.

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 17 of 38

	DCA Part E Lift installations
Requirement	In an accessible building, every passenger lift must comply with Tables E3.6(a) and E3.6(b).
Compliance	Capable of compliance
Comments	 Lift floor dimensions (excluding stairway platform lift) are listed below. Lifts traveling 12M or under, floor size, 1100mm wide x 1400mm deep Lifts travelling more than 12M, floor size 1400mm wide x 1600mm deep Details to be verified at CC stage of works.
Requirement	If the effective height of the building is over 12M, at least one of the lifts is required to be a stretcher lift, which is to accommodate a raised stretcher with clear space of not less than 600 x 2000mm long x 1400mm high above FFL.
Compliance	Capable of compliance
Comments	Details to be verified at CC stage of works.

BCA Part F L ift Installations

Job No 219285

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 18 of 38

The following tables assess compliance with the relevant parts of the BCA and Standards BCA Assessment for Buildings L, M, N & P

	BCA Part D3 Access for People with a Disability BCA D3.1 Requirements for Access for people with a disability SOU refers to Sole Occupancy Unit
Requirement Compliance	 Class 2 From a required accessible pedestrian entrance to at least 1 floor with SOUs and till the entry of doors of each SOU on that level. To and within 1 of each type of room or space in common use. Where floor is accessed by an AS1428.1 ramp or lift, all SOUs on that level till the entry door and to and within all common use areas on that level. Complies.
Comments	Access has been provided from the main pedestrian entry to the entry doors of all SOUs on all levels by means of a lift. Access has been provided to communal open space. On level 3 Building L there are steps with the corridor but access is available to each level. Details to be verified at CC stage of works.
Requirement Compliance	Class 7a To and within any level containing accessible carparking spaces. Complies.
Comments	Access has been provided to the basement level containing the accessible car parking spaces by means of a lift. Details to be verified at CC stage of works.
Requirement	 In areas required to be accessible, the following is to be provided: Width of accessways shall be min 1M clear, and to be increased for door circulation, turning areas and passing areas as required by AS 1428.1 Doors shall provide a clear opening of 850mm with a step free threshold and the required circulation spaces, hardware and luminance contrast as required by AS 1428.1 The separation of doors in airlocks shall comply with AS 1428.1 Door mats, floor grates and the abutment of different finishes shall comply with BCA and AS 1428.1 In accessible sole occupancy units, the light switches shall be 30x30mm min size at a height to match the door handles. GPOs shall be located between 600 and 1100mm above the floor and 500mm from an internal corner.
Compliance Comments	Capable of compliance. All of the above listed requirements are achievable and to be assessed for compliance
	at verified at CC stage of works.
l	

Job No 219285

_

Page 19 of 38

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

	BCA Part D3.2 Access to buildings
Requirement	 Accessway is required from; Main pedestrian entry at the site boundary for new buildings Main pedestrian entry door for existing buildings Any other accessible building connected by a pedestrian link Accessible car parking spaces Complies.
Comments	Access has been provided from the main pedestrian entry at the site boundary by means of a pathway / ramp. Access has been provided from accessible car parking spaces by means of a lift. Details to be verified at CC stage of works.
Requirement	 Accessway is required through: Main entry and Not less than 50% of all pedestrian entrances and in building with floor area over 500m², non-accessible entry and accessible entry to be not more than 50M apart.
Compliance Comments	Capable of compliance. An accessible entry has been provided to each building. Details to be verified at CC stage of works.
Requirement	 Where Accessible pedestrian entry has multiple doorways At least 1 to be accessible if 3 provided At least 50% to be accessible, if more than 3 provided Where doorway has multiple leaves, at least 1 leaf is to have clear opening of 850mm (excluding automatic doors).
Compliance Comments	Capable of compliance. Where multiple leaf doorways have been used, at least 1 operable leaf is required to provide a clear opening of 850mm with the door circulations spaces as per AS1428.1. Where single hinged doors have been used, the door leaf is required to provide a clear opening of 850mm with the door circulations spaces as per AS1428.1. This is achievable and the door selections are to be verified at CC stage of works.
	BCA Part D3.3 Parts of buildings required to be accessible
Requirement	Every Ramp (excluding fire-isolated ramp) to be compliant with AS1428.1 and slip resistance of ramp and landings compliant with BCA Table D2.14
Compliance Comments	Capable of compliance. Detailed features of the ramp will be assessed with the requirements of AS1428.1 at the CC stage of works.
Requirement Compliance	Every Walkway to be compliant with AS1428.1 Capable of compliance.
Comments	Detailed features of the walkways will be assessed with the requirements of AS1428.1 at the CC stage of works.
	Note: all walkways shall have a barrier or continue for a further 600mm in a different material on each side of the walkway.

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 20 of 38

Requirement	Step / Kerb ramp if provided is to be compliant with AS1428.1 and Slip resistance of ramp and landings compliant with BCA Table D2.14
Compliance	Capable of compliance.
Comments	Detailed features of the ramp will be assessed with the requirements of AS1428.1 at the CC stage of works.
Requirement Compliance	Every Stairway (excluding fire-isolated stairway) is to be compliant with AS1428.1 and slip resistance of treads, landings and nosing strips compliant with BCA Table D2.14 Capable of compliance.
Comments	Where non-fire-isolated stairways have been provided, the features of the stairway will be assessed with the requirements of AS1428.1 at the CC stage of works.
Requirement Compliance	Every Fire-isolated Stairway is to be compliant with the relevant sections of AS1428.1 & slip resistance of treads, landings and nosing strips compliant with BCA Table D2.14
	Capable of compliance.
Comments	Where fire-isolated stairways have been provided, the features of the stairway will be assessed with the relevant requirements of AS1428.1 at the CC stage of works.
Requirement	Passing spaces requirement It is a requirement to provide passing spaces in accessways complying with AS1428.1 at maximum 20 M intervals, where a direct line of sight is not available. Space required is width of 1800mmx2800mm (in the direction of travel). Chamfer of 400x400mm is permitted at corners.
Compliance	N/A
Comments	There are no accessways over 20 M lengths in the development where a direct line of
	sight is not available.
Requirement	Turning spaces requirement It is a requirement to provide turning spaces in accessways complying with AS1428.1 within 2M of the end of accessways where it is not possible to continue travelling and at every 20M intervals. Space required is width of 1540mm x 2070mm (in the direction
<i>Requirement</i> <i>Compliance</i>	Turning spaces requirement It is a requirement to provide turning spaces in accessways complying with AS1428.1 within 2M of the end of accessways where it is not possible to continue travelling and at every 20M intervals. Space required is width of 1540mm x 2070mm (in the direction of travel).
	Turning spaces requirement It is a requirement to provide turning spaces in accessways complying with AS1428.1 within 2M of the end of accessways where it is not possible to continue travelling and at every 20M intervals. Space required is width of 1540mm x 2070mm (in the direction of travel). Capable of compliance
Compliance	Turning spaces requirement It is a requirement to provide turning spaces in accessways complying with AS1428.1 within 2M of the end of accessways where it is not possible to continue travelling and at every 20M intervals. Space required is width of 1540mm x 2070mm (in the direction of travel).
Compliance Comments Requirement	Turning spaces requirement It is a requirement to provide turning spaces in accessways complying with AS1428.1 within 2M of the end of accessways where it is not possible to continue travelling and at every 20M intervals. Space required is width of 1540mm x 2070mm (in the direction of travel). Capable of compliance Details to be verified at CC stage of works. Carpet specifications Carpet if used in areas required to be accessible are to be provided with pile height or thickness not more than 11mm and carpet backing not more than 4mm bringing the total height to a maximum of 15mm.
Compliance Comments Requirement Compliance	Turning spaces requirement It is a requirement to provide turning spaces in accessways complying with AS1428.1 within 2M of the end of accessways where it is not possible to continue travelling and at every 20M intervals. Space required is width of 1540mm x 2070mm (in the direction of travel). Capable of compliance Details to be verified at CC stage of works. Carpet specifications Carpet if used in areas required to be accessible are to be provided with pile height or thickness not more than 11mm and carpet backing not more than 4mm bringing the total height to a maximum of 15mm. Capable of compliance
Compliance Comments Requirement	Turning spaces requirement It is a requirement to provide turning spaces in accessways complying with AS1428.1 within 2M of the end of accessways where it is not possible to continue travelling and at every 20M intervals. Space required is width of 1540mm x 2070mm (in the direction of travel). Capable of compliance Details to be verified at CC stage of works. Carpet specifications Carpet if used in areas required to be accessible are to be provided with pile height or thickness not more than 11mm and carpet backing not more than 4mm bringing the total height to a maximum of 15mm. Capable of compliance Only applies to carpets provided in the common use areas.
Compliance Comments Requirement Compliance	Turning spaces requirement It is a requirement to provide turning spaces in accessways complying with AS1428.1 within 2M of the end of accessways where it is not possible to continue travelling and at every 20M intervals. Space required is width of 1540mm x 2070mm (in the direction of travel). Capable of compliance Details to be verified at CC stage of works. Carpet specifications Carpet if used in areas required to be accessible are to be provided with pile height or thickness not more than 11mm and carpet backing not more than 4mm bringing the total height to a maximum of 15mm. Capable of compliance

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 21 of 38

	BCA Part D3.4 Exemption
Requirement	Access is not required to be provided in the following areas :
	where access would be inappropriate because of the use of the area
	where area would pose a health and safety risk
Compliance	any path which exclusively provides access to an exempted area For information only.
Comments	
Comments	Areas such as lift machine rooms, fire services room, and mechanical rooms in the development are exempted from providing access under this clause due to WHS concerns.
Requirement	BCA Part D3.5 Accessible Carparking Parking Service
	Accessible carparking space need not be provided when a parking service is provided
	and direct access to any of the carparking spaces is not available to the public.
Compliance	N/A
Comments Requirement	Accessible car parking spaces shall have pavement marking in accordance with
roquionon	AS 2890.6.
Compliance	Complies.
Comments	Note: the pavement marking shall have the appropriate slip resistance for the location.
Requirement	In situations where not more than 5 carparking spaces have been provided The car parking space need not be designated, so as to restrict the use of the carparking space only for people with a disability.
Compliance	N/A
Comments Requirement	Class 2
	There are no carparking requirements for a Class 2 under the BCA. If adaptable housing has been mandated by the Council, carparking spaces will be required under the requirements of AS4299- Adaptable housing
Compliance	N/A The parking for the adaptable units is assessed later in this report.
Comments	The parking for the adaptable drifts is assessed later in this report.
	BCA Part D3.6 Signage
Requirement	Braille and Tactile signage is required to identify Accessible & Ambulant Sanitary facilities, Fire Exits, areas with Hearing Augmentation and the location of Accessible entrances and toilets
Compliance	Capable of compliance.
Comments	

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 22 of 38

	BCA Part D3.8 Tactile indicators (TGSIs)
Requirement	 TGSIs are required when approaching; Stairways other than fire-isolated stairways and stairways within a SOU of a Class 2 building or a non-accessible SOU of a Class 3 building Escalators / passenger conveyor / moving walk Ramp (other than fire-isolated ramps / kerb or step or swimming pool ramps) Under an overhead obstruction of <2M if no barrier is provided When accessway meets a vehicular way adjacent to a pedestrian entry (if no kerb / kerb ramp provided at the location) Compliance is required with AS1428.4.1 including Luminance contrast and slip resistance requirements for all TGSIs.
Compliance Comments	Capable of compliance.
Comments	 In the proposal, TGSIs are required in the following locations: At top and bottom landings of stairways and 1:14 ramps, <u>600-800mm</u> depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard At mid landings of stairway and 1:14 ramp, <u>300-400mm</u> depth or min 6 discrete cones are required <u>only where handrails are not continuous</u> or landing is more than 3M Where accessway meets a vehicular way, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard. Under the stairway to warn of overhead obstruction, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard. Under the stairway to warn of overhead obstruction, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard.
Requirement Compliance Comments	 BCA Part D3.11 Limitations on Ramps A series of connecting ramps cannot have a vertical height of 3.6M A landing for a step ramp cannot overlap a landing for another ramp Complies The series of connecting ramps do not exceed a vertical height of 3.6M Details to be verified at CC stage of works.
	BCA Part D3.12 Glazing on Accessways
Requirement	Glazing requirements - Where there is no chair rail, handrail or transom, all frameless or fully glazed doors, sidelights and any glazing capable of being mistaken for a doorway or opening are required to have a glazing strip as per requirements of AS1428.1
Compliance	Capable of compliance
Comments	Applies to full length glazing used in common use areas such as lift lobbies and common passageways. Glazing strip selections are to be verified at CC stage of works.

Page 23 of 38

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

	BCA Part F Accessible Sanitary Facilities BCA F2.4 Accessible sanitary facilities
Requirement	 Accessible unisex toilet is to be provided in accessible part of building such that; It can be entered without crossing an area reserved for 1 sex only Where male and female sanitary facilities are provided at different locations, Accessible unisex toilet is only required at one of the locations Even distribution of LH and RH facilities If no lift is required to be provided to a level, then accessible facility is not required on that level.
Compliance	N/A
Comments	No common use sanitary facilities have been proposed in the development. To be verified at CC stage of works.
Requirement	Ambulant use male / female toilets are to be provided if an additional toilet to the Accessible unisex toilet is provided.
Compliance Comments	N/A. No sanitary facilities in addition to the accessible toilet have been provided in the development.
Requirement Compliance Comments	BCA F2.4(a) Accessible unisex sanitary compartments Class 2 At least 1 when sanitary compartments are provided in common areas. N/A No common use sanitary facilities have been proposed in the development.
Requirement	BCA F2.4(b) Requirements for Accessible unisex showers as per AS1428.1-2009 Class 2 At least 1 when showers are provided in common areas.
Compliance	N/A
Comments	N/A No common use shower facilities have been proposed in the development.

Page 24 of 38

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

BCA Part E Lift Installations

BCA Part E Lift Installations				
Requirement	In an accessible building, every passenger lift must comply with Tables E3.6(a) and E3.6(b).			
Compliance	Capable of compliance			
Comments	 Lift floor dimensions (excluding stairway platform lift) are listed below. Lifts traveling 12M or under, floor size, 1100mm wide x 1400mm deep Lifts travelling more than 12M, floor size 1400mm wide x 1600mm deep Details to be verified at CC stage of works. 			
Requirement	If the effective height of the building is over 12M, at least one of the lifts is required to be a stretcher lift, which is to accommodate a raised stretcher with clear space of not less than 600 x 2000mm long x 1400mm high above FFL.			
Compliance	Capable of compliance			
Comments	Details to be verified at CC stage of works.			

Job No 219285

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 25 of 38

The following tables assess compliance with the relevant parts of the BCA and Standards BCA Assessment for Buildings Q, R & S

	BCA Part D3 Access for People with a Disability BCA D3.1 Requirements for Access for people with a disability SOU refers to Sole Occupancy Unit				
Requirement					
Compliance	Complies.				
Comments	Access has been provided from the main pedestrian entry to the entry doors of all SOUs on all levels by means of a lift. Access has been provided to communal open space. Details to be verified at CC stage of works.				
Requirement	Class 7a To and within any level containing accessible carparking spaces.				
Compliance	Complies.				
Comments	Access has been provided to the basement level containing the accessible car parking spaces by means of a lift. Details to be verified at CC stage of works.				
Requirement	 In areas required to be accessible, the following is to be provided: Width of accessways shall be min 1M clear, and to be increased for door circulation, turning areas and passing areas as required by AS 1428.1 Doors shall provide a clear opening of 850mm with a step free threshold and the required circulation spaces, hardware and luminance contrast as required by AS 1428.1 The separation of doors in airlocks shall comply with AS 1428.1 Door mats, floor grates and the abutment of different finishes shall comply with BCA and AS 1428.1 In accessible sole occupancy units, the light switches shall be 30x30mm min size at a height to match the door handles. GPOs shall be located between 600 and 1100mm above the floor and 500mm from an internal corner. 				
Compliance	Capable of compliance.				
Comments	All of the above listed requirements are achievable and to be assessed for compliance at verified at CC stage of works.				

Job No 219285

Page 26 of 38

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

	BCA Part D3.2 Access to buildings
Requirement	 Accessway is required from; Main pedestrian entry at the site boundary for new buildings Main pedestrian entry door for existing buildings Any other accessible building connected by a pedestrian link Accessible car parking spaces Complies.
Comments	Access has been provided from the main pedestrian entry at the site boundary by means of a pathway / ramp. Access has been provided from accessible car parking spaces by means of a lift. Details to be verified at CC stage of works.
Requirement	 Accessway is required through: Main entry and Not less than 50% of all pedestrian entrances and in building with floor area over 500m², non-accessible entry and accessible entry to be not more than 50M apart.
Compliance Comments	Capable of compliance. An accessible entry has been provided to each building. Details to be verified at CC stage of works.
Requirement	 Where Accessible pedestrian entry has multiple doorways At least 1 to be accessible if 3 provided At least 50% to be accessible, if more than 3 provided Where doorway has multiple leaves, at least 1 leaf is to have clear opening of 850mm (excluding automatic doors).
Compliance Comments	Capable of compliance. Where multiple leaf doorways have been used, at least 1 operable leaf is required to provide a clear opening of 850mm with the door circulations spaces as per AS1428.1. Where single hinged doors have been used, the door leaf is required to provide a clear opening of 850mm with the door circulations spaces as per AS1428.1. This is achievable and the door selections are to be verified at CC stage of works.
	BCA Part D3.3 Parts of buildings required to be accessible
Requirement	Every Ramp (excluding fire-isolated ramp) to be compliant with AS1428.1 and slip resistance of ramp and landings compliant with BCA Table D2.14
Compliance Comments	Capable of compliance. Detailed features of the ramp will be assessed with the requirements of AS1428.1 at the CC stage of works.
Requirement Compliance	Every Walkway to be compliant with AS1428.1 Capable of compliance.
Comments	Detailed features of the walkways will be assessed with the requirements of AS1428.1 at the CC stage of works.
	Note: all walkways shall have a barrier or continue for a further 600mm in a different material on each side of the walkway.

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 27 of 38

Requirement	Step / Kerb ramp if provided is to be compliant with AS1428.1 and Slip resistance of ramp and landings compliant with BCA Table D2.14
Compliance	Capable of compliance.
Comments	Detailed features of the ramp will be assessed with the requirements of AS1428.1 at the CC stage of works.
Requirement Compliance	Every Stairway (excluding fire-isolated stairway) is to be compliant with AS1428.1 and slip resistance of treads, landings and nosing strips compliant with BCA Table D2.14 Capable of compliance.
Comments	
Comments	Where non-fire-isolated stairways have been provided, the features of the stairway will be assessed with the requirements of AS1428.1 at the CC stage of works.
Requirement	Every Fire-isolated Stairway is to be compliant with the relevant sections of AS1428.1 & slip resistance of treads, landings and nosing strips compliant with BCA Table D2.14
Compliance	Capable of compliance.
Comments	Where fire-isolated stairways have been provided, the features of the stairway will be assessed with the relevant requirements of AS1428.1 at the CC stage of works.
Requirement	Passing spaces requirement It is a requirement to provide passing spaces in accessways complying with AS1428.1 at maximum 20 M intervals, where a direct line of sight is not available. Space required is width of 1800mmx2800mm (in the direction of travel). Chamfer of 400x400mm is permitted at corners.
Compliance	N/A
Comments	There are no accessways over 20 M lengths in the development where a direct line of sight is not available.
Requirement	Turning spaces requirement It is a requirement to provide turning spaces in accessways complying with AS1428.1 within 2M of the end of accessways where it is not possible to continue travelling and at every 20M intervals. Space required is width of 1540mm x 2070mm (in the direction of travel).
Compliance	Capable of compliance
Comments	Details to be verified at CC stage of works.
	Carpet specifications Carpet if used in areas required to be accessible are to be provided with pile height or thickness not more than 11mm and carpet backing not more than 4mm bringing the total height to a maximum of 15mm.
Compliance	Capable of compliance
Comments	Only applies to carpets provided in the common use areas.
	Carpet selections generally take place at CC stage of works. Selection of carpets as specified above will lead to compliance and these selection details are to be verified at CC stage of works.

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 28 of 38

	BCA Part D3.4 Exemption
Requirement	 Access is not required to be provided in the following areas : where access would be inappropriate because of the use of the area where area would pose a health and safety risk
	any path which exclusively provides access to an exempted area
Compliance	For information only.
Comments	Areas such as lift machine rooms, fire services room, and mechanical rooms in the development are exempted from providing access under this clause due to WHS concerns.
	BCA Part D3.5 Accessible Carparking
Requirement	Parking Service Accessible carparking space need not be provided when a parking service is provided and direct access to any of the carparking spaces is not available to the public.
Compliance	N/A
Comments Requirement	Accessible car parking spaces shall have pavement marking in accordance with
Nequilement	Accessible car parking spaces shall have pavement marking in accordance with AS 2890.6.
Compliance	Complies.
Comments	Note: the pavement marking shall have the appropriate slip resistance for the location.
Requirement	In situations where not more than 5 carparking spaces have been provided The car parking space need not be designated, so as to restrict the use of the carparking space only for people with a disability.
Compliance	N/A
Comments Requirement	Class 2
	There are no carparking requirements for a Class 2 under the BCA. If adaptable housing has been mandated by the Council, carparking spaces will be required under the requirements of AS4299- Adaptable housing
Compliance	N/A The parking for the adaptable units is assessed later in this report.
Comments	
Deminent	BCA Part D3.6 Signage
Requirement	Braille and Tactile signage is required to identify Accessible & Ambulant Sanitary facilities, Fire Exits, areas with Hearing Augmentation and the location of Accessible entrances and toilets
Compliance	Capable of compliance.
Comments	

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 29 of 38

	BCA Part D3.8 Tactile indicators (TGSIs)
Requirement	 TGSIs are required when approaching; Stairways other than fire-isolated stairways and stairways within a SOU of a Class 2 building or a non-accessible SOU of a Class 3 building Escalators / passenger conveyor / moving walk Ramp (other than fire-isolated ramps / kerb or step or swimming pool ramps) Under an overhead obstruction of <2M if no barrier is provided When accessway meets a vehicular way adjacent to a pedestrian entry (if no kerb / kerb ramp provided at the location) Compliance is required with AS1428.4.1 including Luminance contrast and slip resistance requirements for all TGSIs.
Compliance Comments	Capable of compliance.
Comments	 In the proposal, TGSIs are required in the following locations: At top and bottom landings of stairways and 1:14 ramps, <u>600-800mm</u> depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard At mid landings of stairway and 1:14 ramp, <u>300-400mm</u> depth or min 6 discrete cones are required <u>only where handrails are not continuous</u> or landing is more than 3M Where accessway meets a vehicular way, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard. Under the stairway to warn of overhead obstruction, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard. Under the stairway to warn of overhead obstruction, 600-800mm depth or min 12 discrete cones are required at 300+/-10mm from edge of hazard.
Requirement Compliance Comments	 BCA Part D3.11 Limitations on Ramps A series of connecting ramps cannot have a vertical height of 3.6M A landing for a step ramp cannot overlap a landing for another ramp Complies The series of connecting ramps do not exceed a vertical height of 3.6M Details to be verified at CC stage of works.
	BCA Part D3.12 Glazing on Accessways
Requirement	Glazing requirements - Where there is no chair rail, handrail or transom, all frameless or fully glazed doors, sidelights and any glazing capable of being mistaken for a doorway or opening are required to have a glazing strip as per requirements of AS1428.1
Compliance	Capable of compliance
Comments	Applies to full length glazing used in common use areas such as lift lobbies and common passageways. Glazing strip selections are to be verified at CC stage of works.

Page 30 of 38

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

	BCA Part F Accessible Sanitary Facilities BCA F2.4 Accessible sanitary facilities
Requirement	 Accessible unisex toilet is to be provided in accessible part of building such that; It can be entered without crossing an area reserved for 1 sex only Where male and female sanitary facilities are provided at different locations, Accessible unisex toilet is only required at one of the locations Even distribution of LH and RH facilities If no lift is required to be provided to a level, then accessible facility is not required on that level.
Compliance	N/A
Comments	No common use sanitary facilities have been proposed in the development. To be verified at CC stage of works.
Requirement	Ambulant use male / female toilets are to be provided if an additional toilet to the Accessible unisex toilet is provided.
Compliance Comments	N/A. No sanitary facilities in addition to the accessible toilet have been provided in the development.
Requirement Compliance	BCA F2.4(a) Accessible unisex sanitary compartments Class 2 At least 1 when sanitary compartments are provided in common areas. N/A No common use sanitary facilities have been proposed in the development.
Comments	BCA F2.4(b) Requirements for Accessible unisex showers as per AS1428.1-2009
Requirement	Class 2 At least 1 when showers are provided in common areas.
Compliance	N/A
Comments	No common use shower facilities have been proposed in the development.

Page 31 of 38

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

BCA Part E Lift Installations

BCA Part E Lift Installations				
Requirement	In an accessible building, every passenger lift must comply with Tables E3.6(a) and E3.6(b).			
Compliance	Capable of compliance			
Comments	 Lift floor dimensions (excluding stairway platform lift) are listed below. Lifts traveling 12M or under, floor size, 1100mm wide x 1400mm deep Lifts travelling more than 12M, floor size 1400mm wide x 1600mm deep Details to be verified at CC stage of works. 			
Requirement	If the effective height of the building is over 12M, at least one of the lifts is required to be a stretcher lift, which is to accommodate a raised stretcher with clear space of not less than 600 x 2000mm long x 1400mm high above FFL.			
Compliance	Capable of compliance			
Comments	Details to be verified at CC stage of works.			

Job No 219285

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 32 of 38

DCP Requirements

Adaptable Housing

There are 987 units proposed in the development of which 99 adaptable units are required under the Council's DCP.

99 adaptable units have been provided across various layouts. They provide a mix of 1, 2 & 3 bed units generally in proportion that these units are provided throughout the development. See DA-400-100 for full schedule.

At DA stage there is insufficient information to certify compliance with the Standard, however, in accordance with the table below, the units can comply with the spatial requirements of AS4299 for Adaptable Housing.

The Site	Requirement	and to common facilities is provided		
	Compliance Comment	Complies Details to be verified at CC stage of works.		
Carparking	Requirement Compliance	A car space 6m x 3.8m is provided Complies		
	Comment	The layout includes spaces based on AS2890.6 which is acceptable. Details to be verified at CC stage of works.		
Unit Entry	Requirement	The entry is accessible, covered, level, has a low threshold, permits wheelchair maneuverability and has an 850 clear door with lever handles		
	Compliance	Capable of Compliance		
	Comment	Details to be verified at CC stage of works.		
Interior - General	Requirement	Access to bathroom, kitchen, laundry and living areas is provided.		
	Compliance Comment	Complies Threshold ramps may be required in adapted state for wheelchair unless		
	Comment	the floor of wet areas have been recessed. Details to be verified at CC stage of works.		
	Requirement	Doors are 820mm clear (870 leaf) with corridors a min. 1000mm wide with circulation space at doors as per AS1428.1		
	Compliance Comment	Capable of Compliance It is recommended that the door to adaptable bedroom and adaptable		
	Comment	bathroom be 850mm clear opening. Details to be verified at CC stage of works.		
Living/ Dining	Requirement	Provision for circulation space of min 2250 dia,		
Rms	Compliance	Complies		
	Comment	Details to be verified at CC stage of works.		
	Requirement	Provision of, a telephone point adjacent to GPO and lighting which can achieve min 300 lux		
	Compliance	Capable of Compliance		
	Comment	Details to be verified at CC stage of works.		

AS 4299 Adaptable Housing Class C requirements

Job No 219285

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226 ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust Page 33 of 38

- P (office) 0415 255 163
- P (Michael) 0450 334 995

Kitchen	Requirement	Floor surface to be non-slip with 1550 clear between benches and circulation space at door to comply with AS1428.1.
	Compliance	Capable of Compliance
	Comment	Details to be verified at CC stage of works.
	Requirement	Provision for work benches, appliances and other services including tap type and location, GPO locations in accordance with AS 4299.
	Compliance	Capable of Compliance
	Comment	Details to be verified at CC stage of works.
Main Bedroom	Requirement	Can accommodate a queen size bed, wardrobe and circulation to allow a 180deg turn at the foot of the bed or in front of the robe
	Compliance	Complies
	Comment	Details to be verified at CC stage of works.
Bathroom	Requirement Compliance	Provision to allow bathroom to be converted to complying with AS 1428.1. The floor is slip resistant and the shower recess is hobless and can provide a compliant shower area with provision for grabrails, mirror, GPO etc. Complies
	Comment	Either ensuite or main bathroom. Some units combine for adaption.
		Capped off plumbing required where fittings are relocated for adaption. Details to be verified at CC stage of works.
Toilet	Requirement	An accessible toilet or an enlarged toilet with an area 1250x900w in front of pan is provided which is capable of modification to comply with AS 1428.1. The floor is slip resistant and the wall is capable of installing grabrails.
	Compliance	Complies
	Comment	Details to be verified at CC stage of works.
Laundry	Requirement	Circulation at doors to comply with AS 1428.1 is provided, with adequate circulation in front of appliances (min 1550mm). Provision for washing machine and drier is available and an accessible path of travel to clothes line if provided.
	Compliance	Complies
	Comment	Details to be verified at CC stage of works.
	Requirement	Provide a double GPO and the floor is to be slip resistant.
	Compliance	Capable of compliance
	Comment	Details to be verified at CC stage of works.
Door Hardware	Requirement	Lever door handles are provided, located 900-1100mm above floor
	Compliance	Capable of Compliance
	Comment	Details to be verified at CC stage of works.

J	ob	No	21	928	85

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 34 of 38

<u>SEPP 65 – Part 4Q1</u>

Compliance assessment with Objective 4Q1 that requires 20% of the units to incorporate the features of the Livable Housing Guidelines Silver level.

Total number of residential units in the development = 20% of 987 = 197.4 = **198** required Livable units.

198 units across various layouts are capable of providing compliance with the features of Silver level of Livable Housing Guidelines as noted in the table below. See DA-400-100 for full schedule.


By incorporating the requirements of the below Checklist in the Specifications of the project, the nominated Livable units can achieve full compliance with Livable Housing Guidelines- Silver Level.

Design Element	Requirements (All dimensions noted are required to be clear of finishes as required under AS1428.1)	Compliance / Comments
1 Dwelling Access	 (a) Provide a safe and continuous 1M clear width pathway from front site boundary to an entry door to the dwelling. (b) Path including any ramps and walkways to have no steps, even firm, slip-resistant surface, max 1:40 crossfall, max slope of 1:14 with landings of 1.2M every 9M and landings every 15M for 1:20 walkways. 1.2M clear width of ramps are required. 	Complies. Verify at CC
	 (c) Pathway may be provided via an associated car parking in which case the car parking space to be 3200 (width) x5400 (length), even, firm and slip resistant, level surface of 1:40 max grade and 1:33 max grade for bitumen 	Complies. Verify at CC
	 (d) Step ramp may be provided at an entrance doorway. The step ramp to be max 190mm height, max 1:10 grade, max 1900mm length. (e) Level landings of 1200mm are required exclusive of the swing of the door or gate and to be provided at the head and foot of the ramp. 	N/A N/A
2 Dwelling entry	 door or gate and to be provided at the head and foot of the ramp. (a) Dwelling Entry should provide an entrance door with (i) min clear opening width of door to be 820mm (ii) Step free threshold of max 5mm with rounded or bevelled lip (iii) reasonable shelter from the weather 	Capable of compliance. Verify at CC
	 (b) Level landing of 1200x1200mm at step-free entrance door on the arrival / external side of the entrance door. (c) Max permissible threshold is less than 56mm where provided with a 1:8 grade threshold ramp. 	Complies Verify at CC N/A
	(d) Entrance to be connected to a pathway (specified under Element 1) Note: The entrance to incorporate waterproofing and termite management requirements as specified in the NCC	Complies
3 Internal doors and corridors	 (a) Doors to rooms on the entry level used for living, dining, bedroom, bathroom, kitchen, laundry and sanitary compartments to be (i) 8200mm clear opening and (ii) provided with a level threshold of max 5mm between abutting surfaces with rounded or bevelled lip 	Capable of compliance. Verify at CC
	 (b) Internal corridors and passageways to doorway to be min 1M clear (measured from skirting to skirting) 	Capable of compliance. Verify at CC
4 Toilet	 (a) Toilet to be provided on the ground or entry level that provides, (i) Min 900mm between walls if located in separate room (ii) Min 1200mm clear space in forward of the WC pan exclusive of door swing. (iii) The toilet pan to be positioned in the corner of a room to enable handrails 	Mostly Complies. Some Unit types will need to be adjusted to locate toilet adjacent to wall

Job No 219285

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226 ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust Page 35 of 38

P (office) 0415 255 163 **P** (Michael) 0450 334 995

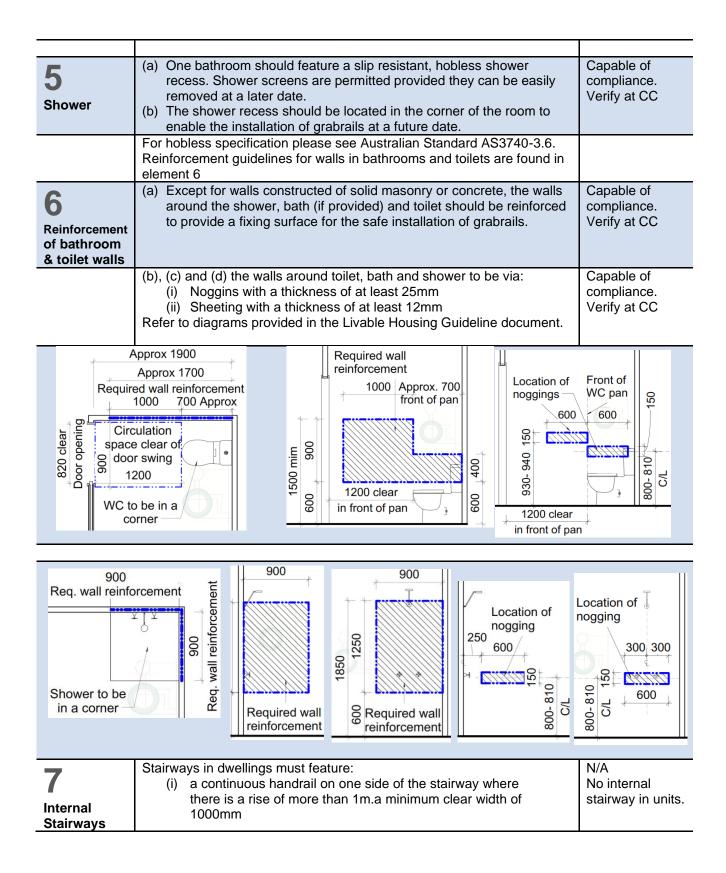

Statement of Compliance

On the basis of the above assessment, I am satisfied that the proposal can achieve compliance with the access provisions of the BCA and the Access to Premises Standard, SEPP 65 Part 4Q and AS4299

Job No 219285

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226 ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust Page 36 of 38

P (office) 0415 255 163

P (Michael) 0450 334 995

Millerohn

Michael Moutrie ACAA Accredited Access Consultant No 581 Date of report: 05-05-2020

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 37 of 38

P (office) 0415 255 163 **P** (Michael) 0450 334 995




Statement of experience

Howard Moutrie

Qualifications: B. Arch (Hons) Registered Architect ARB Reg. No 4550 ACAA Accredited Access Consultant Reg. No. 177 • OHS Induction Training, • OHS - Monitoring a Safe Workplace • Registered Assessor of Livable Housing Australia (License no 10054) • Registered Changing Places assessor (No 007) • Howard has been or is a member of the following: Standards Australia ME/64 Committee (Access Standards) Sutherland Council Design Review Panel Sutherland Council Access Committee City of Sydney Access Panel 2010 Building Professionals Board Access Advisory Panel ACAA Management Committee ACAA NSW Network of Access Consultants Management Committee Howard Moutrie is an architect with over 30 years of experience and is an experienced practicing access consultant with over 15 years experience. Howard has contributed for over 10 years on the Standards Australia Disabled Access Committee ME/64, providing input into the AS 1428 suite of Standards and the Adaptable Housing Standard has acted as an expert witness in the Land & Environment Court.

Howard maintains a high level of continuing education programs and has presented at numerous seminars and training sessions including ACAA National Conference, ACAA State Network Seminars, RAIA Network Seminars, Building Designers Association Seminars.

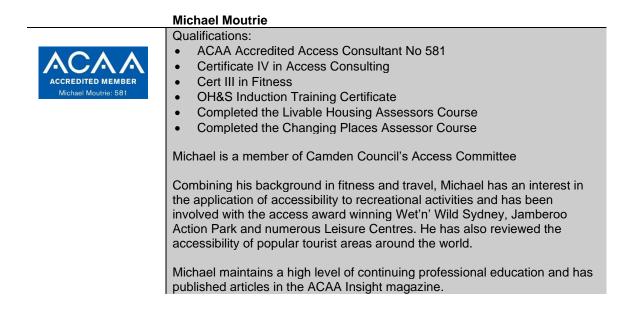

Job No 219285

Accessible Building Solutions 124 Upper Washington Drive, Bonnet Bay NSW 2226

ABN 58 006 628 812 The Trustee For The Howard & Anne Moutrie Family Trust

Page 38 of 38

- **P** (office) 0415 255 163 P (Michael) 0450 334 995
- E michael@absaccess.com.au

ivable Housing Design Howard Moutrie