
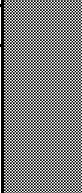

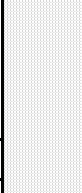
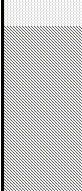

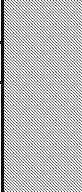



SOIL BORE LOG

Bore No. 8

Sheet 1 of 1

Project No: 110158	Easting (AMG): <u>317125.680</u>	Equipment: <u>Push Tube</u>
Project: <u>Eveleigh Gasworks</u>	Northing (AMG): <u>1247723.696</u>	Contractor: <u>Macquarie</u>
Site: <u>Macdonaldtown Triangle</u>	Elevation (mAHD): <u>18.58</u>	Logged By: <u>Maria Milos</u>
Date: <u>19-Apr-00</u>	Water Level (mbtc): <u>N/A</u>	Project Manager: <u>Lee Moore</u>
Weather: <u>Overcast</u>	Final Depth (mbgl): <u>4.0m</u>	Checked By: _____

Depth (m)	Water Found	Sample		Graphic Log	Soil Description	Observation/Comments
		PID	No.		(soil type, colour, moisture content, plasticity, grain size, stiffness, etc.)	(visual contamination, odour, side collapse, etc.)
0.1		0.9	8-0-0.1		FILL, Dark brown, gravelly fill, gravel fragments less than 3cm, minor fine roots.	
0.2						
0.3						
0.4						
0.5					FILL, Brown/black, coke fill, dry, crumbly, light, minor coarse black sand.	
0.6						
0.7						
0.8					FILL, Crushed orange like, wet.	
0.9						
1.0						
1.1		1.6	8-1.0-1.1		FILL, Dark grey silty clay, roots and coal slag mixed in.	
1.2						
1.3						
1.4					Dark grey silty clay, roots.	
1.5						
1.6						
1.7		2.1	8-1.6-1.7			
1.8						
1.9						
2.0					Red, clay, compacted, dry, weathered shale red.	
2.1						
2.2						
2.3		2.5	8-2.3-2.4			
2.4						
2.5						
2.6						
2.7						
2.8						
2.9						
3.0						
3.1						
3.2						
3.3						
3.4						
3.5		1.6	8-3.5-3.6		Grey compacted clay homogeneous.	
3.6						
3.7						
3.8						
3.9						
4.0						
					EOH @ 4.0m on clay.	

Notes

mAHD:metres Australian Height Datum mbgl:metres below ground level mbtc:metres below top of casing

**CH2M HILL**

CH2M HILL AUSTRALIA Pty Ltd

SOIL BORE LOG**Bore No. 9**

Sheet 1 of 1

Project No: 110158	Easting (AMG)	317132.858	Equipment:	Excavator
Project: Eveleigh Gasworks	Northing (AMG)	1247726.929	Contractor:	JFT(PC45R)
Site: Macdonaldtown Triangle	Elevation (mAHD):	18.74	Logged By:	Kelly Chan
Date: 19-Apr-00	Water Level (mbtc):	N/A	Project Manager:	Lee Moore
Weather: Overcast	Final Depth (mbgl):	0.2m	Checked By:	

Depth (m)	Water Found	Sample		Graphic Log	Soil Description (soil type, colour, moisture content, plasticity, grain size, stiffness, etc.)	Observation/Comments (visual contamination, odour, side collapse, etc.)
		PID	No.			
0.1					FILL, Dark brown sand and brick, moist, unconsolidated.	
0.2					EOH at 0.2m refusal on brick	
0.3						
0.4						
0.5						
0.6						
0.7						
0.8						
0.9						
1.0						
1.1						
1.2						
1.3						
1.4						
1.5						
1.6						
1.7						
1.8						
1.9						
2.0						
2.1						
2.2						
2.3						
2.4						
2.5						
2.6						
2.7						
2.8						
2.9						
3.0						
3.1						
3.2						
3.3						
3.4						
3.5						
3.6						
3.7						
3.8						
3.9						
4.0						

Notes

mAHD:metres Australian Height Datum mbgl:metres below ground level mbtc:metres below top of casing