



TREE SURVEY

ARBORICULTURAL IMPACT ASSESSMENT & TREE PROTECTION PLAN

Pymble Ladies College (PLC)
Secondary Innovation Precinct and Campus Commons
Version 7

Prepared for:
Pymble Ladies College (PLC)

29 May 2025

Document information

Title:	PLC Secondary Innovation Precinct
Report type:	Arboricultural Impact Assessment (AIA) & Tree Protection Plan (TPP)
Prepared by:	 Phil Witten Principal Arborist & GIS Analyst Diploma of Arboriculture AQF 5 Graduate Certificate of Arboriculture AQF 8 Registered Consulting Arborist No. 2458 Advanced QTRA TRAQ Qualification
Contact details:	Tree Survey Pty Limited 📞 0425 536 670 ✉ phil@treesurvey.com.au 💻 www.treesurvey.com.au 📍 PO Box 125, Hornsby NSW 1630, Australia

Document status

Document status	Date	Revision description
Version 1	03/10/24	Expansion of the study area
Version 2	29/11/24	Design updates
Version 3	07/03/25	Footprint updates
Version 4	17/03/25	Tree removal updates
Version 5	18/03/25	Tree removal updates
Version 6	19/03/25	Minor updates following review
Version 7	29/05/25	Final version

© Tree Survey (ABN 94 612 468 792) 2024

Copyright protects this publication. All rights reserved. Except for purposes permitted by the Australian Copyright Act 1968, reproduction, adaption, electronic storage, transmission, and communication to the public by any means is prohibited without our written permission. Any third material, including images, contained in this publication remains the property of the specified copyright owner unless otherwise indicated and is used subject to their licensing conditions.

Disclaimer

While Tree Survey uses care and diligence in the preparation of this report, it is not responsible or liable for any mistakes, misprints, omissions, or typographical errors. None of Tree Survey, nor its editors or authors are responsible for the results of any actions taken on the basis of information in this publication. Tree Survey and its editors and authors expressly disclaim all and any liability and responsibility to any person or organisation in reliance, of, or as a consequence of, anything done or omitted to be done by any person or organisation in reliance, whether wholly or partially, upon the whole or part of any of the contents of this publication, including any photographs, statements or descriptions. No representation is made as to the suitability of this publication for any particular purpose. The views expressed in this publication are not necessarily endorsed by this publication, its editors or authors, or the owners or management of Tree Survey.

Abbreviations

Abbreviation	Description
AQF	Australian Qualifications Framework
AS	Australian Standards
DBH	Diameter at Breast Height
Id	Identification
m	Metre
mm	Millimetre
NDE	Non-Destructive Excavation
NO	Number
NSW	New South Wales
sp.	Species
SRZ	Structural Root Zone
TPZ	Tree Protection Zone
VTA	Visual Tree Assessment

Contents

1	Background	1
1.1	Introduction.....	1
1.2	Sears table response	1
1.3	Description of the site and locality.....	1
1.5	The proposal	2
1.6	Documents and plans referenced	2
2	Method.....	3
2.1	Visual Tree Assessment (VTA)	3
2.2	Significance of a Tree, Assessment Rating System (STARS).....	3
3	Arboricultural Impact Assessment (AIA)	4
3.1	The impact footprint.....	4
3.2	Tree protection zones.....	5
4	Results	6
4.1	Encroachment within the TPZ	6
4.2	Tree removal and retention	6
5	Discussion	7
6	Tree Protection Plan (TPP).....	9
6.1	Tree removal and retention	9
6.2	Tree pruning	9
6.3	Tree protection fencing.....	9
6.4	Restricted activities within the TPZ	10
6.5	Trunk protection	10
6.6	Ground protection.....	10
6.7	Demolition	11
6.8	Excavations	11
6.9	Underground services	11
6.10	Root pruning	11
6.11	Site inspections	12
	References	14
	Appendix I - Tree Data	15
	Appendix II - Arboricultural Impact Assessment Drawings	16
	Appendix III - Tree Protection Plan Drawings	17
	Appendix IV - STARS© assessment matrix.....	18

1 Background

1.1 Introduction

Tree Survey has been commissioned by Pymble Ladies' College (the College) to prepare this Arboricultural Impact Assessment (AIA) and Tree Protection Plan (TPP) in accordance with the technical requirements of the Secretary's Environmental Assessment Requirements (SEARs) and in support of the preparation of an Environmental Impact Statement (EIS) and State Significant Development Application for the proposed Secondary Innovation Precinct (SIP) and Campus Commons (SSD- 79146716) to the Department of Planning, Housing and Infrastructure (DPHI).

1.2 Sears table response

The arboricultural impact assessment is required by the Secretary's Environmental Assessment Requirements (SEARs) for **SSD-79146716**. This table identifies the SEARs and relevant references within this report.

Table 1: SEARs and Relevant Reference

SEARs Item	Report Reference
7. Trees and Landscaping Assess the number, location, condition, and significance of trees to be removed and retained and note any existing canopy coverage to be retained on-site.	This entire report

1.3 Description of the site and locality

The site is located at 20 Avon Road, Pymble, within the Ku-Ring-Gai Local Government Area (LGA). The site comprises multiple parcels of land and is legally described as:

- Lot 1 Deposited Plan 69541
- Lots 11- 17 Deposited Plan 7131

The site and proposed work areas are identified in the figure below.



1.5 The proposal

The proposal seeks development approval for the Secondary Innovation Precinct (SIP) and Campus Commons at Pymble Ladies' College. The development comprises:

- Demolition of the existing Isabel Harrison, Dorothy Knox, John Vicars, and Robert Vicars Buildings.
- Tree removal.
- Excavation of the basement level.
- Construction of the new five-storey SIP building of RL 145.3m including:
 - General Learning Spaces.
 - STEM teaching spaces.
 - Senior student facilities.
 - Function spaces.
 - Food and beverage facilities.
 - Associated amenities.
 - Storage and building services.
- 1 loading space within the basement (for service vehicles) accessible from the existing rear vehicle service road.
- Minor kerb realignment of the existing access road to the east of the SIP.
- Landscaping on the outdoor terraces and surrounding the building.
- The project also includes the Campus Commons, a significant garden lawn, and an amphitheatre connecting the SIP precinct to the rest of the campus.

1.6 Documents and plans referenced

The conclusions and recommendations of this report are based on the Australian Standard, AS 4970-2009, Protection of Trees on Development Sites (AS4970), the findings from the site inspections, and analysis of the documents/plans listed in **Table 1**.

Table 1: Documents and plans

Document	Author	Version	Date
Architectural Plan	3XN Architects	4	26/05/25
Landscape Plan	T.C.L.	1	23/05/25
Engineering Plan	BG&E	B	14/03/25
Survey Plan	LTS	K	03/07/21

The survey and engineering plans have been used as map layers in the Arboricultural Impact Assessment Drawings and Tree Protection Plan Drawings.

2 Method

2.1 Visual Tree Assessment (VTA)

The subject trees were assessed in accordance with a stage one visual tree assessment (VTA) as formulated by Mattheck & Breloer (1994) and practices consistent with modern arboriculture.

The following limitations apply to this methodology:

- Trees are inspected visually from ground level without the use of any invasive or diagnostic tools and testing.
- Trees within private properties or restricted areas were not subject to a complete visual inspection (i.e., defects and abnormalities may be present but not recorded).
- Diameter at breast height (DBH) has been accurately measured using a diameter tape (where access to the trees was available).
- Tree height and canopy spread are estimated unless otherwise stated.
- Tree protection zones have been calculated in accordance with AS4970 using the DBH and diameter at root buttress (DRB) measurements.
- Tree identification is based on broad taxonomical features present and visible from ground level at the time of inspection.

2.2 Significance of a Tree, Assessment Rating System (STARS).

The retention value of a tree or group of trees is determined using a combination of environmental, cultural, physical, and social values.

- **Low:** These trees are not considered important for retention, nor require special works or design modifications to be implemented for their retention.
- **Medium:** These trees are moderately important for retention. Their removal should only be considered if adversely affecting the proposed building/works.
- **High:** These trees are considered important for retention and should be considered for retention where possible. Design modification or relocation of building/s should be considered to accommodate the setbacks as prescribed by AS4970.

This tree retention assessment has been undertaken in accordance with the Institute of Australian Consulting Arboriculturalists (IACA) Significance of a Tree, Assessment Rating System (STARS). The system uses a scale of High, Medium, and Low significance in the landscape. Once the landscape significance of a tree has been defined, the retention value can be determined. Each tree must meet a minimum of three (3) assessment criteria to be classified within a category. Further details and the assessment criteria are in the **Appendices**.

3 Arboricultural Impact Assessment (AIA)

3.1 The impact footprint

Assessment of tree impacts requires a clear understanding and distinction between the construction footprint (or project footprint) and the impact footprint.

- **The construction footprint:** The construction footprint is commonly understood as the extent of the proposal, project area, or subject site. The construction footprint is typically defined by the project boundary or limit of works.
- **The impact footprint:** The impact footprint is located within the construction footprint but should only include elements of the proposal (areas of work) that are likely to impact trees.

It is important to identify elements of the proposal (areas of the construction footprint) that will impact trees and exclude elements of the proposal (areas of the construction footprint) that will not impact trees. The table below provides examples of common construction items that should be included in the impact footprint and excluded from the impact footprint.

Table 2: The impact footprint

Item	Included in the impact footprint	Excluded from the impact footprint
Excavation	Excavation greater than 150mm	Excavation less than 150mm.
Fill	Fill greater than 150mm	Fill less than 150mm.
Grading	Changes in soil level greater than 150mm	Changes in soil level less than 150mm
Hardstand	Impervious concrete or asphalt hardstand	Permeable hardstand with <150mm excavation
Services	Services installed with open-cut trenching	Services installed using directional drilling
Driveways	Impervious driveway with >150mm excavation	Permeable driveway with <150mm excavation
Pathways	Impervious pathway with >150mm excavation	Pathway with <150mm excavation
Building	Building or structure at existing grade	Suspended building with drainage to soil
Decks	Impervious deck at or above grade	Suspended deck with drainage to soil

Once the impact footprint is identified, it is compared with the existing trees and tree protection zones. The impact footprint is used to calculate impacts on trees and informs which trees can be retained, and which trees need to be removed.

3.2 Tree protection zones

The Australian Standard, Protection of Trees on Development Sites (AS4970), describes two zones that need to be considered when undertaking an arboricultural impact assessment:

- **Tree protection zone (TPZ):** The TPZ is the combination of crown and root area that requires protection during the construction process so that the tree can remain viable. The TPZ is calculated by measuring the DBH and multiplying it by twelve (12). The resulting value is applied as a radial measurement from the centre of the trunk to delineate the TPZ.
- **Structural root zone (SRZ):** The SRZ is the area of the root system used for stability, mechanical support, and anchorage of the tree.

Encroachment within the TPZ is acceptable, providing that the arborist can demonstrate that the tree will remain viable. There are three (3) levels of encroachment defined by AS4970.

Table 3: Levels of encroachment

Nil encroachment (0%)	Nil encroachment within the TPZ.
Minor encroachment (<10%)	The encroachment is less than 10% of the TPZ.
Major encroachment (>10%)	The encroachment is greater than 10% of the TPZ.

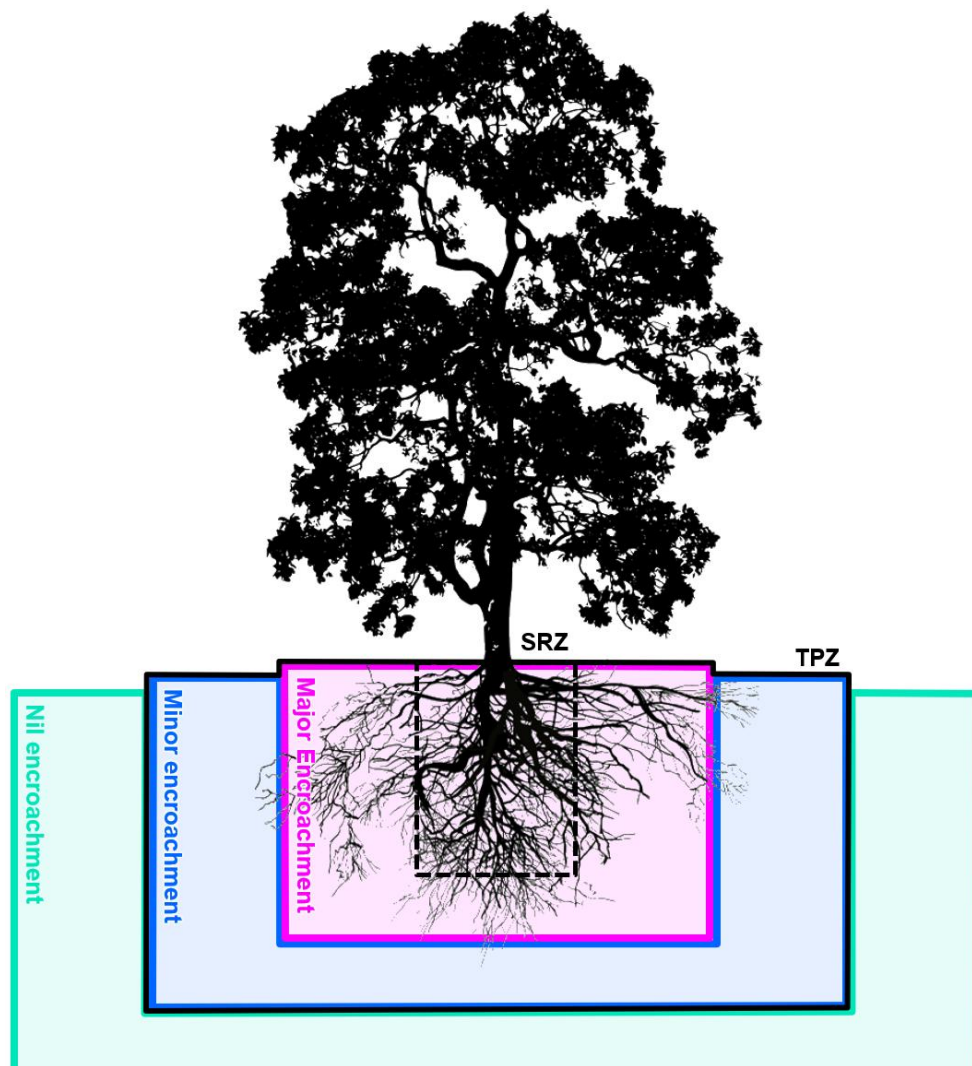


Figure 1: Three (3) levels of encroachment

4 Results

A total of **195** trees were assessed and included in this report. The results are as follows:

4.1 Encroachment within the TPZ

A summary of trees impacted by the proposed construction footprint is outlined below.

Table 4: Encroachment summary

Nil encroachment (0%)	A total of 58 trees will be subject to nil encroachment.
Minor encroachment (<10%)	A total of 14 trees will be subject to minor encroachment.
Major encroachment (>10%)	A total of 123 trees will be subject to major encroachment.

4.2 Tree removal and retention

A summary of proposed tree removal and retention is outlined below.

Table 5: Tree removal summary

Retain	A total of 69 trees are proposed for retention.
Remove	A total of 126 trees are proposed for removal.


A full set of tree data can be found in the supplementary PDF document “Appendix I - Tree Data”.

5 Discussion

Table 7: Discussion of impacts

Nil encroachment (0%) Total trees: 58	Retain A total of 51 trees will be subject to nil encroachment. No impacts on these trees are foreseeable under the current proposal.
	Remove A total of 7 trees will be subject to nil encroachment. These trees are proposed for removal for landscaping purposes.
Minor encroachment (<10%) Total trees: 14	Retain A total of 11 trees will be subject to a minor encroachment of less than 10% within the TPZ. Further design development will need to be undertaken with the Landscape Architect to ensure grade changes and proposed works will not impact trees, however these trees can most likely be retained without significant impact.
	Remove A total of 3 trees will be subject to a minor encroachment. These trees are proposed for removal for landscaping purposes.
Major encroachment (>10%) Total trees: 123	Retain A total of 7 trees will be subject to a major encroachment of less than 20% within the TPZ. Encroachment of up to 20% on one side of the tree (linear excavation) can be achieved without significantly impacting the health or stability of the tree (Roberts, Jackson and Smith 2006, p.295; Costello, Watson and Smiley 2017, p.213). Further design development will need to be undertaken with the Landscape Architect to ensure grade changes and proposed works will not impact trees, however these trees can most likely be retained without significant impact.
	Remove A total of 116 trees will be subject to a major encroachment of greater than 20% within the TPZ. Encroachment of greater than 20% can begin to impact the structural root zone (SRZ) and is more likely to compromise tree stability" (Costello, Watson, and Smiley (2017, p.21). Impacts within the SRZ are not recommended as it may lead to the destabilisation and/or decline of the tree. These trees are located inside or directly adjacent to the proposed construction footprint and cannot be retained under the current proposal.

Arboricultural Impact Assessment

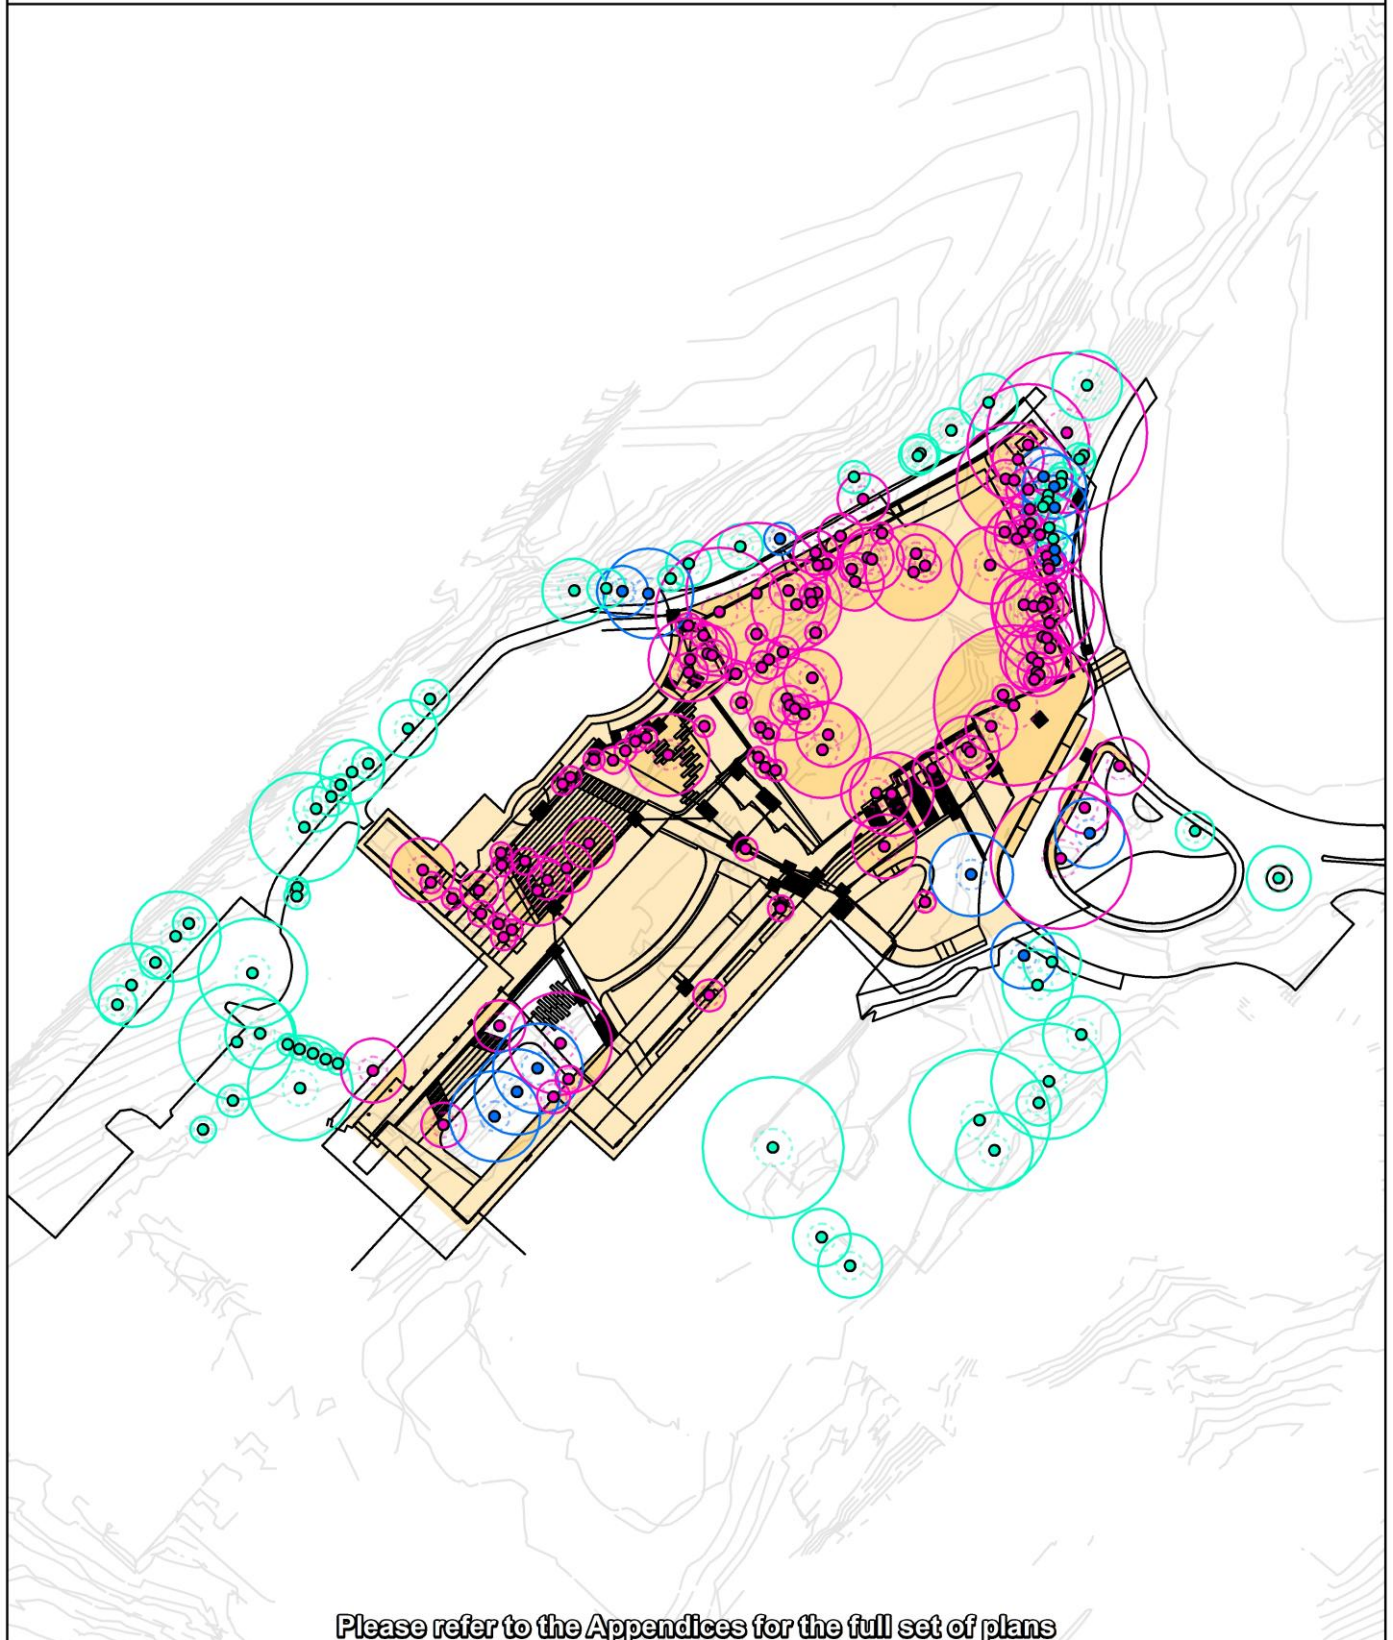

Please refer to the Appendices for the full set of plans

Legend

The subject trees

- Nil encroachment
- Minor encroachment
- Major encroachment

Protection zones

- TPZ (continuous line)
- SRZ (dashed line)

Site features

- Impact footprint
- Site plan (proposed)

6 Tree Protection Plan (TPP)

6.1 Tree removal and retention

A summary of proposed tree removal and retention is outlined below.

Table 7: Tree removal summary

Retain	A total of 69 trees are proposed for retention.
Remove	A total of 126 trees are proposed for removal.

A total of **126** trees are recommended for removal under the current proposal. Trees proposed for removal comprise the following retention values:

- **60** trees with a low priority for retention.
- **56** trees with a medium priority for retention.
- **10** trees with a high priority for retention.

NOTE: This report states that 69 trees are to be retained; this references 8 trees within the site boundary (as described in TCL Landscape Report dated May 2025) and 61 trees within the broader Arborist Assessment investigation area.

6.2 Tree pruning

Minor vegetation trimming may be required to accommodate construction clearances. Standard pruning specifications are outlined below:

- Pruning must not exceed 10% of the overall canopy volume.
- No limbs greater than 150mm in diameter are to be removed.
- Any tree pruning must be in accordance with Australian Standard AS4373-2007, Pruning of Amenity Trees (AS4373).

If the proposed vegetation trimming does not meet the specifications outlined above, the project arborist must undertake an assessment of impacts on a case-by-case basis.

6.3 Tree protection fencing

Tree protection fencing must be established at the locations shown in the TPP. Existing fencing, site hoarding, or structures (such as a wall or building) may be used as tree protection fencing, providing the TPZ remains isolated from the construction footprint. Tree protection fencing must be installed prior to site establishment and remain intact until the completion of works. Once erected, protective fencing must not be removed or altered without the approval of the project arborist. Specifications for the tree protection fencing are as follows:

- Temporary mesh panel fencing (minimum height of 1.8m).
- Installed prior to site establishment and remain intact until the completion of works.
- Protective fencing must not be removed or altered without the approval of the project arborist.
- Prominently signposted with 300mm x 450mm boards stating, "NO ACCESS - TREE PROTECTION ZONE."
- Certified and inspected by the project arborist.

6.4 Restricted activities within the TPZ

The TPZ is an area that is isolated from the work zone to ensure no disturbance or encroachment occurs in this zone. Activities generally excluded from the TPZ (unless otherwise approved under the development consent) include, but are not limited to:

- Machine excavation and trenching.
- Ripping or cultivation of the soil.
- Storage of building materials, waste, and waste receptacles.
- Disposal of waste materials, chemicals, paint, solvents, cement slurry, fuel, or other toxic liquids.
- Movement and storage of plant, equipment, and vehicles.
- Soil level changes, including the placement of fill material.
- Any other activity that is likely to cause damage to the tree.

6.5 Trunk protection

Trunk protection must be established at the locations shown in the TPP. Where the provision of tree protection fencing is impractical or must be temporarily removed, trunk protection shall be installed to avoid accidental mechanical damage.

Specifications for trunk protection are as follows:

- A thick layer of carpet underfelt, geotextile fabric, or similar wrapped around the trunk to a minimum height of 2m.
- 1.8m lengths of softwood timbers aligned vertically and spaced evenly around the trunk (with a small gap of approximately 50mm between the timbers).
- The timbers must be secured using galvanised hoop strap (aluminium strapping).
- The timbers shall be wrapped around the trunk but not fixed to the tree, as this will cause injury/damage to the tree.

6.6 Ground protection

If temporary access for vehicle, plant, or machinery is required within the TPZ, ground protection shall be installed. The purpose of ground protection is to prevent root damage and soil compaction within the TPZ. Where possible, areas of the existing pavement shall be used as ground protection.

Specifications for light traffic access (<3.5 tonne) are as follows:

- Permeable membrane such as geotextile fabric.
- A layer of mulch or crushed rock (at a minimum depth of 100mm)

Specifications for heavy traffic access (>3.5 tonne) are as follows:

- Permeable membrane such as geotextile fabric.
- A layer of lightly compacted road base (at a minimum depth of 200mm)
- Geotextile fabric shall extend a minimum of 300mm beyond the edge of the road base.
- Heavy vehicle track mats, road plates, access mats, or similar.

Pedestrian, vehicular, and machinery access within the TPZ shall be restricted solely to areas where ground protection has been installed.

6.7 Demolition

The demolition of all existing structures inside or directly adjacent to the TPZ of trees to be retained must be undertaken in consultation with the project arborist. Any machinery is to work from inside the footprint of the existing structures or outside the TPZ, to minimise soil disturbance and compaction. If it is not feasible to locate demolition machinery outside the TPZ of trees to be retained, ground protection will be required. The demolition should be undertaken inwards into the footprint of the existing structures, sometimes referred to as the 'top-down, pull back' method.

6.8 Excavations

The project arborist must supervise and certify that all excavations and root pruning are in accordance with AS4373 and AS4970. All excavations (including root investigations) within the TPZ must be carried out using tree-sensitive methods under the supervision of the project arborist. These methods may include:

- **Manual excavation:** Use of hand tools such as spades, trowels, and brushes.
- **Air spade:** Use of a pressurised air device that blows the soil away and leaves roots intact.
- **Hydro-vacuum excavation:** Use of pressurised water to remove soil from around roots.

The recommended techniques for common types of excavations have been outlined below:

- **Continuous strip footings:** Manual excavation, air spade, or hydro-vacuum is utilised excavation lines within the TPZ prior to the commencement of mechanical excavation. Excavation should be a depth of 1 metre (or to unfavourable root growth conditions such as bedrock or heavy clay, if agreed by the project arborist). Any conflicting roots shall be pruned using clean, sharp secateurs or a pruning saw to ensure a clean cut, free from tears. All root pruning must be documented and carried out by the project arborist. After all root pruning is completed, machine excavation is permitted within the footprint of the structure.
- **Post or pier footings:** Manual excavation, air spade, or hydro-vacuum is utilised at the location of pier footings within the TPZ. Any conflicting roots shall be pruned using clean, sharp secateurs or a pruning saw to ensure a clean cut, free from tears. All root pruning must be documented and carried out by the project arborist. After all root pruning is completed, machine excavation is permitted within the footprint of the structure.

No over-excavation, battering, or benching shall be undertaken beyond the footprint of any structure unless approved by the project arborist.

6.9 Underground services

Where possible, underground services should be routed outside of the TPZ. If underground services need to be installed within the TPZ, they must be installed using tree-sensitive excavation methods under the supervision of the project arborist. Alternatively, boring methods such as horizontal directional drilling (HDD) may be used for underground service installation, providing the installation is at a minimum depth of 800mm below grade. Excavations for entry/exit pits must be located outside the TPZ.

6.10 Root pruning

Any conflicting roots greater than 50mm in diameter identified during the supervised excavations shall be pruned using clean, sharp secateurs or a pruning saw to ensure a clean cut, free from tears. All root pruning (>50mm) must be documented and carried out by the project arborist.

6.11 Site inspections

In accordance with AS4970, inspections must be conducted by the project arborist at the following key project stages:


- Prior to any work commencing on-site (including demolition, earthworks, or site clearing) and following the installation of tree protection.
- During any excavations, building works, and any other activities carried out within the TPZ of any tree to be retained & protected.
- A minimum of once per 12 weeks (every 3 months) during the construction phase for trees with a major encroachment within the TPZ.
- After all major construction has ceased, following the removal of tree protection.

It shall be the responsibility of the project manager to notify the project arborist prior to any works within the TPZ of any protected tree at a minimum of 48 hours' notice. To ensure the tree protection plan is implemented, hold points have been specified in the schedule of work (**Table 4**).

Table 9: Schedule of work

Construction Stage	Hold point	Remove
Pre-construction	1	Tree protection (for trees that will be retained) shall be installed prior to demolition and site establishment. This may include the mulching of areas within the TPZ. The project arborist shall inspect and certify tree protection.
During Construction	2	Project arborist to supervise and document any significant works carried out within the TPZ of trees to be retained.
	3	Scheduled inspection of trees by the project arborist should be undertaken approximately every 12 weeks (3 months) during the construction period.
Post Construction	4	Final inspection of trees by project arborist.

Tree Protection Plan

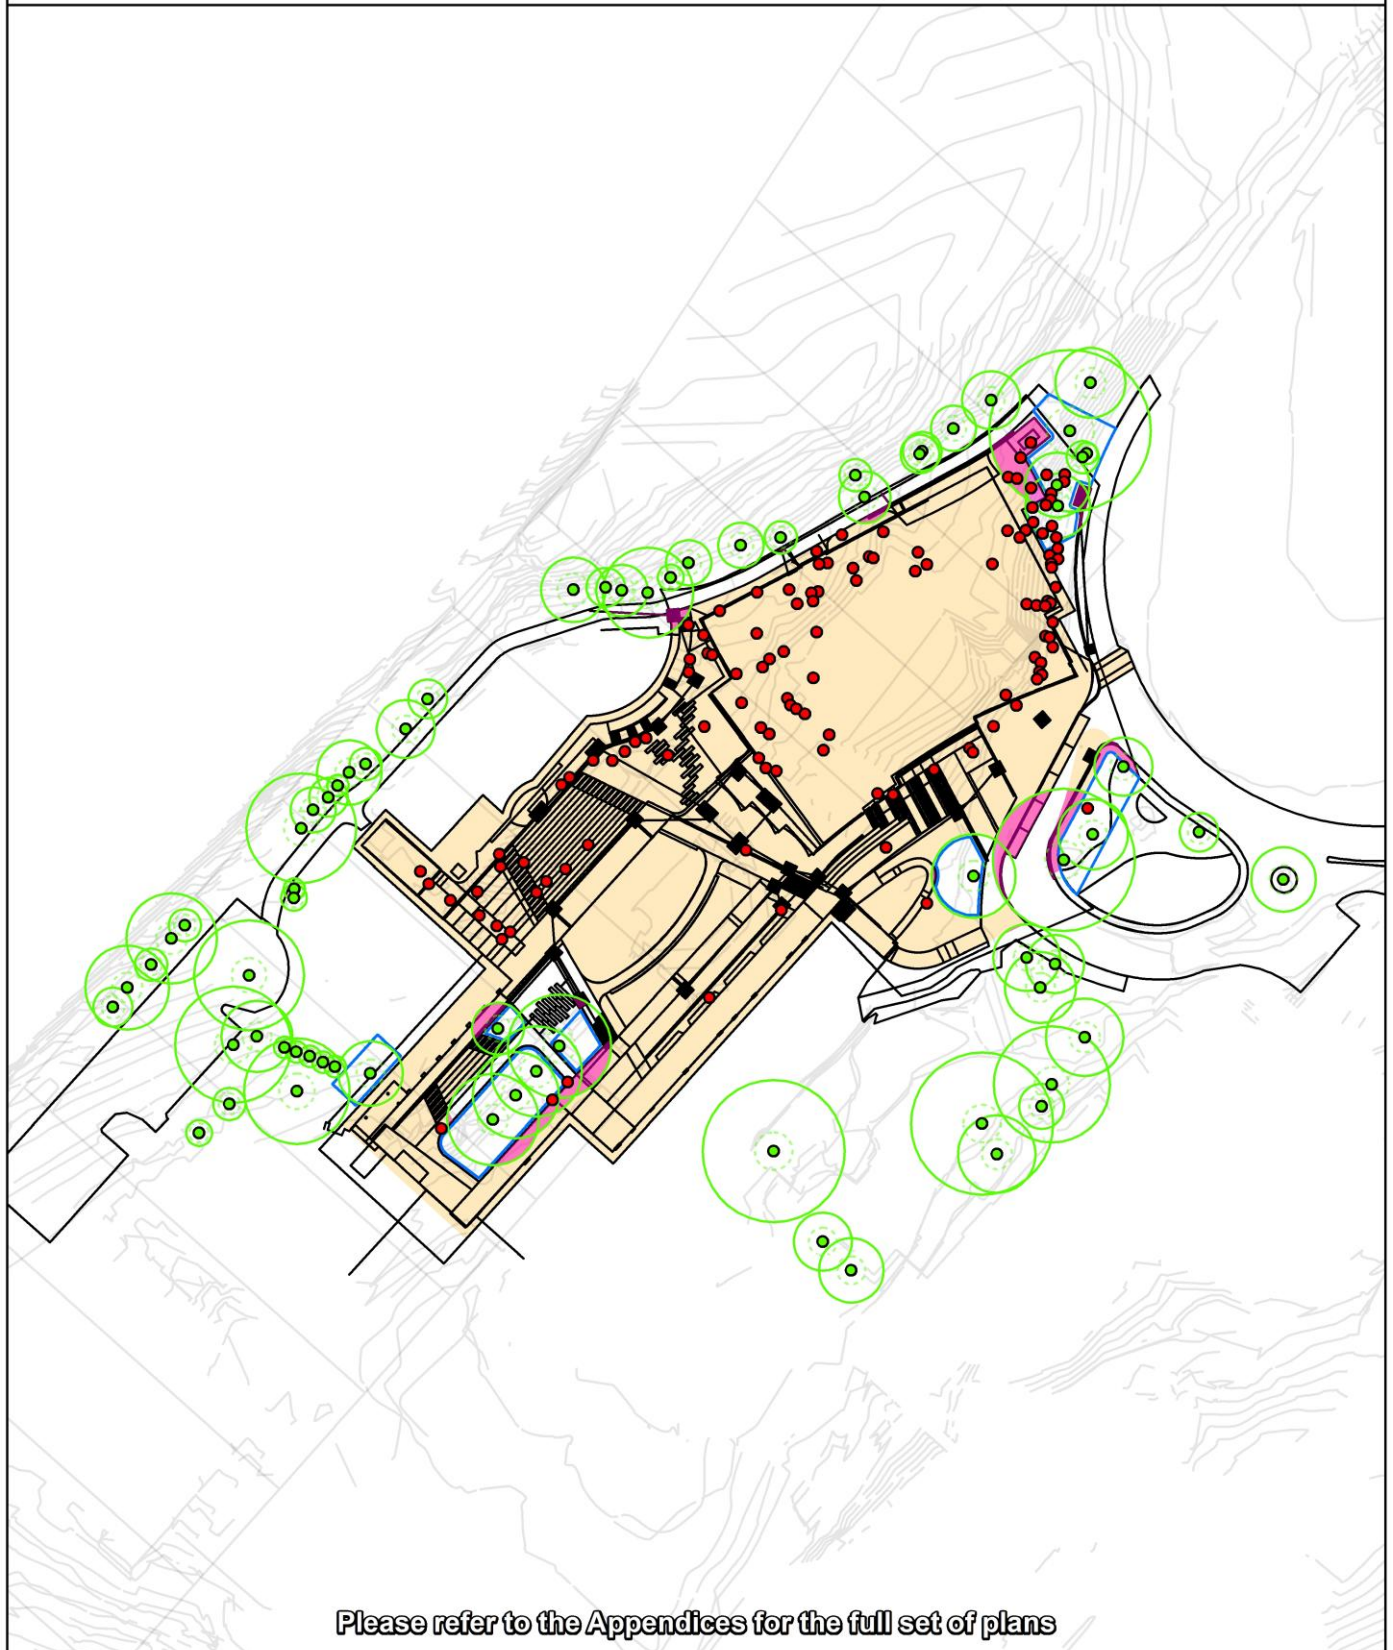

Please refer to the Appendices for the full set of plans

Legend

The subject trees

- Retain
- Remove

Protection zones

- ▭ TPZ (continuous line)
- ▭ SRZ (dashed line)

Site features

- Impact footprint
- Site plan (proposed)

Tree protection measures

- Tree protection fence
- Arborist to supervise works within the TPZ

References

Australian Standard, AS 4970-2009, Protection of Trees on Development Sites

Australian Standard, AS 4373-2007, Pruning of Amenity Trees.

Costello, L., Watson, G. and Smiley, E., 2017. Root Management. International Society of Arboriculture.

IACA, 2010, IACA Significance of a Tree, Assessment Rating System (STARS), Institute of Australian Consulting Arboriculturists, Australia, www.iaca.org.au

Mattheck, C. (2007). Updated field guide for visual tree assessment. Karlsruhe: Forschungszentrum Karlsruhe.

Mattheck, C., Bethge, K. and Weber, K. (2015). The body language of trees. Karlsruhe: Karlsruher Inst. für Technologie.

Mattheck, C., Lonsdale, D. and Breloer, H. (1994). The body language of trees. London: H.M.S.O.

Roberts, J., Jackson, N. and Smith, D. (2006). Tree roots in the built environment.

Appendix I - Tree Data

Please refer to the supplementary PDF document

Appendix II - Arboricultural Impact Assessment Drawings

Please refer to the supplementary PDF document

Appendix III - Tree Protection Plan Drawings

Please refer to the supplementary PDF document

Appendix IV - STARS© assessment matrix

The retention value of a tree or group of trees is determined using a combination of environmental, cultural, physical, and social values.

- **Low:** These trees are not considered important for retention, nor require special works or design modification to be implemented for their retention.
- **Medium:** These trees are moderately important for retention. Their removal should only be considered if adversely affecting the proposed building/works, and all other alternatives have been considered and exhausted.
- **High:** These trees are considered important for retention and should be retained and protected. Design modification or re-location of building/s should be considered to accommodate the setbacks as prescribed by Australian Standard, AS4970-2009 Protection of trees on development sites.

This tree retention assessment has been undertaken in accordance with the Institute of Australian Consulting Arboriculturalists (IACA) Significance of a Tree, Assessment Rating System (STARS). The system uses a scale of High, Medium, and Low significance in the landscape. Once the landscape significance of a tree has been defined, the retention value can be determined. Each tree must meet a minimum of three (3) assessment criteria to be classified within a category.

Tree Significance - Assessment Criteria		
Low Significance	Medium Significance	High Significance
The tree is in fair-poor condition and good or low vigour. The tree has form atypical of the species The tree is not visible or is partly visible from the surrounding properties or obstructed by other vegetation or buildings The tree provides a minor contribution or has a negative impact on the visual character and amenity of the local area The tree is a young specimen which may or may not have reached dimensions to be protected by local Tree Preservation Orders or similar protection mechanisms and can easily be replaced with a suitable specimen The tree's growth is severely restricted by above or below ground influences, unlikely to reach dimensions typical for the taxa in situ – tree is inappropriate to the site conditions The tree is listed as exempt under the provisions of the local Council Tree Preservation Order or similar protection mechanisms The tree has a wound or defect that has the potential to become structurally unsound.	The tree is in fair to good condition The tree has form typical or atypical of the species The tree is a planted locally indigenous or a common species with its taxa commonly planted in the local area The tree is visible from surrounding properties, although not visually prominent as partially obstructed by other vegetation or buildings when viewed from the street The tree provides a fair contribution to the visual character and amenity of the local area The tree's growth is moderately restricted by above or below ground influences, reducing its ability to reach dimensions typical for the taxa in situ	The tree is in good condition and good vigour The tree has a form typical for the species The tree is a remnant or is a planted locally indigenous specimen and/or is rare or uncommon in the local area or of botanical interest or of substantial age. The tree is listed as a heritage item, threatened species or part of an endangered ecological community or listed on council's significant tree register The tree is visually prominent and visible from a considerable distance when viewed from most directions within the landscape due to its size and scale and makes a positive contribution to the local amenity. The tree supports social and cultural sentiments or spiritual associations, reflected by the broader population or community group, or has commemorative values. The tree's growth is unrestricted by above and below ground influences, supporting its ability to reach dimensions typical for the taxa in situ – tree is appropriate to the site conditions.
Environmental Pest / Noxious Weed		
The tree is an environmental pest species due to its invasiveness or poisonous/allergenic properties. The tree is a declared noxious weed by legislation		
Hazardous / Irreversible Decline		
The tree is structurally unsound and/or unstable and is considered potentially dangerous. The tree is dead, or is in irreversible decline, or has the potential to fail or collapse in full or part in the immediate to short term.		

Useful Life Expectancy - Assessment Criteria

Remove	Short	Medium	Long
Trees with a high level of risk that would need removing within the next 5 years. Dead trees. Trees that should be removed within the next 5 years. Dying or suppressed or declining trees through disease or inhospitable conditions. Dangerous trees through instability or recent loss of adjacent trees. Dangerous trees through structural defects, including cavities, decay, included bark, wounds, or poor form. Damaged trees that considered unsafe to retain. Trees that could live for more than 5 years but may be removed to prevent interference with more suitable individuals or to provide space for new planting. Trees that will become dangerous after removal of other trees for the reasons.	Trees that appear to be retainable with an acceptable level of risk for 5-15 years. Trees that may only live between 5 and 15 more years. Trees that may live for more than 15 years but would be removed to allow the safe development of more suitable individuals. Trees that may live for more than 15 years but would be removed during the course of normal management for safety or nuisance reasons. Storm damaged or defective trees that require substantial remedial work to make safe and are only suitable for retention in the short term.	Trees that appear to be retainable with an acceptable level of risk for 15-40 years. Trees that may only live between 15 and 40 more years. Trees that may live for more than 40 years but would be removed to allow the safe development of more suitable individuals. Trees that may live for more than 40 years but would be removed during the course of normal management for safety or nuisance reasons. Storm damaged or defective trees that require substantial remedial work to make safe and are only suitable for retention in the short term.	Trees that appear to be retainable with an acceptable level of risk for more than 40 years. Structurally sound trees located in positions that can accommodate future growth. Storm damaged or defective trees that could be made suitable for retention in the long term by remedial tree surgery. Trees of special significance for historical, commemorative, or rarity reasons that would warrant extraordinary efforts to secure their long-term retention.

Tree Significance						
Useful Life Expectancy		High Significance	Medium Significance	Low Significance	Environmental Pest / Noxious Weed	Hazardous / Irreversible Decline
	Long >40 years					
	Medium 15-40 years					
	Short <1-15 years					
Dead						

Legend for Matrix Assessment	
	Priority for retention (High): These trees are considered important for retention and should be retained and protected. Design modification or re-location of building/s should be considered to accommodate the setbacks as prescribed by the Australian Standard AS4970 Protection of trees on development sites. Tree sensitive construction measures must be implemented if works are to proceed within the Tree Protection Zone.
	Consider for retention (Medium): These trees may be retained and protected. These are considered less critical; however, their retention should remain priority with the removal considered only if adversely affecting the proposed building/works, and all other alternatives have been considered and exhausted.
	Consider for removal (Low): These trees are not considered important for retention, nor require special works or design modification to be implemented for their retention.
	Priority for removal (Low): These trees are not considered important for retention, nor require special works or design modification to be implemented for their retention.

Reference

IACA, 2010, IACA Significance of a Tree, Assessment Rating System (STARS)
 Institute of Australian Consulting Arboriculturists
 Australia, www.iaca.org.au

