



artefact

Beau Bartlett
Holdmark NSW Pty Ltd
2/2-4 Giffnock Avenue, Macquarie Park,
NSW 2113
Beau.bartlett@futureplaceprojects.com

16 December 2025

Dear Beau,

Re: 2-10 Valentine Avenue, Parramatta: Aboriginal Heritage Due Diligence Assessment.

Introduction

This Aboriginal Heritage Due Diligence Assessment has been prepared to support a State Significant Development Application (**SSDA**) SSD- 90243456 and concurrent Rezoning Application (**RA**) for the site at 10 Valentine Avenue Parramatta.

The Minister for Planning, or their delegate, is the consent authority for the SSDA and this application is lodged with the NSW Department of Planning, Housing and Infrastructure (**DPHI**) for assessment.

This Aboriginal Heritage Due Diligence Assessment has been prepared in response to the requirements contained within the Secretary's Environmental Assessment Requirements (**SEARs**) dated 12 September 2025 (SSD- 90243456). Specifically, this report has been prepared to respond to the following SEARs

Secretary's Environmental Assessment Requirements	Supporting Documentation
22. Aboriginal Cultural Heritage Where there is known, or reasonably likely, to be Aboriginal cultural heritage on or near the site demonstrate that impacts have been adequately investigated and assessed by: - Identifying that an appropriate prior planning process has already considered these impacts, e.g. a rezoning or development application, or - Providing an initial assessment of the potential impacts. If potential impacts are significant, provide an Aboriginal Cultural Heritage Assessment Report (ACHAR) which: - Identifies, describes and assesses any impacts to Aboriginal cultural heritage sites or values associated with the site. - Is prepared in accordance with relevant guidelines.	<i>The Aboriginal Heritage Due Diligence Assessment prepared by Artefact Heritage for the SSD (90243456) requirement determined that no Aboriginal cultural heritage sites will be impacted by this proposed development therefore an Aboriginal Cultural Heritage Assessment Report is not warranted.</i>

Project information

Project Brief

The application seeks development consent for the redevelopment of the site for a mixed-use development comprising residential accommodation (shop top housing and co-living housing) and retail uses.

Specifically, this application seeks approval for the following:

- Demolition of the existing multi-deck car park.
- Demolition of existing internal fit-out within the commercial building.
- Site preparation works including: – Removal of trees as outlined in the Arborist Report. – Excavation on the southern portion of the site to a maximum depth of six basement levels.
- Construction of a 72-storey shop-top housing building, which will accommodate:
 - Six levels of basement with 144 car parking spaces, bicycle parking, services, waste storage.
 - Lobby, retail premises and loading dock at ground level.
 - 479 residential apartments on Levels 1-70.
 - Communal open space and resident amenities on level 5 and level 71.
 - Rooftop plant on level 72. – Vehicular access provided via Valentine Avenue.
 - Dedication of 3% of dwellings as affordable housing.
- Change of use of from commercial premises to co-living housing and ancillary retail.
- Alterations and additions to the existing commercial premises to accommodate co-living housing including:
 - Upgrade to existing internal lift access.
 - Alterations to the basement with amenity, laundry, jam space, manager's office and 17 co-living housing spaces.
 - Ground level retail premises and communal internal facilities including a gym, yoga room and wellness lounge.
 - Upper levels: Co-living housing providing 608 beds across 440 units in private rooms, and 2-, 3- and 4-room configurations, communal internal facilities on each level and communal open spaces on level 7 and level 14. – Alterations to the building façade.
- Hard and soft landscaping and public domain works along Valentine Avenue and Parkes Street.
- Building identification signage on the shop-top housing building and co-living housing building.
- Stratum subdivision into two lots.
- Extension and augmentation of physical infrastructure and utilities as required.

Refer to Architectural Plans prepared by Buchan collaborating with Furtado Sullivan and Curzon + Partners appended to the Environmental Impact Statement.

A concurrent RA is proposed under the SSDA. The RA seeks to amend the *Parramatta Local Environmental Plan 2023* to amend the zoning, height, permissibility and FSR controls for the site.

Refer to the EIS for a full description of the proposed amendments under the RA.

The plans for the proposed works at ground level and below-ground-surface basements can be found in Appendix A.

Scope

The proponent has engaged Artefact Heritage and Environment (Artefact) to prepare an Aboriginal Heritage Due Diligence Assessment in response to Item 22 of the SEARs. The assessment considers whether there is known, or reasonably likely, to be Aboriginal cultural heritage on or near the site of proposed works, and if there will be potential impacts on Aboriginal cultural heritage from the proposed development within the study area. Additionally, it will also provide advice to the proponent and determine whether any further archaeological assessment is required.

Description of the study area

The site at 10 Valentine Avenue, Parramatta, is located within the City of Parramatta Local Government Area (**LGA**), approximately 19km northwest of Sydney CBD and 16km northeast of Liverpool CBD (Figure 1). The site covers 3,937m² and is legally described as Lot 2 in DP 1119257.

The study area is situated within the boundaries of the Deerubbin Local Aboriginal Land Council (LALC) and is within the Parramatta Local Government Area (LGA).

The southern part of the site is currently occupied by six-level above ground carpark with 286 spaces. The northern portion of the site is occupied by 13-storey commercial office building with basement levels. Vehicular access into the site is available via the combined entry in the existing commercial building at 10 Valentine Avenue. An additional egress point from the above ground carpark is located to the south of the entry and provides exit only access onto Valentine Avenue.


The site is positioned within the Parramatta CBD, which is approximately 19km north west of the Sydney CBD and 16km north east of the Liverpool CBD. The site is located just southeast of Parramatta Railway Station, approximately 440 metres from the planned Parramatta Metro Station. It is also approximately 2 kilometres southeast of the future Westmead Metro Station on the eastern side of Hawkesbury Road.

Limitations and constraints

This report is limited to a desktop study only; no site inspection was undertaken as part of this assessment. The *Due Diligence Code of Practice* (Department of Environment, Climate Change and Water 2010) has been used to guide the assessment of Aboriginal potential..

This assessment does not consider non-Aboriginal (historical) archaeology.

Figure 1: The study area

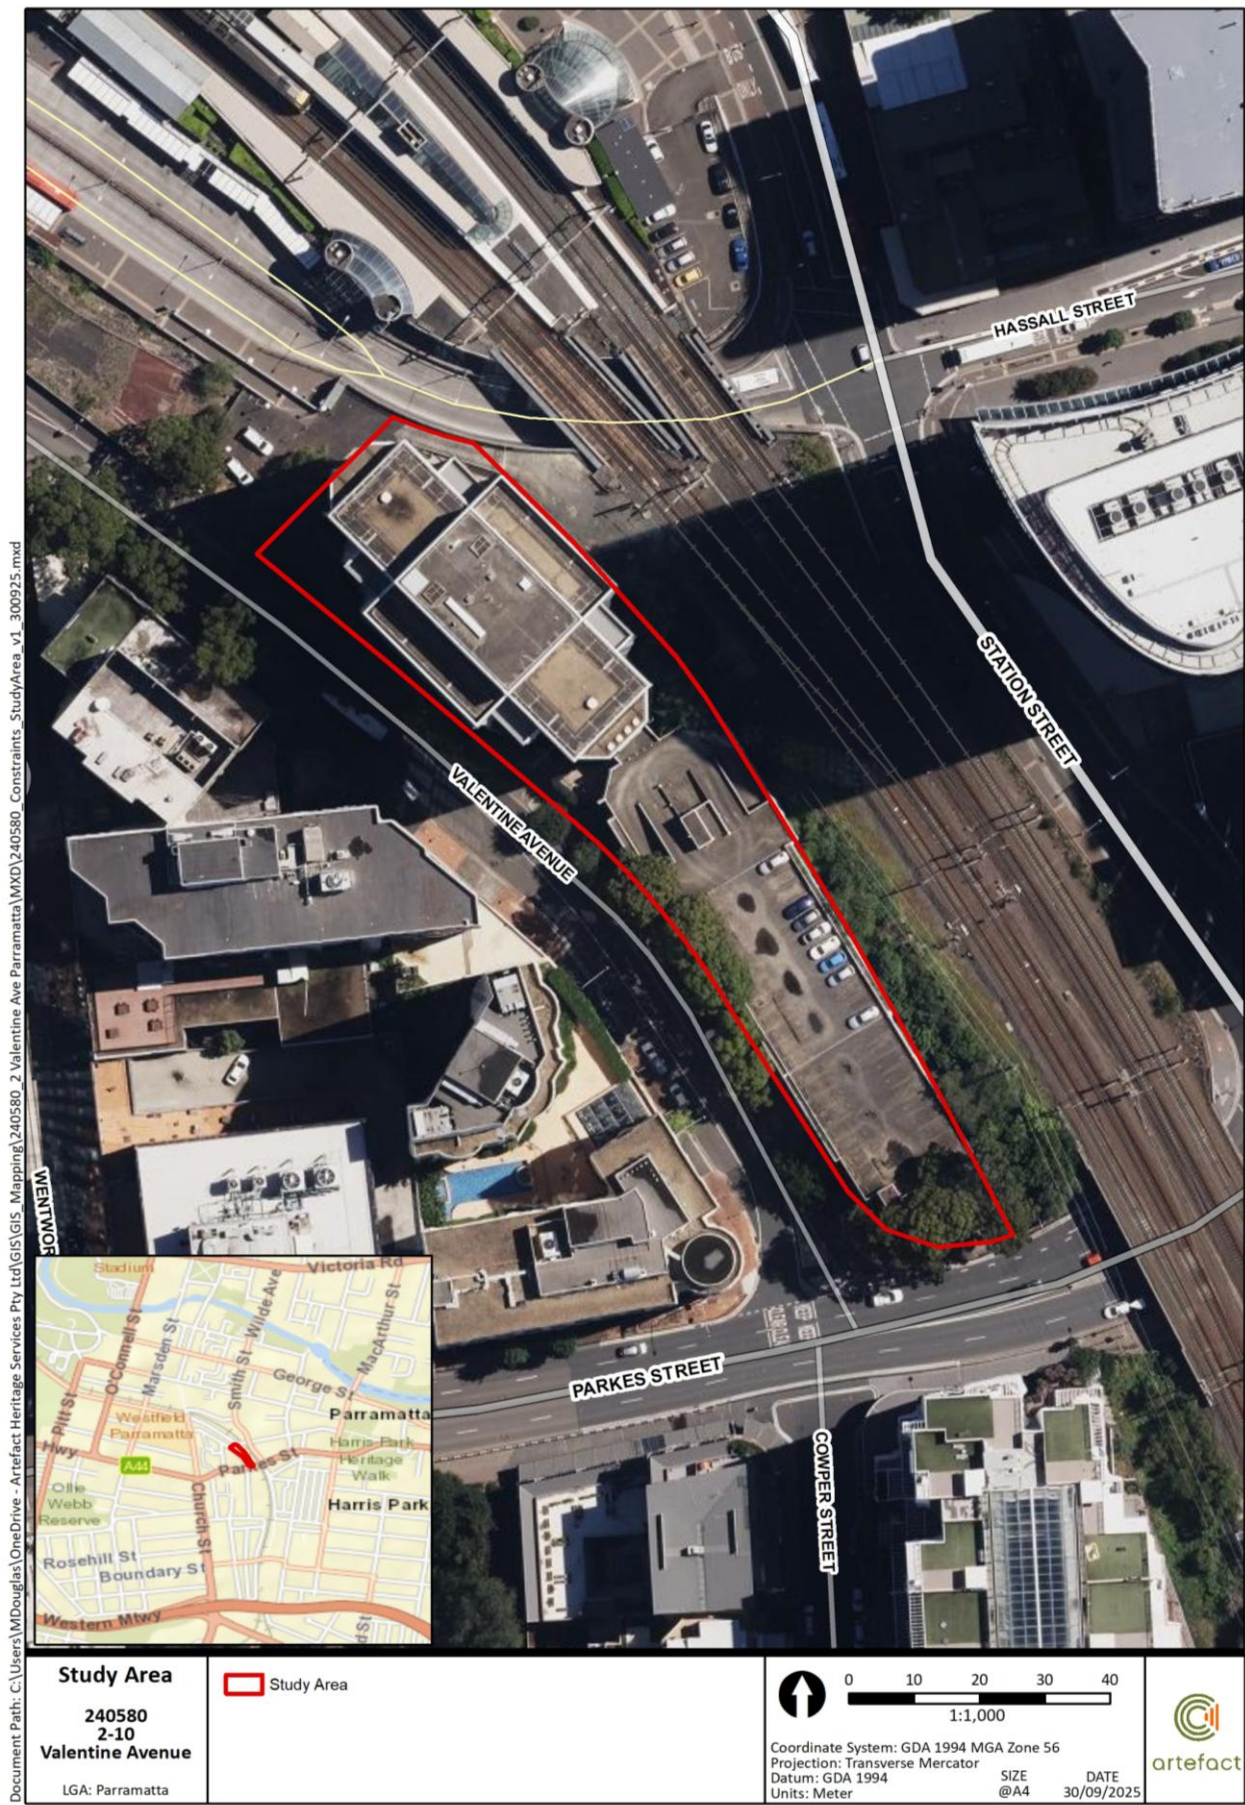

AHIMS search

An extensive search of the Aboriginal Heritage Information Management System (AHIMS) database was undertaken on 27 August 2025 (Client Service ID 1037630) to determine the location of registered Aboriginal sites in relation to the current study area. The search area was defined as approximately 2 km x 2 km of land surrounding the study area to inform the characterisation of the local archaeological context.

The extensive search resulted in a total of 82 registered sites within the wider search area. However, two of these sites were classified as 'Not a site' and have been removed from the total of registered results. As a result, 80 registered sites were identified within the extensive search. No Aboriginal sites were identified within the study area. The closest AHIMS site to the study area is AHIMS ID 45-6-4080 'Potential Archaeological Deposit', in which its centroid is located approximately 55 m northeast of the study area.

The majority of site features within the search area were categorised as 'Potential Archaeological Deposit' (PAD), seven of which are located in close proximity to the study area. When taken in total, the number of sites containing PAD constituted 72.5% (n=58). Comparatively, the total of sites containing 'Artefact' was 53.75% (n=43).

The search results show a dense concentration of sites to the north of the study area along Parramatta River where the Parramatta Sand Body is located. Comparatively, only two sites have been recorded south and east of the study area. The Parramatta Sand Body is known for its deep sand bodies and high archaeological potential. In comparison, the lack of Aboriginal sites in south of the study area could indicate either a lack of archaeological studies or indicate the detrimental effect dense development has had on Aboriginal sites.

Sites within 300m of the study area

Several AHIMS sites were identified within 300m of the study area and their site cards are summarised below.

AHIMS ID 45-6-4080 – Parramatta Transport Interchange PAD-01

While the centroid for AHIMS ID 45-6-4080 is registered approximately 55 m northwest of the study area, the extent of the site abuts the study area. The site is recorded as a PAD measuring 100 m x 35 m. The site was assessed to have been subject to a moderate level of historical disturbance, yet the site card states that archaeological deposits have been recorded in 'similar circumstances nearby'. The site card also states that the site is close to the location of 'the Native Feast' and that the site has potential to contain contact archaeology.

AHIMS ID 45-6-2668 – Argyle St

While this site is recorded on AHIMS, the site card was not available. The information attached to AHIMS excel spreadsheet state it was recorded by Jo McDonald as a PAD

AHIMS ID 45-5-3434 – Parramatta SWC PAD

While the centroid for AHIMS ID 45-5-3434 is located approximately 180 m northwest of the study area, the PAD encompasses a large majority of the Parramatta CBD including Valentine Avenue where the current study area is located. The site card states that despite 19th and 20th century disturbance to Parramatta CBD, intact Aboriginal deposits still remain, including complex archaeological sites or evidence of continuous occupation dating back to the Pleistocene era. It was also assessed there is potential for contact archaeology to be present.

AHIMS ID 45-6-2678 – Smith Street PAD

AHIMS ID 45-6-2678 is located approximately 150 m north of the current study area. The PAD consists of underfloor deposits located at 1-7 Smith and 40-60 Darcy Street, Parramatta. The site card states that the site has unknown archaeological potential and is the site of 'blanket exchange and early feasts held for Aboriginal people by Governor Macquarie' despite the area being subject to a high level of disturbance. Test excavations have been recommended of the site.

AHIMS ID 45-6-3630 – Hassall St PAD

AHIMS ID 45-6-3630 was located approximately 130 m northeast of the current study area. The site card states that through archaeological test excavations 517 cultural lithics were recovered, including 411 stone artefacts. Nine glass artefacts and one flaked artefact made from flint were also recovered. Additionally, a disturbed heat retainer hearth was also uncovered, which was similar to three other similar hearths uncovered at excavations within Parramatta Square (200 m west of AHIMS ID 45-6-3630). The depths of these excavations were not provided on the site card; however, the excavations did not occur within the Parramatta Sand Body. The site was assessed to be occupied by Aboriginal peoples within the last 5000 years and that occupation also continued post-contact. The site was subject to an AHIP (#c0004705 / AHIMS ID 4412) and was subsequently destroyed. The site card was updated to reflect this in 2019.

AHIMS ID 45-6-2741 – Parramatta Transport Interchange PAD

While this site is recorded on AHIMS, the site card was not available. The information attached to AHIMS excel spreadsheet state it was recorded by Sue McIntyre-Tamwoy as a PAD

AHIMS ID 45-6-2669 – PAD WBH

AHIMS ID 45-6-2669 is located approximately 225 m northeast of the current study area. Geotechnical investigations in the site indicate that intact subsurface deposits and thick alluvial deposits extend to depths of 700 mm. It was assessed that due to topography and close proximity of Clay Cliff Creek there is potential for artefact scatters and isolated finds to be present. As a result, test excavations were recommended.

AHIMS ID 45-6-3180 – 21 Hassall Street

AHIMS ID 45-6-3180 is approximately 280 m northeast of the current study area. The site card, recorded in 2015, states that despite the site having been subject to deep localised disturbance, there is potential for subsurface Aboriginal archaeological deposits to be present. As a result, test excavations have been recommended. Following an AHIP (#C0001505) and test excavations, the site card was updated as the site was partially destroyed.

Test excavations completed at the site recovered a total of 1,725 artefacts (52.27 per m²). These were recovered from shallow soils and had extensive post-depositional mixing, such as from bioturbation. It was assessed that while the site contained evidence of Pleistocene activity, it was not easily distinguished from late-Holocene activity. As a result of the excavations, the site has been declared locally significant.

Figure 2: AHIMS extensive search results

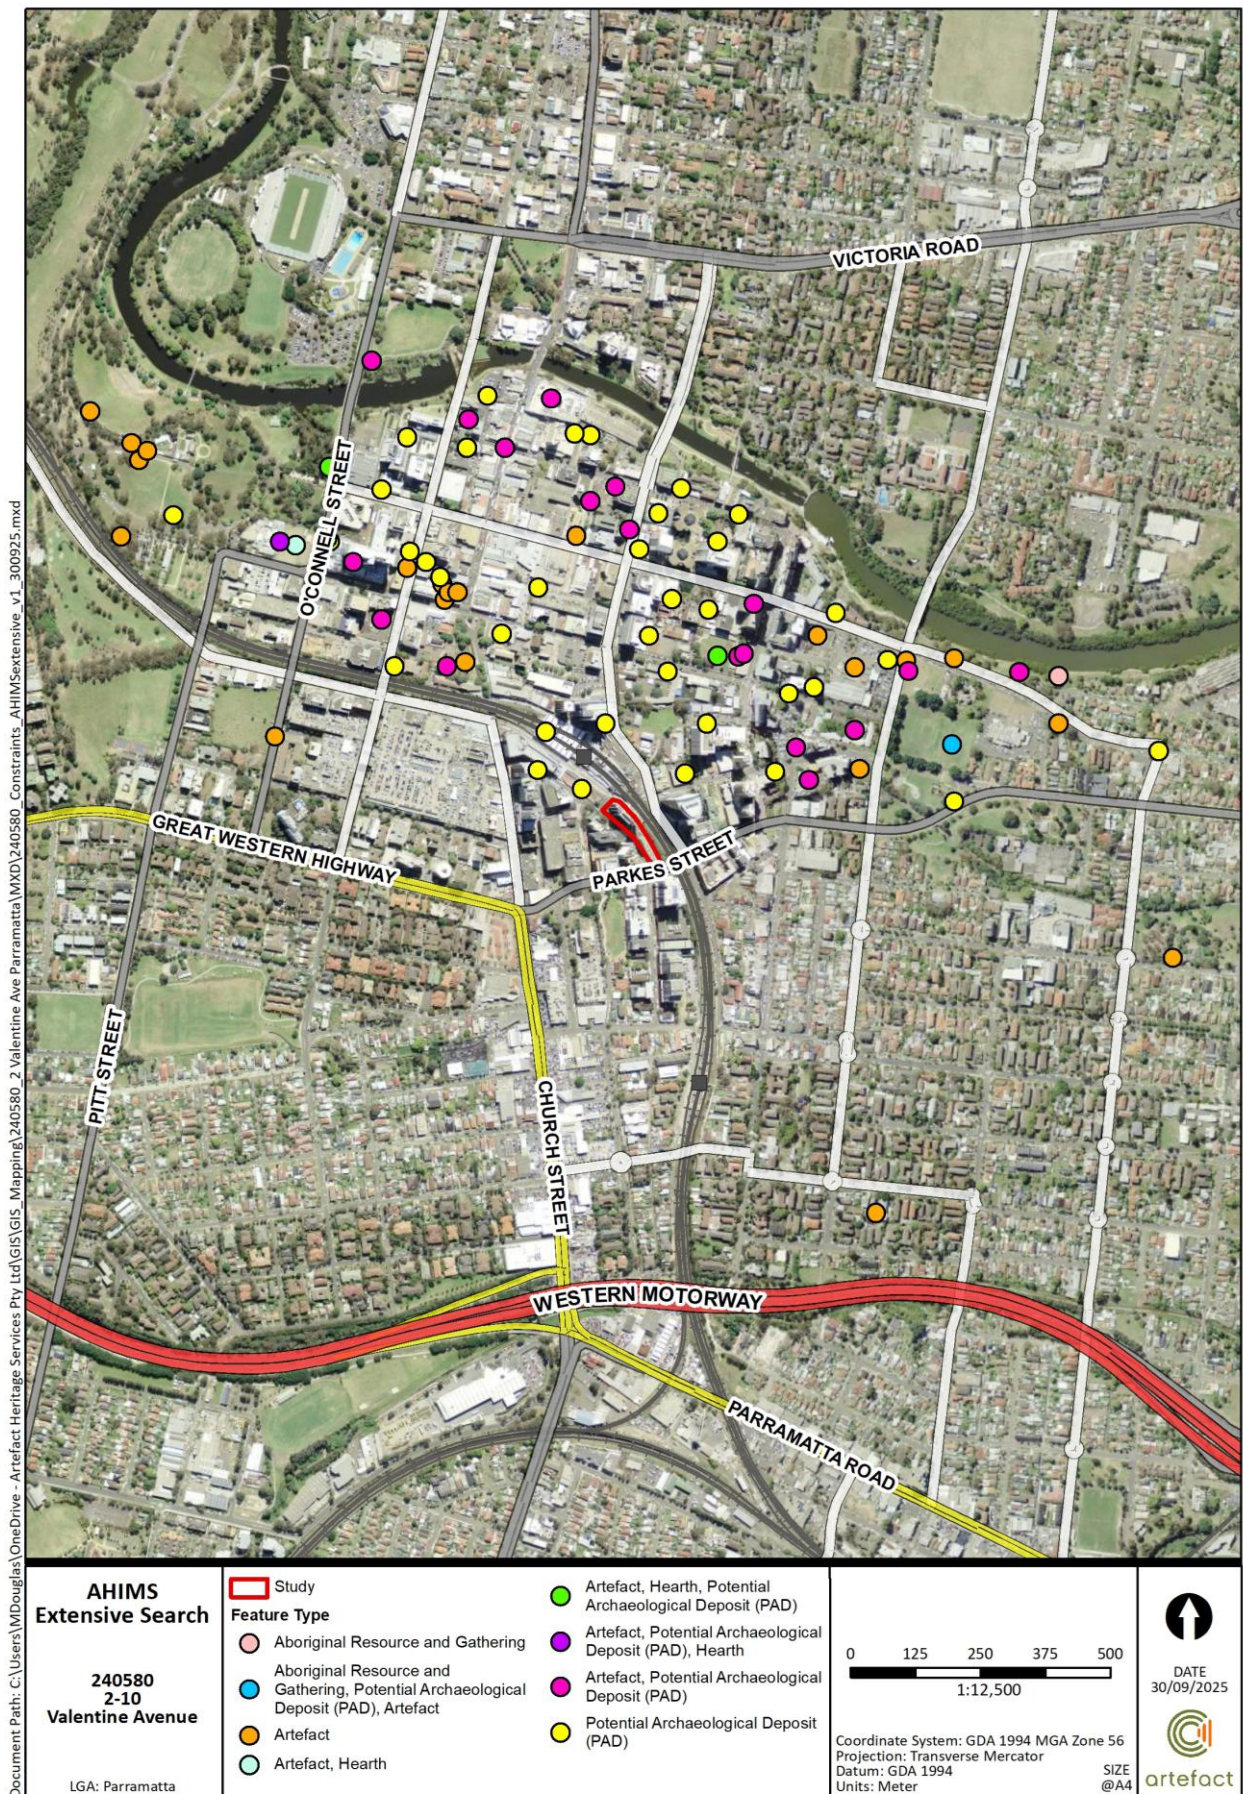


Figure 3: AHIMS detailed search results



Environmental Background

Landform and Hydrology

The study area is 600 m to the west of the Parramatta River on land that grades gently downwards towards the southeast eventually reaching a floodplain associated with Clay Cliff Creek. The creek is located approximately 40 m southeast of the study area and is the closest watercourse. Clay Cliff Creek has previously been described as a freshwater stream in the pre-European era ('Sydney's Forgotten Waterways' n.d.). However, the creek has subsequently been enclosed in concrete and used as a stormwater drain.

Soils

The study area is situated within the Blacktown soil landscape, which is comprised of shallow to moderately deep (<100cm) Red and Brown Podzolic Soils on crests, upper slopes and well-drained areas, and deep (150-300cm) Yellow Podzolic Soils on lower slopes and in poorly drained areas (eSPADE 2015) (Figure 4). As the study area is spread across the upper to lower portions of a slope, portions of the study area are likely to contain shallow soil profiles that are susceptible to ground disturbance, which may limit the potential for archaeological deposits to be present.

The southern portion of the study area is also in close proximity to the boundary between the Blacktown and Birrong soil landscapes, meaning that some soil mixture between the two landscapes may have occurred within the study area (Figure 4). Soils within the Birrong landscape are generally deeper (>250 cm) and less prone to erosion from ground disturbance (eSPADE 2015).

At its closest point, the study area is also located approximately 250 m southeast of the mapped extent of the Parramatta Sand Body, which is known to possess Aboriginal archaeological sensitivity (Williams and McDonald 2021; Artefact Heritage 2023; Quinn et al. 2023; Williams et al. 2024) (Figure 5). While the sand body has been identified outside its mapped extent, the study area's distance from the confirmed location of the sand body suggests that it is unlikely to appear in the study area.

Geology

The study area is underlain by Wianamatta Group geology, which is predominantly composed of shale with some claystone and fine to medium grain sandstone. These lithic materials were not generally used as stone tools or in their manufacture, and the lack of rocky outcrops in areas underlain by Wianamatta Group geology limits the potential for rock shelters or engraving platforms to be present.

Historical land use

The preservation of the original soil landscape, and therefore its potential to contain in situ Aboriginal objects, is primarily dependent on the underlying topography, depth of the soil, rate of erosion, the amount of vegetation cover, and the level of historical disturbance. An historical image of the study area from 1930s shows that by this time the original vegetation had been cleared and the railway line had been constructed as well as numerous other buildings in the surrounding areas (Figure 6). A structure was present by 1943 and subsequently extended by 1978 with the addition of a carpark along within the southern portion of the study area (Figure 7 and Figure 8). In 1994, two structures (believed to be the present day structures) are present and cover the majority of the study area (Figure 9). Mapping as well as previous building plans provided by Future Place Projects on the 22 September 2025 for the commercial building at 10 Valentine Avenue and the multi-storey carpark at

2 Valentine Avenue demonstrate that deep subsurface excavations had been undertaken for below-ground-surface car parking in both building (Figure 10).

These previous historical disturbances would have required meters of subsurface excavations which would have included the removal/redistribution of soil and importation of fill. These impacts are likely to have significantly disturbed if not destroyed any archaeological remains which may once have been present within the study area.

Figure 4: Soil landscape within and surrounding the study area

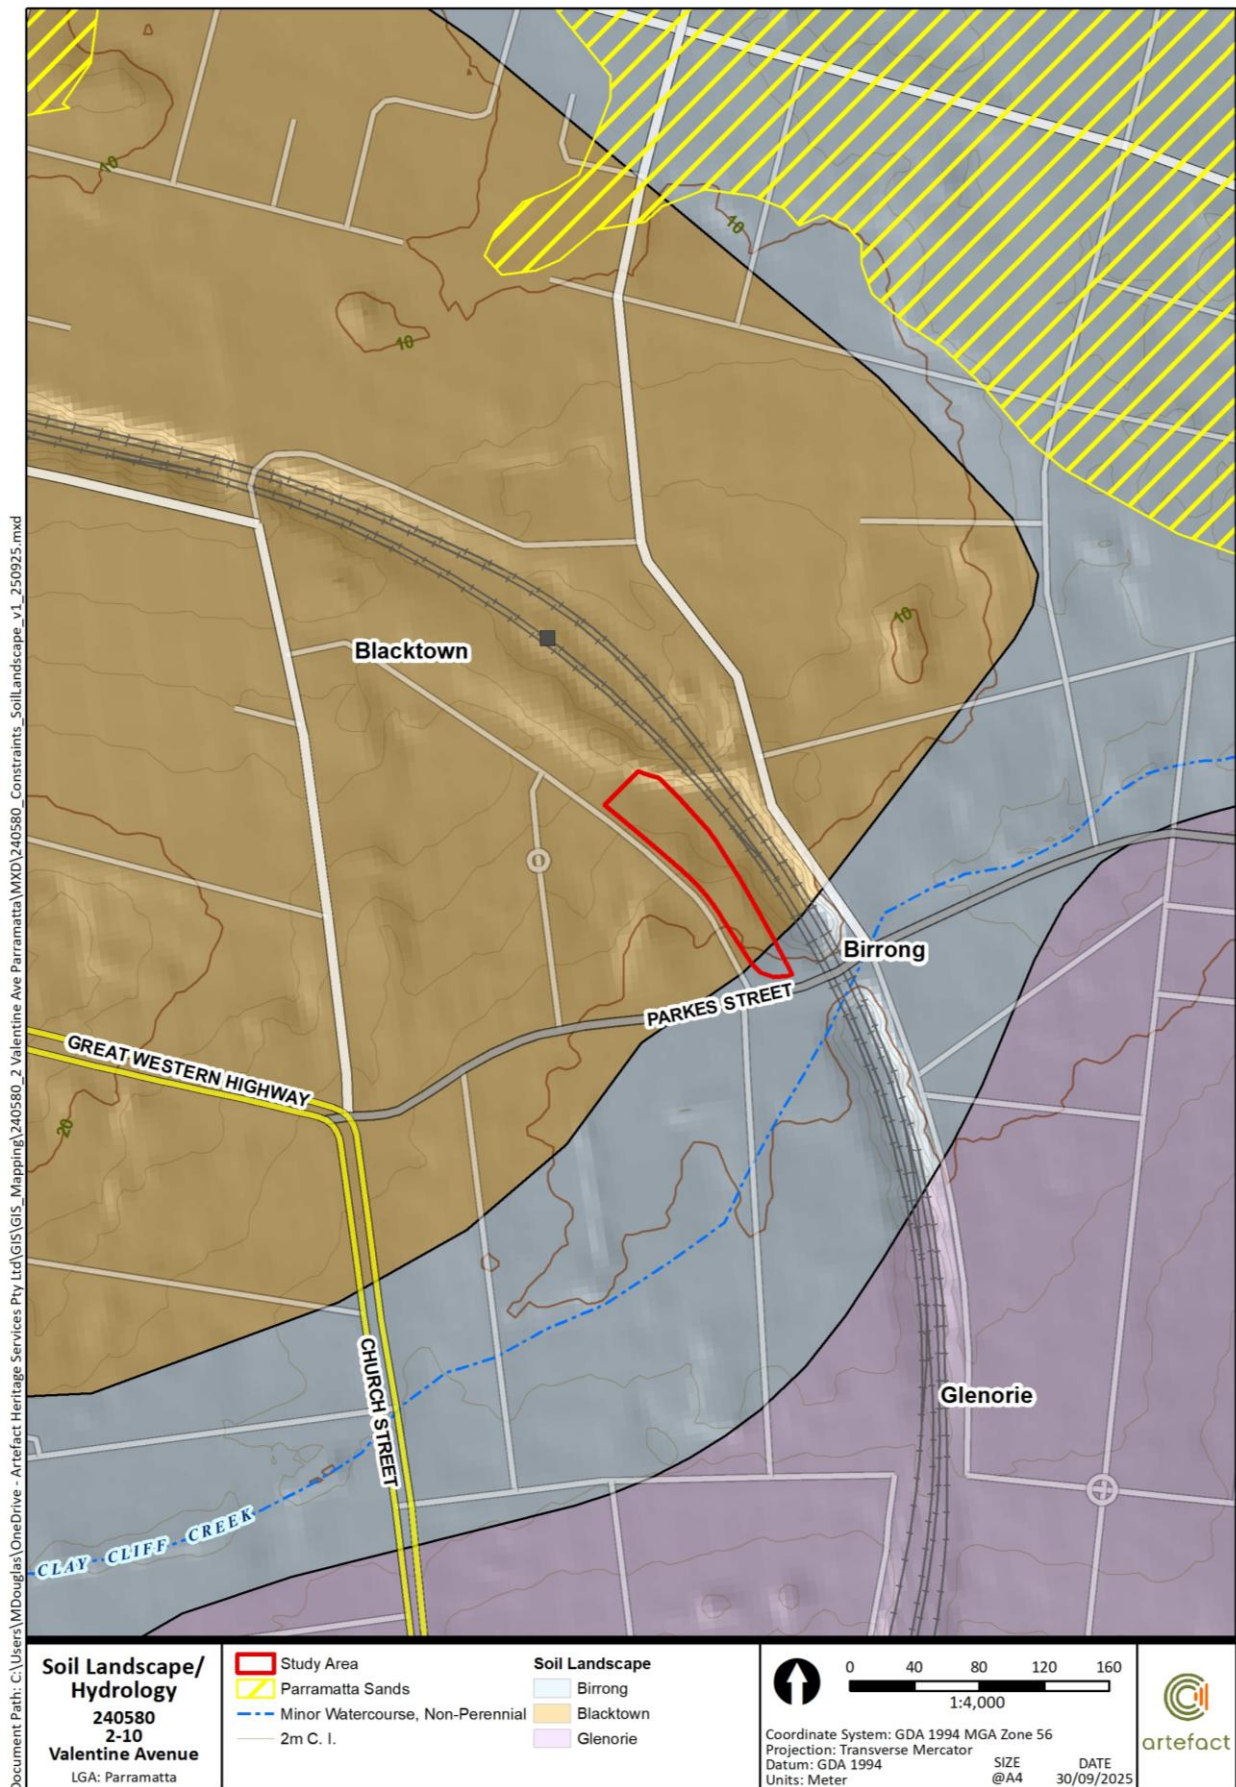


Figure 5: The study area (blue) in relation to the Parramatta Sand Body (shown in yellow)

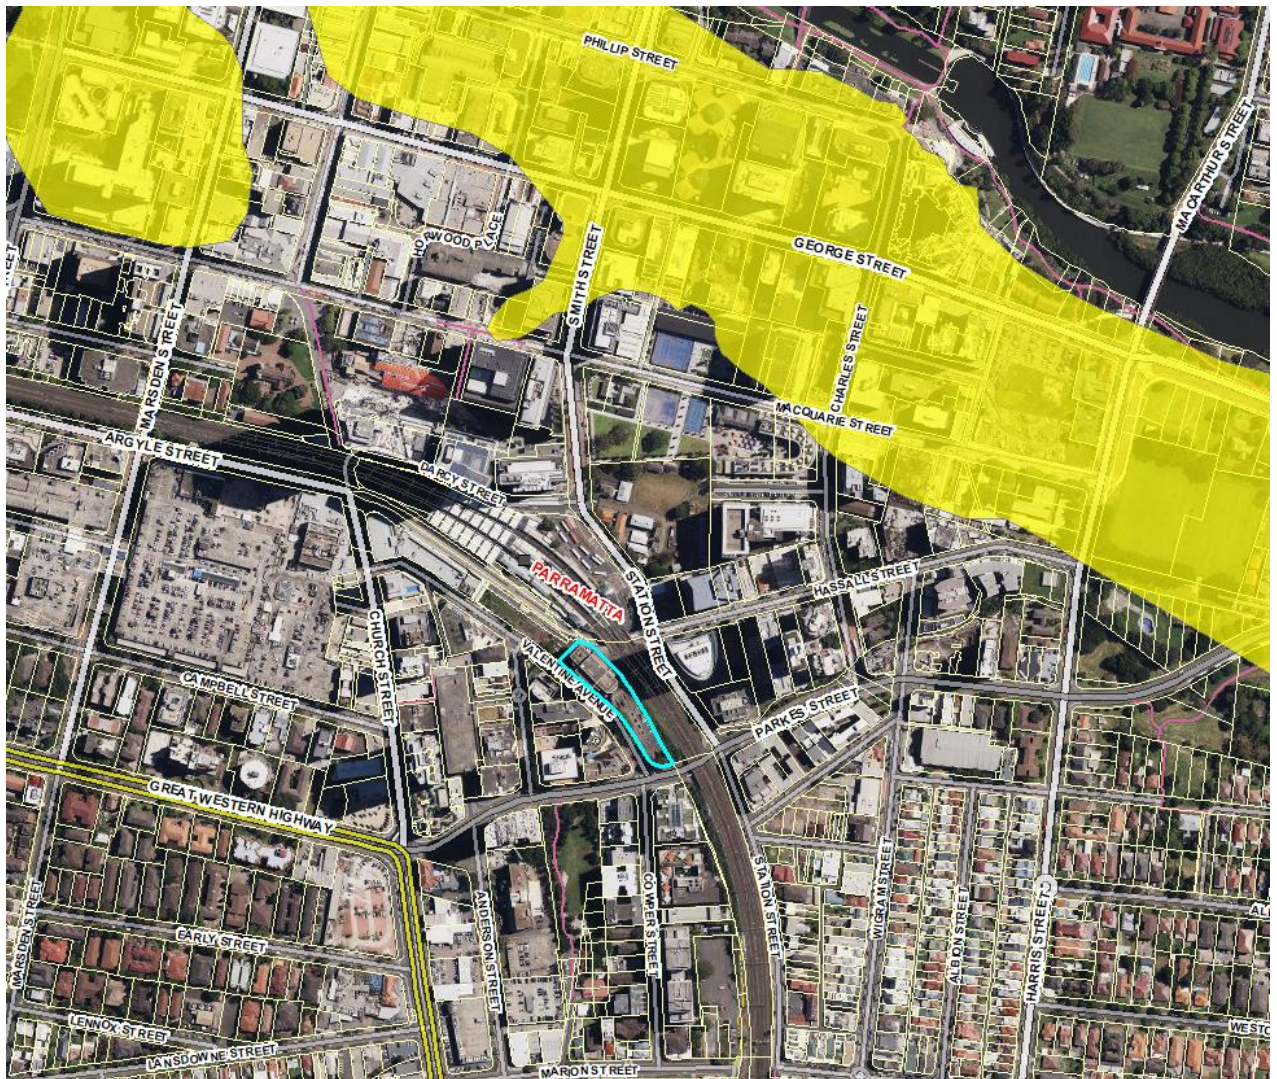


Figure 6: 1930 aerial overlay showing the study area has cleared from vegetation and the construction of multiple developments and infrastructure around the study area including the rail corridor



Figure 7: 1943 aerial overlay showing a large structure within the study area and associated landscaping

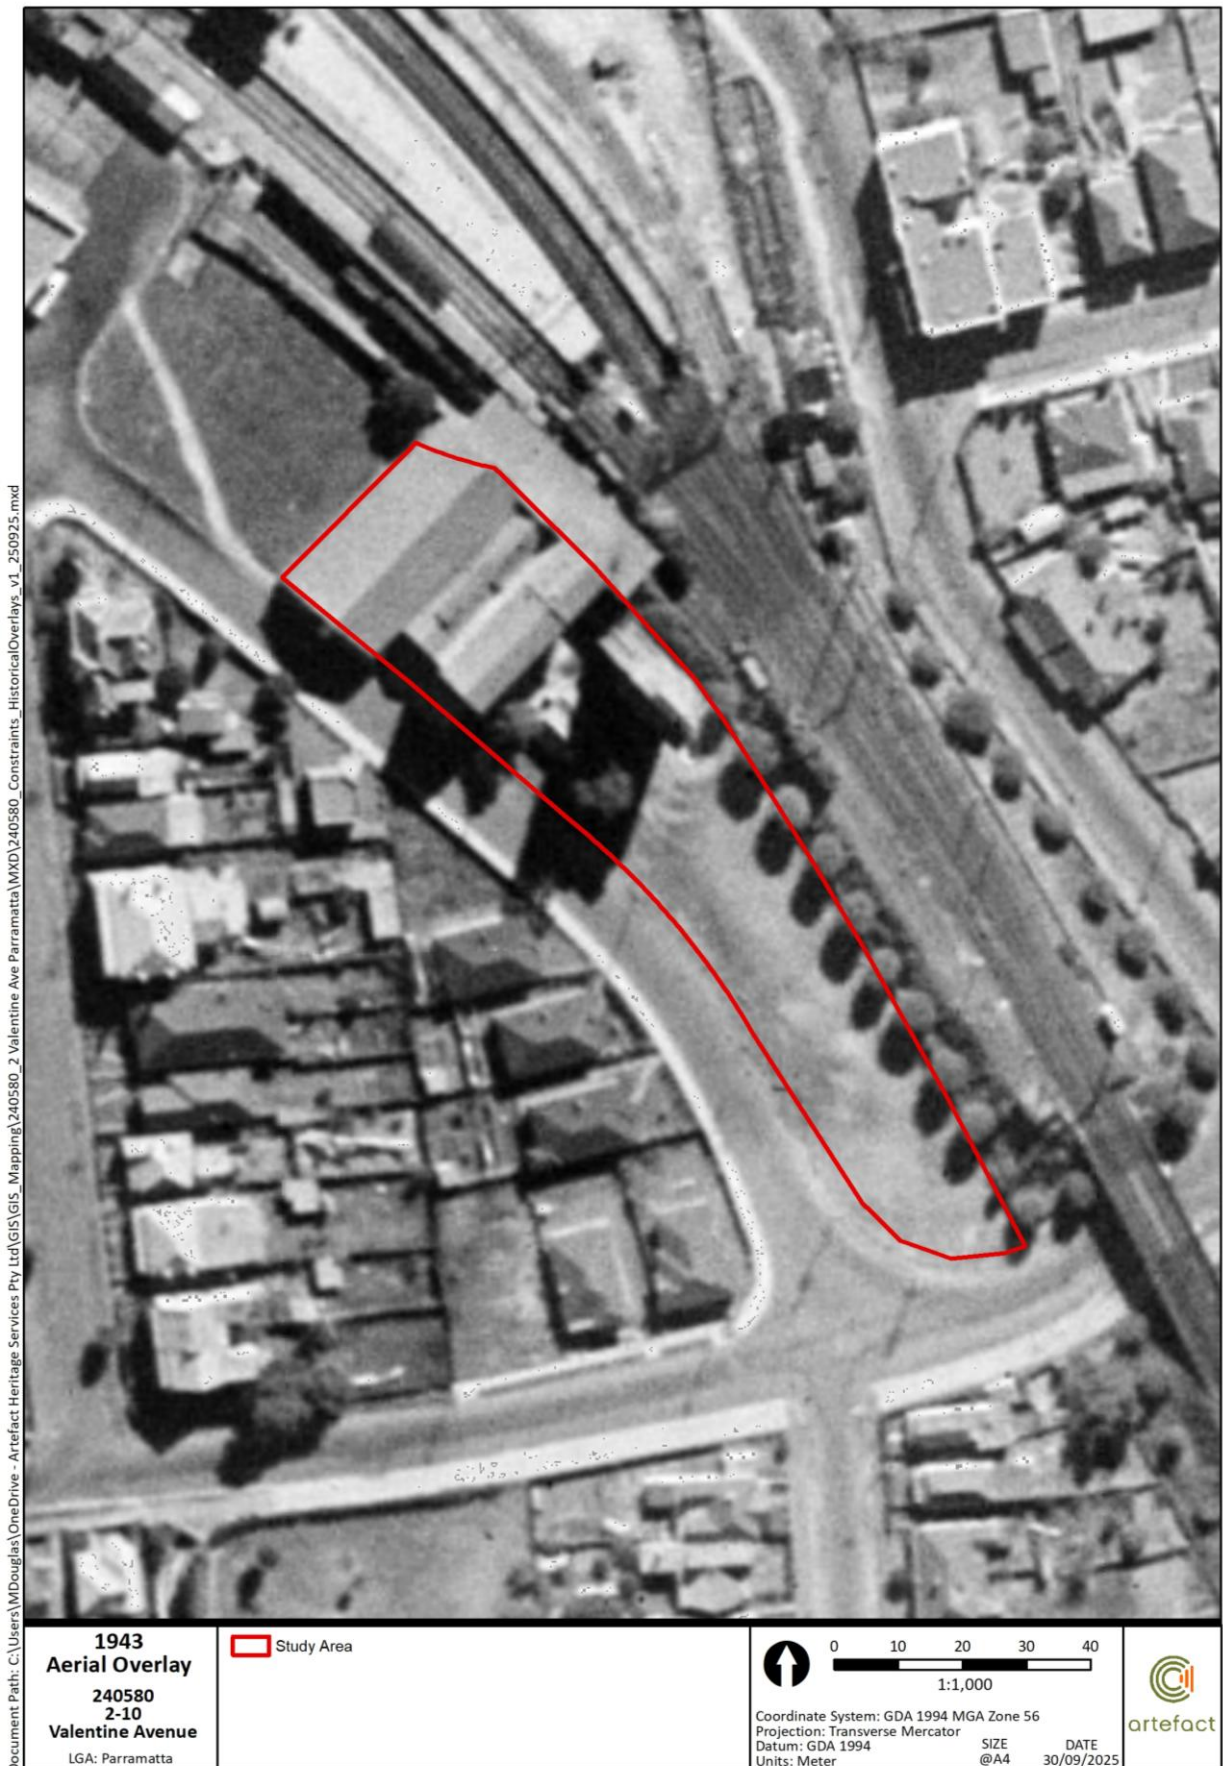


Figure 8: 1978 aerial overlay showing the structure was extended to the southeast



Figure 9: 1994 aerial overlay showing the majority of the study area occupied by two large structures



Figure 10: Evidence of subsurface ground disturbance from basement carparking (Source: Google maps, 2025)



Landscape features that indicate the presence of Aboriginal objects

Aboriginal objects are often associated with particular landscape features as a result of Aboriginal people's use of those features in their everyday lives and for traditional cultural activities. Therefore, according to the *Due Diligence Code of Practice for the Protection of Aboriginal Objects in New South Wales* (Department of Environment, Climate Change & Water 2010), it is likely that Aboriginal objects will be present on land that is:

- Within 200m of water, or
- Located within a sand dune system, or
- Located on a ridge top, ridge line, or headland, or
- Located within 200m below or above a cliff face, or
- Within 20m of or in a cave, rock shelter, or cave mouth
- Is on land that has not been subject to human activity that has changed the land's surface, in a clear and observable manner.

A review of aerial imagery and desktop resources indicate that the study area contains **one** of the landscape features that often associated with Aboriginal objects.

Landscape Feature	Presence in study area
Within 200m of water	Yes. The study area is 40 m north of Clay Cliff Creek, which has since been enclosed in concrete and used as a stormwater drain.
Located within a sand dune system	No. The Parramatta Sand Body is located approximately 250 m north and northeast of the study area at its closest point, and approximate 570m northwest of the study area.
Located on a ridge top, ridge line, or headland	No. The study area is not located on a ridge top, ridge line or headland.
Located within 200m below or above of a cliff face	No. The study area is not located within 200m below or above of a cliff face
Within 20m of or in a cave, rock shelter, or cave mouth (Environment 2010)	No. The study area is not located within 20 of or in a cave, rock shelter or cave mouth.
Is not on disturbed land – Land is disturbed if it has been the subject of a human activity that has changed the land's surface, being changes that remain clear and observable.	Yes. The land within the study area has been historically modified since at least the 1930s. These have included meters-deep subsurface excavations for the constructions of carparks and building.

Previous relevant archaeological assessments

A summary of previous relevant Aboriginal archaeological assessments listed in Table 1 below are within close proximity to the study area. They demonstrate that this area of Parramatta is archaeologically and cultural significant to the Aboriginal people. However, it is important to note that the likelihood of landforms to potentially contain intact archaeological deposits with Aboriginal objects is dependent on the extent of land modification. Some sites, such as those within the deeper soil profiles that have not been subjected to deep historical excavation have a stronger likelihood to contain Aboriginal objects.

Table 1: Previous Aboriginal archaeological assessments

Report	Summary	Proximity to study area
Umwelt 2025, Archaeological Test Excavation Report: nbn Upgrade Works, Parramatta, New South Wales, Aboriginal Heritage Impact Permit #4767. Report prepared for Ventia on behalf of nbn Co.	Investigation of the site indicated that potential natural soils profiles may be present within the works area. A trench of 1m x ~400-700mm was excavated and consisted of sterile fill material and synthetic sheeting over a disturbed sand and clay base. No Aboriginal objects were identified. The site was assessed to be disturbed from previous ground disturbing works and it was unclear whether any natural or intact areas of the Parramatta sand body were present. Deeper deposits were not verified due to the impact depths for the works. It was assessed that no Aboriginal objects or potential for Aboriginal objects would be likely in immediate proximity to the site.	Approximately 560 m north
Artefact 2024, 33 Argyle Street, Parramatta: Aboriginal Cultural Heritage Report. Report prepared for TE2 Roxy Argyle Pty Ltd.	Artefact previously assessed a site at 33 Argyle Street and identified one PAD (, 33AGL- which extended across the whole of the site. The PAD was identified based on the localised disturbance, meaning that natural soil profiles could still be present under the existing development, as well as the general level of archaeological potential observed as the Parramatta region, even outside of the Parramatta Sand Body and within urbanised areas. Due to the potential for natural soil profiles preserved under the building, further investigation of the area was recommended prior to future development of the site.	Adjacent (northwest)

Report	Summary	Proximity to study area
Artefact 2023, Fitzwilliam and Argyle Streets, Parramatta: Aboriginal Cultural Heritage Report. Report prepared for Urban Property.	Artefact previously assessed a site directly adjacent to the present study for the Parramatta Transport Interchange (SSDA) and identified an area of potential archaeological deposit - 33AGL-PAD 01 (AHIMS ID 45-6-4080) in a portion of the study area. Although the majority of the site was assessed as having nil-low potential for archaeological deposits, there was a small area in the northwest of the study area identified as having moderate potential for natural soil profiles preserved under the building, It was recommended that further investigation, including archaeological test excavation be undertaken to if Aboriginal objects are present prior to future development of the site.	
Comber Consultants 2023, 39-43 Hassall St, Parramatta: Aboriginal Archaeological Testing Report. Report prepared for Novus Management Pty Ltd on behalf of Perpetual Corporate Trust Limited (CAN 000 341 5330) as custodian for Aliro Trusco 1 Pty Ltd (ACN 630 343 654) as trustee for Harris Street Sub Trust (Landowner).	Investigation of the site led to test excavations in September/October 2022, in which 13 1m x 1m test trenches were excavated. Three artefacts and a piece of ochre were recovered. The three artefacts consisted of one complete tuff flake, one river pebble used for pounding and one flaked piece of chert (AHIMS ID 45-6-4068). The site was assessed to be highly disturbed from continual flooding from the Parramatta River and Clay Cliff Creek.	Approximately 410 m northeast
Comber Consultants 2022, 12 Hassall St, Parramatta: Aboriginal Cultural Heritage Assessment Report. Report prepared for GQ Hassall Street Pty Ltd.	From an investigation of the site, Comber, in conjunction with information from the general archaeological investigations across Parramatta, concluded there was potential for subsurface deposits despite development of the site. Comber suggested that a layer of fill within the site would have protect subsurface Aboriginal deposits. However, a PAD has not been registered on AHIMS.	Approximately 190 m northeast
Comber Consultants 2022, 12 Hassall St, Parramatta: Aboriginal Archaeological Assessment. Report prepared for GQ Hassall Street Pty Ltd.	Recommendations included test excavations.	

Report	Summary	Proximity to study area
Jo McDonald Cultural Heritage Management Pty Ltd 2004, <i>Archaeological Test Excavation at 1 Smith Street (Site SSP1) Parramatta NSW. Report prepared for Casey & Lowe Pty Ltd on behalf of Sydney Water.</i>	Test excavations of the site (79 pits) resulted in recovery of 198 lithic items. The highest pit density was 25 Aboriginal object, but the overall density of artefacts per test pit was low. An increased area of artefact density appeared to be from a quartz knapping floor in the southern portion of the site. Despite ground disturbance from development, it was estimated that approximately 40% remained undisturbed or relatively undisturbed. As a result, it was predicted that this may be similar to other places across Parramatta CBD.	Approximately 160 m north

Conclusions and recommendations


This Due Diligence Assessment has found that:

- Numerous Aboriginal sites and PADs have been identified in close proximity to the study area. These are in landforms that have *not* been impacted and modified to the depth and extent of the study area.
- No AHIMS registered sites were identified within the study area. However, it does contain one landscape feature (water) known to be associated with potential Aboriginal objects
- The study area has been subject to development since at least the 1930s that have required meters-deep subsurface excavations to construct subsurface carparks and basements within buildings. These works would have included the removal/redistribution of soil and importation of fill which is likely to have significantly disturbed if not destroyed any archaeological remains which may once have been present within the study area.
- It has been determined due to the abovementioned landform modification from historical disturbance across the site, it is unlikely Aboriginal objects are unlikely to be present in the study area

Based on these findings, it is recommended that:

- There are no known Aboriginal objects or places located within the study area.
- The study area is not likely to contain any Aboriginal objects. It is recommended that no further Aboriginal heritage assessment or investigation are required, and the proposed works can proceed with caution.
- As no Aboriginal objects or places will be harmed as result of the proposed works an Aboriginal cultural heritage assessment report (ACHAR) is not recommended
- This Due Diligence assessment does not constitute consent to harm Aboriginal objects, nor it is a 'site clearance' mechanism to allow activities to occur in an area where Aboriginal objects are likely or known to be present
- If Aboriginal objects are discovered during the proposed works, works must stop immediately, and an assessment must be undertaken in accordance with Part 6 of the National Parks and Wildlife Act 1974. If the activity cannot avoid harm to Aboriginal objects, works cannot proceed until an Aboriginal Heritage Impact Permit has been issued

Rebecca Bryant

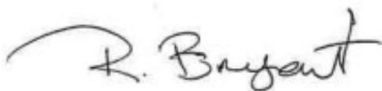

Senior Heritage Consultant
Artefact Heritage and Environment
rebecca.bryant@artefact.net.au

Re Artefact 2024, 33 Argyle Street, Parramatta: *Aboriginal Cultural Heritage Report*. Report
prepared for TE2 Roxy Argyle Pty Ltd.

REFERENCES

- Artefact 2023, Fitzwilliam and Argyle Streets, *Parramatta: Aboriginal Cultural Heritage Report*. Report prepared for Urban Property.
- Artefact 2023, *Parramatta Transport Interchange SSDA: Aboriginal Technical Report*. Report prepared for Urban Property.
- Artefact, 2023, *Parramatta Transport Interchange SSDA: Aboriginal Cultural Heritage Assessment Report*. Report prepared for Urban Property.
- Artefact 2024, 33 Argyle Street, *Parramatta: Aboriginal Cultural Heritage Report*. Report prepared for TE2 Roxy Argyle Pty Ltd.
- Colquhoun, GP, Hughes, KS, Deyssing, L, Ballard, JC, Folkes, CB, Phillips, G, Troedson, AL & Fitzherbert, JA 2024, *New South Wales Seamless Geology dataset, version 2.4 [Digital Dataset]*. Geological Survey of New South Wales, Department of Regional NSW, Maitland.
- Comber Consultants 2022, 12 Hassall St, *Parramatta: Aboriginal Archaeological Assessment*. Report prepared for GQ Hassall Street Pty Ltd.
- Comber Consultants 2022, 12 Hassall St, *Parramatta: Aboriginal Cultural Heritage Assessment Report*. Report prepared for GQ Hassall Street Pty Ltd.
- Comber Consultants 2023, 39-43 Hassall St, *Parramatta: Aboriginal Cultural Heritage Assessment Report*. Report prepared for Novus Management Pty Ltd on behalf of Perpetual Corporate Trust Limited (CAN 000 341 5330) as custodian for Aliro Trusco 1 Pty Ltd (ACN 630 343 654) as trustee for Harris Street Sub Trust (Landowner).
- Comber Consultants 2023, 39-43 Hassall St, *Parramatta: Aboriginal Archaeological Testing Report*. Report prepared for Novus Management Pty Ltd on behalf of Perpetual Corporate Trust Limited (CAN 000 341 5330) as custodian for Aliro Trusco 1 Pty Ltd (ACN 630 343 654) as trustee for Harris Street Sub Trust (Landowner).
- Department of Environment Climate Change and Water 2010a, *Code of Practice for the Protection of Aboriginal Objects in New South Wales*, DECCW, Sydney
- Jo McDonald Cultural Heritage Management Pty Ltd 2004, *Archaeological Test Excavation at 1 Smith Street (Site SSP1) Parramatta NSW*. Report prepared for Casey & Lowe Pty Ltd on behalf of Sydney Water.
- NSW Government 2015, 'Birrong',
<https://espaderesources.environment.nsw.gov.au/resources/SPADE/reports/9130bg.pdf>
- NSW Government 2105, 'Blacktown',
<https://espaderesources.environment.nsw.gov.au/resources/SPADE/reports/9030bt.pdf>
- NSW Government 2025, Historical Imagery Viewer,
<https://portal.spatial.nsw.gov.au/portal/apps/webappviewer/index.html?id=f7c215b873864d44bccddda8075238cb>
- Quinn, M, Owen, T, Flanagan, J, Westaway, K.E 2023, 'An Aboriginal presence in the Sydney basin prior to the LGM; further investigations into the age and formation of the Parramatta Sand Body', *Journal of Archaeological Science*, vol. 51.
- Sydney's Forgotten Waterways (n.d.). 'Pocket Guide to Sydney'. Retrieved 20 August 2021 <
<https://www.visitsydneyaustralia.com.au/waterways-west.html> >.

Umwelt 2025, *Archaeological Test Excavation Report: nbn Upgrade Works, Parramatta, New South Wales, Aboriginal Heritage Impact Permit #4767*. Report prepared for Ventia on behalf of nbn Co.

Williams and McDonald 2021, 'We revisited Parramatta's archaeological past to reveal the deep-time history of the heart of Sydney', *The Conversation*, <<https://theconversation.com/we-revisited-parramattas-archaeological-past-to-reveal-the-deep-time-history-of-the-heart-of-sydney-169827>>

Williams, A, McDonald. J, Atkinson F, Barry L, Doelman T 2024, 'On the balance of evidence, peopling of Parramatta, Sydney, Australia, occurred after the Last Glacial Maximum: A reply to Quinn et al. (2023) and Owen et al. (2024)', *Journal of Archaeological Science*, vol. 60.

APPENDIX A – PROPOSED WORKS (BELOW GROUND SURFACE)

Figure 11: Proposed works – Basement 6 (Source: Buchan Furtado Sullivan, December 2025, Rev C)



Level B6 Basement

File
Autodesk Docs://240008-R24-2ValentineAve/VAL-BUC-AZ-M6-A-R24-ARCHITECTURE.rvt

Figure 12: Proposed works – Basements 3-5 (Source: Buchan Furtado Sullivan, December 2025, Rev C)




Figure 13: Proposed works – Basement 2 (Source: Buchan Furtado Sullivan, December 2025, Rev C)



Figure 14: Proposed works – Basement 1 (Source: Buchan Furtado Sullivan, December 2025, Rev C)



Figure 15: Proposed works – Ground Floor Plan (Source: Buchan Furtado Sullivan, December 2025, Rev C)

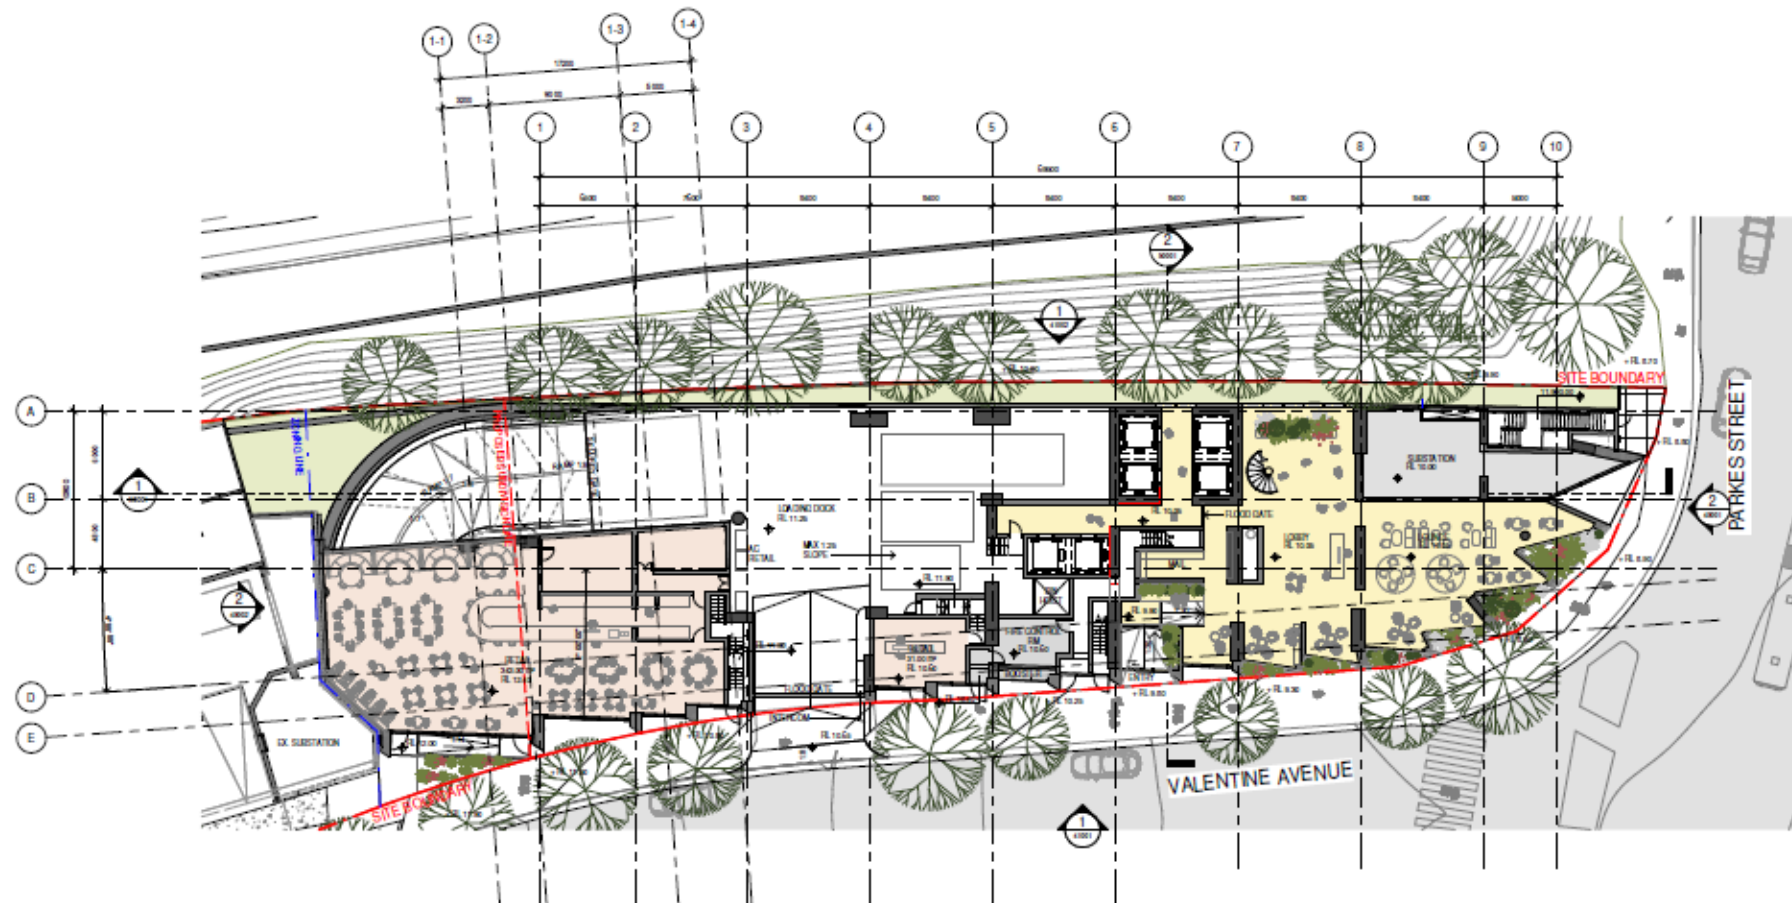

APPENDIX B – AHIMS RECORDS



AHIMS Web Services (AWS) Extensive search - Site list report

Your Ref/PO Number : valentine av
Client Service ID : 1037630

SiteID	SiteName	Datum	Zone	Easting	Northing	Context	Site Status **	SiteFeatures	SiteTypes	Reports
45-5-2465	Parramatta Regional Park (IF3)	GDA	56	314524	6256879	Open site	Partially Destroyed	Artefact : -	Isolated Find	102142,10219 6
Contact		Recorders		Doctor.Jillian Comber,J Steel		Permits		3822		
45-6-4063	The Albion Hotel	GDA	56	315977	6256462	Open site	Valid	Potential Archaeological Deposit (PAD) : -		105061
Contact		Recorders		Comber Consultants Pty Limited,Ms.Agata Calabrese		Permits		5108		
45-6-3065	PHILLIP ST PAD 1	GDA	56	315500	6256675	Open site	Valid	Potential Archaeological Deposit (PAD) : 1		
Contact		Recorders		Mr.Dominic Steele		Permits				
45-5-4535	Parramatta Park - Location E	GDA	56	314539	6256846	Open site	Valid	Artefact : -		
Contact		Recorders		Val Attenbrow		Permits				
45-6-4123	Horwood Place PAD 1	GDA	56	315405	6256768	Open site	Partially Destroyed	Potential Archaeological Deposit (PAD) : -, Artefact : -		
Contact		Recorders		Extent Heritage Pty Ltd - Pyrmont - Individual users,Extent Heritage Pty Ltd - Pyrm		Permits		5340		
45-6-4134	PARRAMATTA AS 2	GDA	56	315126	6256579	Open site	Valid	Artefact : -		
Contact		Recorders		Austral Archaeology,Mrs.Felicity Smolenaers		Permits				
45-5-0864	Governors Bathhouse;	AGD	56	314340	6256750	Open site	Partially Destroyed	Artefact : -	Open Camp Site	102142,10219 6
Contact		Recorders		Michael Guider		Permits		3822		
45-5-2856	Parramatta Park Macquarie Entrance PAD	AGD	56	314500	6256550	Open site	Partially Destroyed	Potential Archaeological Deposit (PAD) : -		98738,103133
Contact		Recorders		Dominic Steele Archaeological Consulting		Permits		1647,3822		
45-6-2679	Parramatta Children's Court	AGD	56	314900	6256600	Open site	Valid	Potential Archaeological Deposit (PAD) : -		102196,10378 2
Contact		Recorders		Ms.Laila Haglund		Permits		1850,1973,2117,3847		
45-5-3630	Macquarie St PAD	AGD	56	314800	6256500	Open site	Destroyed	Potential Archaeological Deposit (PAD) : -		103782
Contact		Recorders		Comber Consultants Pty Limited,Comber Consultants Pty Limited		Permits		3107,3302		
45-6-1523	George St Parramatta;Family Law Courts;	AGD	56	314950	6256450	Open site	Valid	Artefact : -	Open Camp Site	1809,102196,1 03782
Contact		Recorders		Val Attenbrow,Doctor.Edward Higginbotham		Permits				
45-6-2554	Elizabeth Farmhouse	AGD	56	316420	6255700	Open site	Valid	Artefact : -	Open Camp Site	102196,10378 2
Contact		Recorders		Michael Guider		Permits		2928		

Report generated by AHIMS Web Service on 27/08/2025 for Katrina Eckford for the following area at Datum :GDA, Zone : 56, Eastings : 314440.0 - 316555.0, Northings : 6254988.0 - 6257043.0 with a Buffer of 0 meters.. Number of Aboriginal sites and Aboriginal objects found is 82

This information is not guaranteed to be free from error omission. Heritage NSW and its employees disclaim liability for any act done or omission made on the information and consequences of such acts or omission.

Page 1 of 8



AHIMS Web Services (AWS) Extensive search - Site list report

Your Ref/PO Number : valentine av

Client Service ID : 1037630

SiteID	SiteName	Datum	Zone	Easting	Northing	Context	Site Status **	SiteFeatures	SiteTypes	Reports
45-6-2978	41 Hunter Street PAD	GDA	56	315030	6256450	Open site	Valid	Potential Archaeological Deposit (PAD) : -		
	Contact									
		Recorders		Mr.Alexander Beben				Permits	3419	
45-6-3503	32 Smith Street	GDA	56	315536	6256745	Open site	Partially Destroyed	Potential Archaeological Deposit (PAD) : 1		103963,10396 4,103965
	Contact									
		Recorders		AMAC Group P/L,Mr.Benjamin Streat				Permits	4268,4347	
45-6-3630	Hassall St PAD	GDA	56	315587	6256244	Open site	Destroyed	Potential Archaeological Deposit (PAD) : 1		
	Contact									
		Recorders		Comber Consultants Pty Limited,Ms.Jillian Comber				Permits	4412,4527	
45-6-4015	Church St PAD-1	GDA	56	315118	6256622	Open site	Valid	Potential Archaeological Deposit (PAD) : -		
	Contact									
		Recorders		Biosis Pty Ltd - Wollongong,Biosis Pty Ltd - Wollongong,Mrs.Samantha Keats,Mrs.S				Permits	4960,5234	
45-6-2648	Charles/George 1	GDA	56	315690	6256470	Open site	Partially Destroyed	Artefact : -, Potential Archaeological Deposit (PAD) : -		99538,102196, 104847
	Contact									
		Recorders		Doctor.Jo McDonald,EMM Consulting - Individual users,Curio Projects Pty Ltd,Mx.S.				Permits	1433,1682,2176,2240,2353,3049,3509,4662	
45-6-2756	Parramatta Rehabilitation Centre (formerly O'Connell St PAD)	GDA	56	314985	6257038	Open site	Valid	Potential Archaeological Deposit (PAD) : -, Artefact : -		102196,10378 2,105213,1054 51
	Contact									
		Recorders		Ms.Laila Haglund,Doctor.Alan (emm consulting) Williams,EMM Consulting - Indiv				Permits	2317,2414,2511,4797,5433	
45-6-2950	Macquarie St PAD 2	GDA	56	315835	6256410	Open site	Destroyed	Potential Archaeological Deposit (PAD) : -		102144,10378 2
	Contact									
		Recorders		Doctor.Jillian Comber,Comber Consultants Pty Limited				Permits	3238,3366	
45-5-4546	Parramatta Park - Location D	GDA	56	314555	6256864	Open site	Valid	Artefact : -		
	Contact									
		Recorders		Val Attenbrow				Permits		
45-6-3158	Robin Thomas Reserve	GDA	56	316100	6256300	Open site	Partially Destroyed	Aboriginal Resource and Gathering : -, Potential Archaeological Deposit (PAD) : -, Artefact : -		
	Contact									
		Recorders		Doctor.Jillian Comber,Extent Heritage Pty Ltd - Pyrmont - Individual users,Extent H				Permits	4439,5134,5138	
45-6-3157	Harris St Footpath	GDA	56	316013	6256461	Open site	Valid	Artefact : -		
	Contact									
		Recorders		Ms.Tory Stening				Permits	4439,4900,5134	

Report generated by AHIMS Web Service on 27/08/2025 for Katrina Eckford for the following area at Datum :GDA, Zone : 56, Eastings : 314440.0 - 316555.0, Northings : 6254988.0 - 6257043.0 with a Buffer of 0 meters.. Number of Aboriginal sites and Aboriginal objects found is 82

This information is not guaranteed to be free from error omission. Heritage NSW and its employees disclaim liability for any act done or omission made on the information and consequences of such acts or omission.

Page 2 of 8



AHIMS Web Services (AWS)

Extensive search - Site list report

Your Ref/PO Number : valentine av

Client Service ID : 1037630

SiteID	SiteName	Datum	Zone	Easting	Northing	Context	Site Status **	SiteFeatures	SiteTypes	Reports
45-6-3214	Wigram & Hassall St AS	GDA	56	315825	6256231	Open site	Valid	Artefact : 1, Potential Archaeological Deposit (PAD) : 1		105565
	Contact	Recorders	Extent Heritage Pty Ltd - Pyrmont - Individual users,Mr.Alistair Hobbs						Permits	4043,5138
45-6-4110	Knapping Demonstration (Queens Wharf Reserve)	GDA	56	316305	6256431	Open site	Not a Site	Aboriginal Resource and Gathering : -		
	Contact	Recorders	Extent Heritage Pty Ltd - Pyrmont - Individual users,Extent Heritage Pty Ltd - Pyrm						Permits	
45-6-4156	81-83 George St PAD	GDA	56	315562	6256580	Open site	Valid	Potential Archaeological Deposit (PAD) : -		
	Contact	Recorders	Urbis Pty Ltd - Angel Place L8 123 Pitt Street,Mr.Owen Barrett						Permits	
45-6-3818	St Johns Cathedral Background Artefact Scatter	GDA	56	315165	6256458	Open site	Valid	Artefact : -		
	Contact	Recorders	Doctor.Alan (emm consulting) Williams,EMM Consulting - Individual users						Permits	4702
45-6-2678	SSP1 (formerly Smith Street PAD)	AGD	56	315330	6256150	Open site	Destroyed	Potential Archaeological Deposit (PAD) : -		99518,102196, 103782
	Contact	Recorders	Doctor.Jo McDonald						Permits	1848,2561
45-6-2893	95-101 George St (GSP AD)	GDA	56	315720	6256570	Open site	Valid	Potential Archaeological Deposit (PAD) : -, Artefact : -		101078,10378 2
	Contact	Recorders	Megan Mebberson						Permits	3509
45-6-2977	Macquarie St PAD 3	GDA	56	315090	6256650	Open site	Valid	Potential Archaeological Deposit (PAD) : 1		105654
	Contact	Recorders	Comber Consultants Pty Limited,Mr.David Nutley						Permits	3509,4767
45-6-3068	GS PAD 1 184-188 George Street	GDA	56	315877	6256553	Open site	Destroyed	Potential Archaeological Deposit (PAD) : 1		103962,10528 7
	Contact	Recorders	Mr.Dominic Steele						Permits	3584
45-6-4053	87-91 George St PAD	GDA	56	315633	6256560	Open site	Valid	Potential Archaeological Deposit (PAD) : -		105254
	Contact	Recorders	Urbis Pty Ltd - Angel Place L8 123 Pitt Street,Mr.Owen Barrett						Permits	
45-6-2746	Old Hospital Site Parramatta Health Services Precinct	GDA	56	314950	6256650	Open site	Valid	Artefact : -, Potential Archaeological Deposit (PAD) : -		99798,100551, 100558,10219 6,103782
	Contact	Recorders	Ms.Laila Haglund,GML Heritage Pty Ltd - Surry Hills,Mr.Jacob (GML) Kiefel						Permits	2160,2507,5433
45-6-4080	Parramatta Transport Interchange PAD-01	GDA	56	315390	6256215	Open site	Valid	Potential Archaeological Deposit (PAD) : -		
	Contact	Recorders	Artefact Heritage and Environment - Pyrmont,Artefact Heritage and Environment -						Permits	5420

Report generated by AHIMS Web Service on 27/08/2025 for Katrina Eckford for the following area at Datum :GDA, Zone : 56, Eastings : 314440.0 - 316555.0, Northings : 6254988.0 - 6257043.0 with a Buffer of 0 meters.. Number of Aboriginal sites and Aboriginal objects found is 82

This information is not guaranteed to be free from error omission. Heritage NSW and its employees disclaim liability for any act done or omission made on the information and consequences of such acts or omission.

Page 3 of 8



AHIMS Web Services (AWS)

Extensive search - Site list report

Your Ref/PO Number : valentine av

Client Service ID : 1037630

SiteID	SiteName	Datum	Zone	Easting	Northing	Context	Site Status **	SiteFeatures	SiteTypes	Reports
45-6-3193	Riverbank Square PAD	GDA	56	315405	6256895	Open site	Valid	Potential Archaeological Deposit (PAD) : -		
	Contact	Recorders	Ms.Ngaire Richards							
45-6-3192	Riverbank Square	GDA	56	315376	6256898	Open site	Partially Destroyed	Potential Archaeological Deposit (PAD) : -		
	Contact	Recorders	Mr.Ashley O'Sullivan, Curio Projects Pty Ltd, Ms.Sarah McGuinness							
45-5-4942	Parramatta RSL Artefact Scatter 1 (PRSL AS-01)	GDA	56	314839	6256683	Open site	Destroyed	Artefact : -, Hearth : -		
	Contact	Recorders	Artefact Heritage and Environment - Pyrmont, Artefact Heritage and Environment -							
45-6-3801	APHS Stone and Glass Artefacts	GDA	56	315650	6256471	Open site	Partially Destroyed	Artefact : -, Hearth : -, Potential Archaeological Deposit (PAD) : -	4235,4949	104764
	Contact	Recorders	GML Heritage Pty Ltd - Surry Hills, GML Heritage Pty Ltd - Surry Hills, Doctor.Tim O							
45-6-2741	Parramatta Transport Interchange PAD	AGD	56	315450	6256250	Open site	Valid	Potential Archaeological Deposit (PAD) : -	4808	99438,99497,1 02196,103782, 104764,10565 4
	Contact	Recorders	Doctor.Susan (left ahms) McIntyre-Tamwoy							
45-6-2863	Cumberland Press Site	GDA	56	315913	6256448	Open site	Valid	Artefact : 89		103782
	Contact	Recorders	Ms.Laila Haglund, Ms.Tory Stening							
45-6-3102	Phillip Street PAD 1	GDA	56	315580	6256792	Open site	Valid	Potential Archaeological Deposit (PAD) : 1		105286
	Contact	Recorders	Mr.Dominic Steele							
45-6-4068	39-43 Hassall Street, Parramatta	GDA	56	315923	6256253	Open site	Valid	Artefact : -		
	Contact	Recorders	Comber Consultants Pty Limited, Ms.Agata Calabrese							
45-6-4161	Horwood Place IA 1	GDA	56	315379	6256701	Open site	Valid	Artefact : -		
	Contact	Recorders	Extent Heritage Pty Ltd - Pyrmont - Individual users, Ms.Sarah Janson							
45-6-4135	PARRAMATTA AS 1	GDA	56	315122	6256608	Open site	Valid	Artefact : -		
	Contact	Recorders	Austral Archaeology, Mrs.Felicity Smolenaers							
45-6-4136	PARRAMATTA ISO 2	GDA	56	315133	6256592	Open site	Valid	Artefact : -		
	Contact	Recorders	Austral Archaeology, Mrs.Felicity Smolenaers							
45-6-2739	PADUNKNOWN	AGD	56	314950	6256700	Open site	Valid	Potential Archaeological Deposit (PAD) : -		102196,10378 2
	Contact	Recorders	Haglund and Associates							

Report generated by AHIMS Web Service on 27/08/2025 for Katrina Eckford for the following area at Datum :GDA, Zone : 56, Eastings : 314440.0 - 316555.0, Northings : 6254988.0 - 6257043.0 with a Buffer of 0 meters.. Number of Aboriginal sites and Aboriginal objects found is 82

This information is not guaranteed to be free from error omission. Heritage NSW and its employees disclaim liability for any act done or omission made on the information and consequences of such acts or omission.

Page 4 of 8



AHIMS Web Services (AWS) Extensive search - Site list report

Your Ref/PO Number : valentine av

Client Service ID : 1037630

SiteID	SiteName	Datum	Zone	Easting	Northing	Context	Site Status **	SiteFeatures	SiteTypes	Reports
45-6-3495	116 Macquarie St Parramatta	GDA	56	315700	6256475	Open site	Valid	Potential Archaeological Deposit (PAD) : 1, Artefact : -		103782,10484 7
Contact		Recorders		Comber Consultants Pty Limited,Comber Consultants Pty Limited,Ms.Alandra Tasir		Permits		4607,4651,5138		
45-6-2669	Kendall Street, Harris Park	AGD	56	315525	6256150	Open site	Valid	Potential Archaeological Deposit (PAD) : -		102196,10378 2
Contact		Recorders		Jim Wheeler		Permits		1767		
45-6-2795	150 Marsden Street Parramatta PAD	AGD	56	314955	6256480	Open site	Valid	Potential Archaeological Deposit (PAD) : 1		102196,10378 2
Contact T Russell		Recorders		Austral Archaeology		Permits		2404		
45-5-4097	O'Connell St PAD1	GDA	56	314900	6256695	Open site	Valid	Potential Archaeological Deposit (PAD) : 1		
Contact		Recorders		Comber Consultants Pty Limited,Mr.David Nutley		Permits		3509		
45-5-4536	Parramatta Park - Location G	GDA	56	314504	6256700	Open site	Valid	Artefact : -		
Contact		Recorders		Val Attenbrow		Permits				
45-6-3895	PLR Macquarie St PAD	GDA	56	315787	6256398	Open site	Valid	Potential Archaeological Deposit (PAD) : -		
Contact		Recorders		GML Heritage Pty Ltd - Surry Hills,Doctor.Tim Owen		Permits		5138		
45-6-4114	Barrack Lane PAD	GDA	56	315519	6256509	Open site	Valid	Potential Archaeological Deposit (PAD) : -		
Contact		Recorders		GML Heritage Pty Ltd - Surry Hills,Mr.Jacob (GML) Kiefel		Permits				
45-6-2738	James Ruse Reserve Open Camp 1	AGD	56	316000	6256000	Open site	Valid	Potential Archaeological Deposit (PAD) : -		102196,10378 2
Contact		Recorders		Jim Wheeler		Permits		2018,2187		
45-6-2668	Argyle St	AGD	56	315200	6256060	Open site	Valid	Potential Archaeological Deposit (PAD) : -		102196,10378 2
Contact		Recorders		Doctor.Jo McDonald		Permits		1764,2155		
45-6-2976	George St PAD 1	GDA	56	315650	6256690	Open site	Valid	Potential Archaeological Deposit (PAD) : 1		105654
Contact		Recorders		Comber Consultants Pty Limited,Mr.David Nutley		Permits		3509,4766,4767,5138		

Report generated by AHIMS Web Service on 27/08/2025 for Katrina Eckford for the following area at Datum :GDA, Zone : 56, Eastings : 314440.0 - 316555.0, Northings : 6254988.0 - 6257043.0 with a Buffer of 0 meters.. Number of Aboriginal sites and Aboriginal objects found is 82

This information is not guaranteed to be free from error omission. Heritage NSW and its employees disclaim liability for any act done or omission made on the information and consequences of such acts or omission.

Page 5 of 8



AHIMS Web Services (AWS)

Extensive search - Site list report

Your Ref/PO Number : valentine av

Client Service ID : 1037630

SiteID	SiteName	Datum	Zone	Easting	Northing	Context	Site Status **	SiteFeatures	SiteTypes	Reports
45-6-3360	Parramatta Riverside AD 1	GDA	56	315172	6256924	Open site	Destroyed	Potential Archaeological Deposit (PAD) : -, Artefact : -		
	Contact	Recorders	Biosis Pty Ltd - Sydney,Biosis Pty Ltd - Wollongong,Biosis Pty Ltd - Wollongong,Mr. Permits							
45-6-3679	Stage One PAD	GDA	56	315454	6256795	Open site	Not a Site	Artefact : -, Potential Archaeological Deposit (PAD) : -	4250,4379	
	Contact	Recorders	Niche Environment and Heritage,Niche Environment and Heritage,Ms.Clare Anders Permits							
45-6-3992	PPS PAD 1	GDA	56	315168	6256871	Open site	Destroyed	Potential Archaeological Deposit (PAD) : -	4522	
	Contact	Recorders	Biosis Pty Ltd - Wollongong,Biosis Pty Ltd - Wollongong,Mrs.Samantha Keats,Mrs.S Permits							
45-6-3313	PLR AFT 2	GDA	56	316305	6256340	Open site	Valid	Artefact : -	4906	
	Contact	Recorders	Kelleher Nightingale Consulting Pty Ltd,Ms.Cristany Milicich Permits							
45-6-3767	85-97 Macquarie St	GDA	56	315235	6256513	Open site	Valid	Potential Archaeological Deposit (PAD) : -		
	Contact	Recorders	Comber Consultants Pty Limited,Ms.Tory Stening Permits							
45-6-3894	PLR Church St PAD and Artefacts	GDA	56	315241	6256871	Open site	Valid	Artefact : -, Potential Archaeological Deposit (PAD) : -	4627,4681	
	Contact	Recorders	GML Heritage Pty Ltd - Surry Hills,Doctor.Tim Owen Permits							
45-6-2751	Marsden St Carpark	AGD	56	314900	6256350	Open site	Valid	Artefact : -, Potential Archaeological Deposit (PAD) : -		102196,10378 2
	Contact	Recorders	Ms.Laila Haglund Permits							
45-6-3134	Lennox Bridge Car Park PAD	GDA	56	315209	6256970	Open site	Partially Destroyed	Potential Archaeological Deposit (PAD) : -	2243	105654
	Contact	Recorders	Miss.Felicity Barry Permits							
45-6-3582	Macquarie Street PAD	GDA	56	315306	6256602	Open site	Valid	Potential Archaeological Deposit (PAD) : -	3797,4094,4537,4767	
	Contact	Recorders	Miss.Alandra Tasire,Comber Consultants Pty Limited,Artefact Heritage and Enviror Permits							
45-6-3180	21 Hassall Street	GDA	56	315761	6256247	Open site	Partially Destroyed	Potential Archaeological Deposit (PAD) : 1		103758
	Contact	Recorders	Ms.Ngaire Richards Permits							
45-6-4048	Phillip St East PAD	GDA	56	315691	6256742	Open site	Valid	Potential Archaeological Deposit (PAD) : -	3906,3975,5138	

Report generated by AHIMS Web Service on 27/08/2025 for Katrina Eckford for the following area at Datum :GDA, Zone : 56, Eastings : 314440.0 - 316555.0, Northings : 6254988.0 - 6257043.0 with a Buffer of 0 meters.. Number of Aboriginal sites and Aboriginal objects found is 82

This information is not guaranteed to be free from error omission. Heritage NSW and its employees disclaim liability for any act done or omission made on the information and consequences of such acts or omission.

Page 6 of 8



AHIMS Web Services (AWS)

Extensive search - Site list report

Your Ref/PO Number : valentine av

Client Service ID : 1037630

SiteID	SiteName	Datum	Zone	Easting	Northing	Context	Site Status **	SiteFeatures	SiteTypes	Reports
	Contact	Recorders						Permits		
45-5-3186	Marsden Street	GDA	56	314800	6256315	Open site	Valid	Artefact : 4	4981	102196,103782
	Contact T Russell	Recorders						Permits		
45-6-3896	PLR George St PAD	GDA	56	316497	6256288	Open site	Valid	Potential Archaeological Deposit (PAD) : -		
	Contact	Recorders						Permits	4900	
45-6-4082	Hassall Street PAD	GDA	56	315913	6256328	Open site	Destroyed	Artefact : -, Potential Archaeological Deposit (PAD) : -		105706
	Contact	Recorders						Permits	5192,5298	
45-6-4133	PARRAMATTA ISO 1	GDA	56	315150	6256592	Open site	Valid	Artefact : -		
	Contact	Recorders						Permits		
45-6-2686	Civic Place PAD	GDA	56	315130	6256450	Open site	Partially Destroyed	Artefact : -, Potential Archaeological Deposit (PAD) : -		99666,99791,103115,103782,105448,105654
	Contact	Recorders						Permits	1960,3749,3890,3897,3983,3988,4044,4146	
45-6-3118	Clay Cliff Creek Levee	GDA	56	315801	6256294	Open site	Valid	Artefact : 1, Potential Archaeological Deposit (PAD) : 1		102992,102997,102998
	Contact	Recorders						Permits	3788	
45-5-4530	Parramatta RSL PAD	GDA	56	314810	6256690	Open site	Partially Destroyed	Artefact : -, Potential Archaeological Deposit (PAD) : -, Hearth : -		104179
	Contact	Recorders						Permits	3819,3853,3935,4364,5230	
45-6-2673	RTA-G1	GDA	56	315842	6256510	Open site	Valid	Artefact : -		100552,102196,103782
	Contact	Recorders						Permits	1841,2176,3050,3509,5138	
45-5-3434	Parramatta SWC PAD	GDA	56	315320	6256325	Open site	Valid	Potential Archaeological Deposit (PAD) : 1		
	Contact	Recorders						Permits	2965,2966	
45-6-3124	330 Church St Artefact Scatter	GDA	56	315330	6256965	Open site	Valid	Artefact : -, Potential Archaeological Deposit (PAD) : -		
	Contact	Recorders						Permits		
45-6-3702	Smith St PAD1	GDA	56	315480	6256713	Open site	Destroyed	Artefact : -, Potential Archaeological Deposit (PAD) : 1		

Report generated by AHIMS Web Service on 27/08/2025 for Katrina Eckford for the following area at Datum :GDA, Zone : 56, Eastings : 314440.0 - 316555.0, Northings : 6254988.0 - 6257043.0 with a Buffer of 0 meters.. Number of Aboriginal sites and Aboriginal objects found is 82

This information is not guaranteed to be free from error omission. Heritage NSW and its employees disclaim liability for any act done or omission made on the information and consequences of such acts or omission.

Page 7 of 8



AHIMS Web Services (AWS)

Extensive search - Site list report

Your Ref/PO Number : valentine av

Client Service ID : 1037630

SiteID	SiteName	Datum	Zone	Easting	Northing	Context	Site Status **	SiteFeatures	SiteTypes	Reports
	<u>Contact</u>	<u>Recorders</u>	Comber Consultants Pty Limited,Comber Consultants Pty Limited,Ms.Jillian Combe					<u>Permits</u>	4513,4756	
45-6-2627	HP-1	AGD	56	315850	6255210	Open site	Valid	Artefact : -		102196
	<u>Contact</u>	<u>Recorders</u>	Mick Leon					<u>Permits</u>		
45-6-3312	PLR AFT 1	GDA	56	316105	6256465	Open site	Destroyed	Artefact : -		
	<u>Contact</u>	<u>Recorders</u>	Extent Heritage Pty Ltd - Pyrmont - Individual users,Kelleher Nightingale Consultir					<u>Permits</u>		
45-6-3897	PLR RTR Artefacts and PAD	GDA	56	316017	6256441	Open site	Valid	Artefact : -, Potential Archaeological Deposit (PAD) : -		
	<u>Contact</u>	<u>Recorders</u>	GML Heritage Pty Ltd - Surry Hills,Doctor,Tim Owen					<u>Permits</u>		
45-6-4094	QWR PAD 1	GDA	56	316229	6256439	Open site	Partially Destroyed	Artefact : -, Potential Archaeological Deposit (PAD) : -		
	<u>Contact</u>	<u>Recorders</u>	Extent Heritage Pty Ltd - Pyrmont - Individual users,Extent Heritage Pty Ltd - Pyrm					<u>Permits</u>	5105	
45-5-5952	George Street Gatehouse	GDA	56	314904	6256833	Open site	Valid	Artefact : -, Hearth : -, Potential Archaeological Deposit (PAD) : -		
	<u>Contact</u>	<u>Recorders</u>	GML Heritage Pty Ltd - Surry Hills,Doctor,Tim Owen					<u>Permits</u>		

** Site Status

Valid - The site has been recorded and accepted onto the system as valid

Destroyed - The site has been completely impacted or harmed usually as consequence of permit activity but sometimes also after natural events. There is nothing left of the site on the ground but proponents should proceed with caution.

Partially Destroyed - The site has been only partially impacted or harmed usually as consequence of permit activity but sometimes also after natural events. There might be parts or sections of the original site still present on the ground

Not a site - The site has been originally entered and accepted onto AHIMS as a valid site but after further investigations it was decided it is NOT an aboriginal site. Impact of this type of site does not require permit but Heritage NSW should be notified

Report generated by AHIMS Web Service on 27/08/2025 for Katrina Eckford for the following area at Datum :GDA, Zone : 56, Eastings : 314440.0 - 316555.0, Northings : 6254988.0 - 6257043.0 with a Buffer of 0 meters.. Number of Aboriginal sites and Aboriginal objects found is 82

This information is not guaranteed to be free from error omission. Heritage NSW and its employees disclaim liability for any act done or omission made on the information and consequences of such acts or omission.

Page 8 of 8