


West Muswellbrook Project

Gateway Application Supporting Document Appendix C





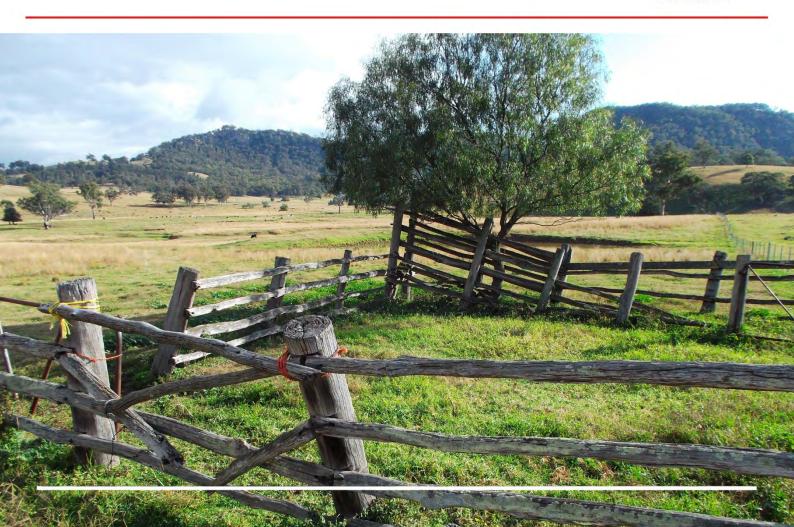

Australasian Groundwater and Environmental Consultants Pty Ltd (AGE)



Appendices to the Report on

West Muswellbrook Project Gateway Application

Highly Productive Aquifer Groundwater Impact Assessment

Prepared for
Muswellbrook Coal Company Limited

Project No. G1676 November 2014 www.ageconsultants.com.au ABN 64 080 238 642

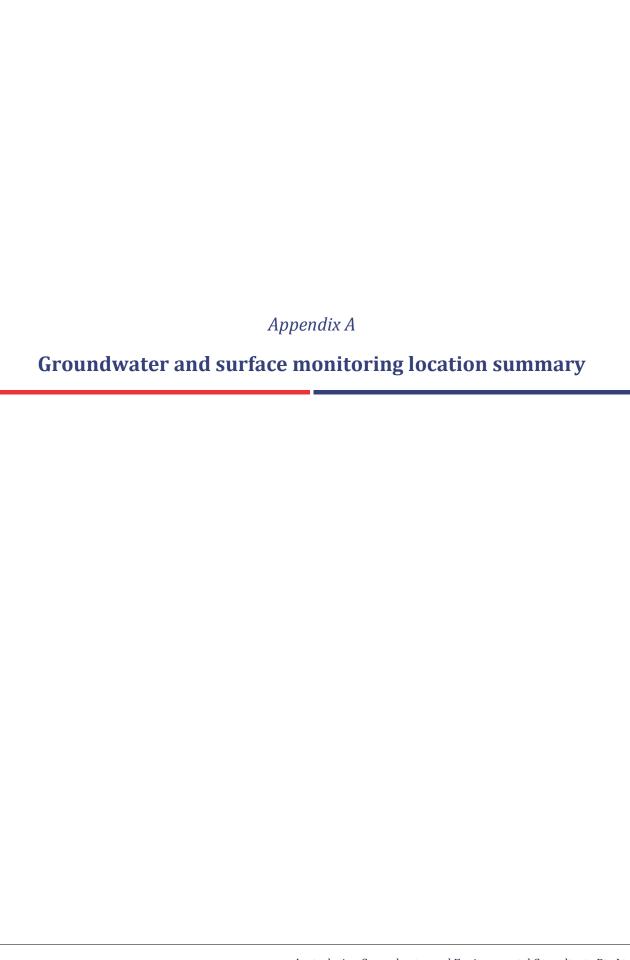


 Table A-1
 Project water monitoring locations

| Bore ID | Easting (MGA 56) | Northing (MGA 56) | Ground Level mAHD survey | Ground Level from DEM mAHD | Stick Up (m) | Date Completed | Bore Desc. | Depth of drill hole (mBGL) | Dia. of Casing (mm) | Base of bore - mBGL | Top of Screen mBGL | Bottom Screen mBGL | Target Formation | Single GWL data year | Temporal GWL data year range | Field WQ Data (Y/N) | Once yearly lab. WQ analysis |
|-----------|---------------------|----------------------|-----------------------------------|-------------------------------------|--------------------|-------------------|----------------|-------------------------------------|---------------------------|------------------------------|--------------------------|--------------------------|-------------------------------|-------------------------------|------------------------------------|------------------------|------------------------------------|
| CRDDH14 | 286849.20 | 6424724.40 | 149.5 | 149.9 | 1.00 | 24/01/2000 | GW mon | 30.5 | 50 | 30.5 | 19.5 | 25.2 | Blakefield | 2000 | No | No | No |
| CRRDH22 | 288971.20 | 6429468.90 | 210.0 | 208.8 | 1.50 | 15/02/2000 | GW mon | 67.85 | 50 | 67.85 | 57.85 | 63.85 | Blakefield / Glen Munro | 2000 | No | No | No |
| CRRDH52 | 291701.57 | 6434009.73 | 237.6 | 238.5 | 1.21 | 14/05/2002 | GW mon | 37 | 50 | 16.76 | 31 | 37 | Heat altered coal | | 2003 to 2011 | 2003 to 2011 | 2011 |
| CRRDH67 | 290912.40 | 6433195.40 | 208.0 | 208.2 | 1.50 | 14/05/2002 | GW mon | 36.5 | 50 | 36.5 | 2.5 | 6 | Blakefield / Glen Munro | 2002 | No | No | No |
| CRLDH97 | 291130.90 | 6433832.80 | 224.1 | 224.6 | 1.00 | 15/11/2004 | GW mon | 30.88 | 125 | 30.88 | 24.88 | 30.88 | Blakefield / Glen Munro | 2004 | No | No | No |
| CRRDH105 | 290674.30 | 6432864.43 | 204.0 | 203.5 | 2.12 | 11/03/2005 | GW & SW mon | 5.8 | 50 | 7.9 | 2.8 | 5.8 | Alluvium Sandy Creek South | | 2004 to 2014 | 2006 to 2013 | No |
| CRRDH106 | 290009.14 | 6433457.19 | 213.0 | 215.3 | 2.05 | 11/03/2005 | GW & SW mon | 4.7 | 50 | 4.6 | 2.7 | 4.7 | Alluvium Sandy Creek South | | 2004 to 2014 | 2006 to 2013 | No |
| CRRDH107 | 290870.20 | 6432412.80 | 201.8 | 198.1 | 1.50 | 12/03/2005 | GW & SW mon | 5.82 | 50 | 5.82 | 2.82 | 5.82 | Alluvium Sandy Creek South | | 2007 to 2014 | 2006 to 2013 | No |
| CRLDH108R | 289754.20 | 6434186.50 | 225.3 | 225.8 | 0.40 | 30/04/2006 | GW mon | 127.4 | 150 | 18.3 | 12.3 | 18.3 | Wambo | 2013 | No | No | No |
| CRRDH109 | 290352.46 | 6432094.78 | 200.6 | 200.5 | 0.60 | 12/05/2006 | GW mon | 31 | 150 | 31 | 13 | 31 | Blakefield / Glen Munro | 2009 | No | No | No |
| RHDDH4 | 291783 | 6436624 | 257.2 | | 0.92 | 24/03/1998 | GW mon | 84 | 50 | 40 | | | Blakefield Seam | | 2000 to 2014 | 2000 to 2014 | 2011, 2012 & 2013 |
| RHDDH20 | 293115.37 | 6439916.10 | 240.3 | 241.0 | 0.76 | 24/09/1998 | GW mon | 45.73 | 50 | 46.76 | 35.9 | 45.7 | Blakefield / Glen Munro | | 2000 to 2014 | 2000 to 2014 | 2011, 2012 & 2013 |

| Bore ID | Easting (MGA 56) | Northing (MGA 56) | Ground Level mAHD survey | Ground Level from DEM mAHD | Stick Up (m) | Date Completed | Bore Desc. | Depth of drill hole (mBGL) | Dia. of Casing (mm) | Base of bore - mBGL | Top of Screen mBGL | Bottom Screen mBGL | Target Formation | Single GWL data year | Temporal GWL data year range | Field WQ Data (Y/N) | Once yearly lab. WQ analysis |
|----------|---------------------|----------------------|-----------------------------------|-------------------------------------|--------------------|-------------------|----------------|-------------------------------------|---------------------------|------------------------------|--------------------------|--------------------------|--------------------------------------|-------------------------------|------------------------------------|------------------------|------------------------------------|
| RHDDH27 | 291291.04 | 6434348.03 | 244.0 | 245.2 | | 3/11/1998 | GW mon | 62.01 | 50 | 62.01 | 54.5 | 60.5 | Blakefield / Glen Munro | | 2003 to 2011 | 2003 to 2011 | 2001 |
| RHRDH78 | 292236.70 | 6438025.90 | 219.4 | 220.0 | 1.50 | 4/04/2002 | GW mon | 54 | 50 | 7.6 | 3.6 | 7.6 | Alluvium Sandy Creek North | 2002 | No | No | No |
| RHRDH79 | 292516.70 | 6438469.50 | 214.0 | 214.5 | 1.50 | 4/04/2002 | GW mon | 24.72 | 50 | 6.15 | 2.65 | 6.15 | Alluvium Sandy Creek North | 2002 | No | No | No |
| RHRDH211 | 292437.20 | 6437962.70 | 214.1 | 215.8 | 1.50 | 6/05/2005 | GW & SW mon | 5.2 | 50 | 5.2 | 2.2 | 5.2 | Alluvium Sandy Creek North | | 2005 -2014 | 2006 -2013 | No |
| RHRDH212 | 293426.10 | 6438850.10 | 201.7 | 202.6 | 1.50 | 6/05/2005 | GW & SW mon | 5.12 | 50 | 5.12 | 2.12 | 5.12 | Alluvium Sandy Creek North | | 2007 -2014 | 2006 -2013 | No |
| RHRDH213 | 291214.52 | 6438080.75 | 231.4 | 232.3 | 1.50 | 9/07/2005 | GW & SW mon | 3.21 | 50 | 3.21 | 1.21 | 3.21 | Alluvium Sandy Creek North | | 2007 - 2009 | 2007 | No |
| DAY1 | 292850.35 | 6441989.50 | 246.0 | 240.6 | 0.49 | | production | | 135 | | | | Permian Abbey Green | | 2003 -2011 | 2003 -2011 | 2012 & 2013 |
| GDAY1 | 290818.30 | 6438405.69 | 237.6 | | 1.12 | | production | | | 5.67 | | | Colluvium Sandy Creek North | | 2003 -2014 | 2003 -2014 | 2011, 2012 & 2013 |
| JLON1 | 292403.50 | 6434331.87 | 259.2 | 272.9 | 0.00 | 1/09/1965 | production | 57.9 | 127 | | | | 50m below Blakefield (Permian) | | 2000 -2014 | 2003 -2014 | 2011, 2012 & 2013 |
| JLON2 | 292318.84 | 6434390.91 | 252.1 | 253.1 | 0.60 | 1/09/1965 | production | 39.6 | 127 | 29.48 | | | 30m below Blakefield (Permian) | | 1965 -2014 | 2003 -2014 | 2011, 2012 & 2013 |
| PIT1 | 291243.59 | 6437765.25 | 230.1 | 227.7 | 0.27 | | production | | | 6 | | | Alluvium Sandy Creek North | | 2003 -2014 | 2003 - 2014 | 2011, 2012 & 2013 |

| Bore ID | Easting (MGA 56) | Northing (MGA 56) | Ground Level mAHD survey | Ground Level from DEM mAHD | Stick Up (m) | Date Completed | Bore Desc. | Depth of drill hole (mBGL) | Dia. of Casing (mm) | Base of bore - mBGL | Top of Screen mBGL | Bottom Screen mBGL | Target Formation | Single GWL data year | Temporal GWL data year range | Field WQ Data (Y/N) | Once yearly lab. WQ analysis |
|---------|---------------------|----------------------|-----------------------------------|-------------------------------------|--------------------|-------------------|---------------|-------------------------------------|---------------------------|------------------------------|--------------------------|--------------------------|-------------------------------|-------------------------------|------------------------------------|------------------------|------------------------------------|
| PIT2 | 291337.60 | 6437735.42 | 229.6 | 226.8 | 0.00 | | production | | | 4 | | | Alluvium Sandy Creek North | | 2003 -2014 | 2003 -2014 | 2011, 2012 & 2013 |
| SPAR2 | 289994.50 | 6433497.99 | 217.4 | 216.0 | 0.48 | | production | | | | | | Alluvium Coal Creek | | 2003 -2011 | 2003 -2011 | 2011 |
| SPAR4 | 290210.33 | 6433732.92 | 215.2 | 225.1 | 0.46 | | production | 24.89 | 150 | 3.78 | | | Alluvium Coal Creek | | 2003 - 2011 | 2003 -2011 | 2011 |
| SPAR5 | 289875.92 | 6433546.68 | 217.1 | 218.8 | 0.08 | | production | | | 3.95 | | | Alluvium Coal Creek | | 2003 - 2011 | 2003 - 2011 | 2011 |
| WEK2 | 288753.59 | 6434415.55 | | 241.8 | | | production | | | | | | Alluvium Coal Creek | | 2003 -2006 | 2003 - 2006 | No |
| WYL1 | 291169.47 | 6438494.78 | 243.8 | 248.1 | 0.00 | | production | 24.4 | | 15.7 | | | Colluvium | | 1957 - 2014 | 2003 -2010 | No |
| YOU1 | 288149.59 | 6434786.27 | 250.4 | 269.4 | 0.67 | | production | | | 2 | | | Alluvium Coal Creek | | 2003 - 2014 | 2003 -2014 | 2011, 2012 & 2013 |


Table A-2 Selected bores outside the PAA

| Bore ID | Easting MGA 56 | Northing MGA 56 | Ground Level mAHD survey | Ground Level from DEM mAHD | Date Drilled | Depth of drill hole mBGL | Dia. of Casing mm | Target Formation (Alluvium / Permian Coal Seam) | Temporal GWL data (year range) |
|-------------------|-------------------|--------------------|-----------------------------------|--|-----------------|-----------------------------------|-------------------------|---|---|
| BRO3 ¹ | 296022 | 6439457 | 180.0 | 182.9 | | | | Shallow regolith | 1998 - 2013 |
| CAD2 ¹ | 294132 | 6439790 | 200.1 | 198.6 | | | | Shallow regolith | 1998 - 2013 |
| COR3 ¹ | 293689 | 6439180 | 199.6 | 200.3 | | | | Alluvium Sandy Creek North | 1998 -2013 |
| WM3 ¹ | 294773 | 6439840 | 191.7 | 190.0 | | 3 | | Alluvium Sandy Creek North | 1999 - 2014 |
| GW012975* | 297328 | 6440165 | | 172.6 | 1948 | 10.7 | 1219 | Alluvium Sandy Creek North | 1953 - 1956 |
| GW013113* | 294164 | 6439793 | | 198.3 | 1957 | 30.8 | 152 | Regolith | 1957 -2003 |
| GW027311* | 292056 | 6422787 | | 129.1 | 1967 | 11.6 | 1829 | Alluvium Hunter River | 2004 - 2006 |
| GW032886* | 293026 | 6450647 | | 227.7 | 1970 | 32.9 | 152 | Assumed Abbey Green | 1970 - 2003 |
| GW032887* | 293602 | 6449839 | | 219.1 | 1970 | 37.2 | 152 | Wambo assumed based on depth | 1970 -2008 |
| GW037397* | 294914 | 6448097 | | 191.0 | 1972 | 11.9 | 1371 | Alluvium | 20002 |
| GW040500* | 297419 | 6442201 | | 173.6 | | 12.3 | 1829 | Alluvium Dartbrook | 1967 - 2000 |
| GW040509* | 297473 | 6440784 | | 172.9 | | 11.8 | 1219 | Assume to be Permina regolith no depth | 1953 - 1993 |
| GW044912* | 293000 | 6428769 | | 221.5 | | 15.5 | 152 | Regolith | 1975 - 1993 |
| GW053572* | 291651 | 6423266 | | 127.4 | 1981 | 10.5 | 1200 | Alluvium Hunter River | 2001 - 2004 |
| GW061636* | 291981 | 6426129 | | 199.1 | 1986 | 42.7 | 150 | Below Blakefield/above Warkworth | 1986 - 1993 |
| GW067260* | 297560 | 6443888 | | 175.8 | | 11.2 | | Alluvium | 2006 - 2008 |
| GW080074* | 298120 | 6447511 | 185.4 | 187.0 | | 18 | | Alluvium (presumed from depth) | 20142 |
| GW080433* | 296333 | 6445791 | 181.3 | 182.7 | 2003 | 14.2 | 203 | Alluvium Dart Brook (presumed from depth) | 2003 - 2014 |
| GW080909* | 287363 | 6425117 | | 142.8 | 2004 | 2.66 | 0 | Alluvium Sandy Creek South | 20042 |

Note: *NOW PINEENA database 2013, ¹AngloAmerican (2013); ² single record only.

 Table A-3
 Surface water monitoring sites

| | 10.010110 | | | | | | | |
|---------|-------------------|--------------------|--------------------|---|--|--|--|--|
| Site ID | Easting MGA 56 | Northing MGA 56 | Elevation m AHD | Stream/ River | Comment on the site AGE June 2014 survey | | | |
| CRK1 | 289184 | 6428133 | 161.9819 | Sandy Creek South | Perennial flow - stream 8 - 10m width underneath a main bridge flow observed between larger permanent pools. | | | |
| CRK4 | 288155 | 6434860 | 254.8614 | Coal Creek | Headwaters - surface sampling point at concrete river crossing close to the escarpment pools were low salilnity but not flowing. | | | |
| DAR2 | 297683 | 6441584 | 166.4066 | Dartbrook | Sample point under bridge, flows only in heavy rain. Dry at the time of site visit. | | | |
| ROS1 | 294126 | 6439695 | 196.4616 | Sandy Creek North | Minor tributary of Sandy Creek North. Dry only flows from large rain events. | | | |
| ROS11 | 290780 | 6434457 | 222.0585 | Sandy Creek South | Sampling point at bridge. Upper Sandy Creek South with alluvial flats and no permanent water noticeable. Only flows during rain events, dry June 2014. | | | |
| ROS2 | 291097 | 6438131 | 232.6574 | Sandy Creek North | Sandy Creek North crossing on gravel flat gravel road with adjacent raised alluvial flats. Ephemeral, appears to flow only in heavy rain events. | | | |
| SCK1 | 287371 | 6427973 | 164.0588 | Spring Creek | Adjacent bridge on Wybong Road permanent pools with no observable flow but would appear to readily flow with minimal input. | | | |
| SCK2 | 286922 | 6423782 | 134.9469 | Sandy Creek South | Road crossing with flow of water between permanent pools of water furthest south point sampled point. Water depth $0.3\mathrm{m}$ June 2014. | | | |
| BRA2 | 294928 | 6442979 | 197.8337 | Dam | A stock dam 3km north of Sandy Creek North. Turbid waters from cattle. | | | |
| DAN1 | 292946 | 6440242 | 231.9133 | Dam | Stock dam adjacent VAL1. Larger body of water. | | | |
| HUT1 | 288190 | 6434682 | | Coal Creek | Dam – not visited during AGE 2014 survey. | | | |
| HUT2 | 288233 | 6434605 | | Coal Creek | Dam – not visited during AGE 2014 survey. | | | |
| HUT3 | | | | Coal Creek | Dam – not visited during AGE 2014 survey. | | | |
| VAL1 | 292996 | 6440297 | 227.3515 | Dam | A smaller stock dam than the adjacent DAN1. | | | |
| SPAR3 | 291440 | 6433548 | 220.8879 | Well - alluvium of upper part of tributary into Sandy Creek North | Old well with beams covering the excavation. Very dilapidated and has dam nearby. | | | |

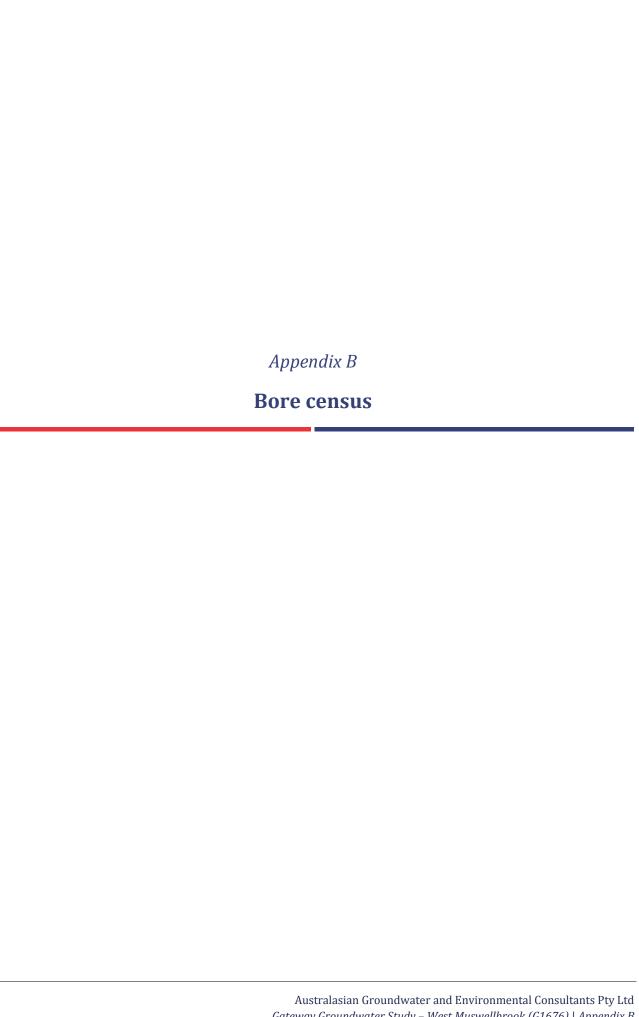

| Property / Landho | lder: | Bruce Anthony | Day | | | | | | |
|------------------------------|------------------|---|--------------------|-----------------------|-------------------|--|--|--|--|
| Bore name | DAY1 | Cad. Lot No: | 1 | Cad. Plan No: | DP416437 | | | | |
| Easting: | 292849.6 | Northing: | 6441988.7 | Elevation: | 246.5 | | | | |
| Bore located behir | nd metal shed, | next to a small wa | iter storage pond | , approx. 800 m sou | uth of the | | | | |
| unsealed road. | | | | | | | | | |
| Bore construction | • | | | | | | | | |
| Bore diameter: | | 20 cm (outer) | | | | | | | |
| Casing: Black PVC, 1cm thick | | | | | | | | | |
| Bore equipment / | use: | | | | | | | | |
| Bore use: | | Functional, in u | ise, pumping to a | djacent water tank | located directly | | | | |
| | | behind the she | d (not the tank no | ext to bore). Stock - | - approx 40 heads | | | | |
| | | of cattle | | | | | | | |
| Bore equipment: | | Windmill (non-functioning), petrol pump (behind the water tank) | | | | | | | |
| Water level measu | urement: | | | | | | | | |
| Reference point ele | evation: | 0.48 m | | | | | | | |
| Reference point de | | Top of the black PVC casing | | | | | | | |
| Measured depth to | water: | n/a | n/a | | | | | | |
| GWL elevation: | | n/a | | | | | | | |
| GWL not measured | d, advised agaiı | nst by previous sa | mplers (Carbon B | ased Environmenta | l) due to | | | | |
| equipment loss in | bore. | | | | | | | | |
| Water quality mea | asurement: | T | | | | | | | |
| Temperature (°C) | | 11.8 | | | | | | | |
| рН | | 6.8 | | | | | | | |
| ORP (mV) | | 251 | | | | | | | |
| EC (μS/cm) | | | | | | | | | |
| TDS (mg/l) | | 535 | | | | | | | |
| Sampled from tank | k behind metal | shed | | | | | | | |
| Date: | | 30/6/2014 | | | | | | | |
| Time: | | 8:50 | | | | | | | |





| Property / Landho | older: | Rob Gordon | | | | | | | | |
|----------------------|-------------------|---|-------------------|--------------------|-----------------|--|--|--|--|--|
| Bore name | GW079026 | Cad. Lot No: | 177 | Cad. Plan No: | DP750951 | | | | | |
| Easting: | 295055.8 | Northing: | 6440427.0 | Elevation: | 189.6 | | | | | |
| Bore construction | : | | | | | | | | | |
| Bore diameter: | | 20 mm (outer) | | | | | | | | |
| Casing: | S | Steel | | | | | | | | |
| Bore equipment / | use: | | | | | | | | | |
| Bore use: | n | unctional, in use, ext to bore. Tank tock – approx 60 | cracked, leaking. | cent concrete wate | r tank located | | | | | |
| Bore equipment: | V | Windmill – functioning | | | | | | | | |
| Water level meas | urement: | | | | | | | | | |
| Reference point el | evation: 0 | .19 m | | | | | | | | |
| Reference point de | escription: n | n/a | | | | | | | | |
| Measured depth to | <i>o water:</i> n | n/a | | | | | | | | |
| GWL elevation: | n | n/a | | | | | | | | |
| safely accessible to | o sample. | not able to take (| GWL reading or sa | ample bore. Water | in the tank not | | | | | |
| Water quality me | | | | | | | | | | |
| Temperature (°C) | | /a | | | | | | | | |
| рН | | n/a | | | | | | | | |
| ORP (mV) | | /a | | | | | | | | |
| EC (μS/cm) | | n/a | | | | | | | | |
| TDS (mg/l) | n | n/a | | | | | | | | |
| Date: | 3 | 30/6/2014 | | | | | | | | |
| Time: | 9 | 9:50 | | | | | | | | |





| Property / Landho | lder: | Rob Gordon | | | | | | | | | |
|---------------------|----------|---|------------------|--------------------------------------|---------------------------------------|--|--|--|--|--|--|
| Bore name | GW079025 | Cad. Lot No: | 177 | Cad. Plan No: | DP750951 | | | | | | |
| Easting: | 295498.5 | Northing: | 6440472.9 | Elevation: | 182.0 | | | | | | |
| | | | | | | | | | | | |
| Bore construction | • | | | | | | | | | | |
| Bore diameter: | | 140 mm | | | | | | | | | |
| Casing: | | steel, rusty | | | | | | | | | |
| Bore depth: | | · · | | of possible equipm because of pump i | · · · · · · · · · · · · · · · · · · · | | | | | | |
| Bore equipment / | use: | | | | | | | | | | |
| Bore use: | | unctional, in use, | pumping to adjac | cent concrete wate | r tank and | | | | | | |
| | | roughs. Stock. | | | | | | | | | |
| Bore equipment: | , | Windmill (non-functioning), electric pump (Onga, 220V, timer) | | | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| Water level measu | | | | | | | | | | | |
| Reference point ele | | approx 0.4 m | | | | | | | | | |
| Reference point de | | Edge of steel casing | | | | | | | | | |
| Measured depth to | | n/a | | | | | | | | | |
| GWL elevation: | | n/a | | | | | | | | | |
| GWL not measured | | g inaccessible bec | ause of the pump | installation | | | | | | | |
| Water quality mea | | | | | | | | | | | |
| Temperature (°C) | | 11.5 | | | | | | | | | |
| рН | | 7.4 | | | | | | | | | |
| ORP (mg/l) | | 301 | | | | | | | | | |
| EC (μS/cm) | | 1498 | | | | | | | | | |
| TDS (mg/l) | | 1035 | | | | | | | | | |
| | | trough at location of pump outlet (pump running) | | | | | | | | | |
| Date: | | 30/6/2014 | | | | | | | | | |
| Time: | | 10:20 | | | | | | | | | |





| Property / Landi | nolder: | Wilcrow Pty Ltd | | | | | | | |
|--------------------|-------------------|---|-------------------|--------------------|-----------|--|--|--|--|
| Bore name | WILCROW1 | Cad. Lot No: | 16 | Cad. Plan No: | DP750931 | | | | |
| Easting: | 290912.9 | Northing: | 6438672.7 | Elevation: | 243.9 | | | | |
| Bore located in t | he middle of pad | dock, approximat | ely 300 m west fr | om Halls Rd, Sandy | Crk North | | | | |
| alluvial flat. | | | | | | | | | |
| Bore construction | n: | | | | | | | | |
| Bore diameter: | | 140 mm | | | | | | | |
| Casing: | | 10 steel | | | | | | | |
| Bore depth: | | 8.3 m | | | | | | | |
| Bore equipment | / use: | | | | | | | | |
| Bore use: | | abandoned, bore opened to elements (no cap) | | | | | | | |
| Bore equipment: | | none – formerly probably windmill | | | | | | | |
| Water level mea | surement: | | | | | | | | |
| Reference point of | elevation (m): | 0.325 | | | | | | | |
| Reference point of | description: | Edge of steel casing | | | | | | | |
| Measured depth | to water (m): | 5.83 | | | | | | | |
| GWL elevation (r | n RL): | 238.36 | | | | | | | |
| | | | | | | | | | |
| Water quality m | easurement: | | | | | | | | |
| Temperature (°C, |) | 19.2 | | | | | | | |
| рН | | 8.3 | | | | | | | |
| ORP (mV) | | 207 | | | | | | | |
| EC (μS/cm) | | | | | | | | | |
| TDS (mg/l) | | 1947 | | | | | | | |
| Balier used to ob | tain water qualit | y sample (3 rd baile | er) | | | | | | |
| Date: | | 30/6/2014 | | | | | | | |
| Time: | | 11:15 | | | | | | | |





| Property / Landho | lder: | Wilcrow Pty Ltd | | | | | | | |
|---------------------|---------------------------------------|-----------------------------------|--------------------|-------------------|--------------------|--|--|--|--|
| Bore name | GW023103 | Cad. Lot No: | 28 | Cad. Plan No: | DP750931 | | | | |
| Easting: | 290850.9 | Northing: | 6438997.4 | Elevation: | 247.0 | | | | |
| South western corr | ner of the prop | erty, approximat | ely 550 m west fro | m Halls Rd, Sandy | Crk North alluvial | | | | |
| flat. | | | | | | | | | |
| Bore construction: | 1 | | | | | | | | |
| Bore diameter: | | 140 mm | | | | | | | |
| Casing: | | 10 steel | | | | | | | |
| Bore depth: | | n/a | | | | | | | |
| Bore equipment / | use: | | | | | | | | |
| Bore use: | | abandoned, filled up (concrete?) | | | | | | | |
| Bore equipment: | | none – formerly probably windmill | | | | | | | |
| Water level measu | rement: | | | | | | | | |
| Reference point ele | evation (m): | 0.86 | | | | | | | |
| Reference point de | scription: | edge of steel casing | | | | | | | |
| Measured depth to | water (m): | n/a | | | | | | | |
| GWL elevation (m l | RL): | n/a | | | | | | | |
| | | | | | | | | | |
| Water quality mea | surement: | | | | | | | | |
| Temperature (°C) | | n/a | | | | | | | |
| рH | | n/a | | | | | | | |
| ORP (mV) | | n/a | | | | | | | |
| EC (μS/cm) n/a | | | | | | | | | |
| TDS (mg/l) | | n/a | | | | | | | |
| | · · · · · · · · · · · · · · · · · · · | | | | · | | | | |
| Date: | | 30/6/2014 | | | | | | | |
| Time: | | 11:25 | | | | | | | |





TUR3 not found – destroyed?

| Property / Landho | lder: | Darryl Len Caddey, Phillip Caddey | | | | | | | |
|--|--------------|-----------------------------------|------------------|----------------|---------------|----------|--|--|--|
| Bore name | CAD2, MAF | RYVALE | Cad. Lot No: | 178 | Cad. Plan No: | DP750951 | | | |
| Easting: | 294131.8 | | Northing: | 6439790.2 | Elevation: | 200.1 | | | |
| Approximately 40 | m north from | n Halls Ro | d., shallow rego | lith bore. | | | | | |
| Bore construction: | 1 | | | | | | | | |
| Bore diameter: | | 160 mr | n | | | | | | |
| Casing: | | Steel | | | | | | | |
| Bore depth: | | 14.36 r | n | | | | | | |
| Bore equipment / | use: | | | | | | | | |
| Bore use: | | bore no | ot used, formerl | y water supply | for cattle | | | | |
| Bore equipment: | | windmill | | | | | | | |
| Water level measu | rement: | | | | | | | | |
| Reference point ele | evation: | 0.25 m | | | | | | | |
| Reference point de | scription: | top of steel casing | | | | | | | |
| Measured depth to | water: | 11.67 | | | | | | | |
| GWL elevation: | | 188.66 | | | | | | | |
| Water quality mea | surement: | | | | | | | | |
| Temperature (°C) | | 18.1 | | | | | | | |
| рН | | 6.6 | | | | | | | |
| ORP (mV) | | -97 | | | | | | | |
| EC (μS/cm) | | 4264 | | | | | | | |
| TDS (mg/l) | | 3139 | | | | | | | |
| Sampled using bailer (3 rd bailer volum | | | | | | | | | |
| Date: | 30/6/2014 | | | | | | | | |
| Time: | 13:00 | | | | | | | | |





| Property / Landho | lder: | Graeme Carl Sparre | | | | | | | | |
|---------------------|----------------|--------------------------------|--------------|-----------|---------------|---------|--|--|--|--|
| Bore name | CRRDH109 | | Cad. Lot No: | 4 | Cad. Plan No: | DP21335 | | | | |
| Easting: | 290352.5 | | Northing: | 6432094.8 | Elevation: | 200.6 | | | | |
| Source aquifer 'bui | rnt rock'. | | | | | | | | | |
| Bore construction: | • | | | | | | | | | |
| Bore diameter: | | 140 mm | | | | | | | | |
| Casing: | PVC – v | vhite | | | | | | | | |
| Bore depth: | | n/a | | | | | | | | |
| Bore equipment / | use: | | | | | | | | | |
| Bore use: | | bore in | use – stock | | | | | | | |
| Bore equipment: | | pump - petrol | | | | | | | | |
| Water level measu | ırement: | | | | | | | | | |
| Reference point ele | evation: | n/a | | | | | | | | |
| Reference point de | scription: | top of PVC casing | | | | | | | | |
| Measured depth to | water: | n/a | | | | | | | | |
| GWL elevation: | | n/a | | | | | | | | |
| Not measured – pu | ımp installed | d and bore opening is covered. | | | | | | | | |
| Water quality mea | surement: | | | | | | | | | |
| Temperature (°C) | | n/a | | | | | | | | |
| рН | | n/a | | | | | | | | |
| ORP (mV) | | n/a | · | · | · | · | | | | |
| EC (μS/cm) | | n/a | | | | | | | | |
| TDS (mg/l) | | n/a | | | | | | | | |
| Not sampled – pun | np installed a | and bore opening is covered. | | | | | | | | |
| Date: | Date: 30 | | | 30/6/2014 | | | | | | |
| Time: | 15:50 | | | | | | | | | |





| Property / Landho | lder: | FA Wheatley and Son Pty Ltd | | | | | | |
|------------------------------|----------------------------|-----------------------------|------------------|------------------|---------------------|----------|--|--|
| Bore name | GDAY1 | | Cad. Lot No: | 15 | Cad. Plan No: | DP750931 | | |
| Easting: | 290818.3 | | Northing: | 6438406.7 | Elevation: | 236.8 | | |
| Paddock, alluvial fla | at (Sandy Crl | (North), | approx 380 m v | vest of Halls Rd | | | | |
| Bore construction: | Bore construction: | | | | | | | |
| Bore diameter: | | 92 cm (| inner) | | | | | |
| Casing: | | Concre | te | | | | | |
| Bore depth: | | 5.77 m | | | | | | |
| Bore equipment / | use: | | | | | | | |
| Bore use: | | Functio | nal well, not us | ed, not equippe | ed, previously stoc | k water. | | |
| Bore equipment: n/a | | | | | | | | |
| Water level measu | rement: | | | | | | | |
| Reference point ele | 0.70 m | | | | | | | |
| Reference point description: | | | concrete casin | g | | | | |
| Measured depth to | water: | 3.52 m | | | | | | |
| GWL elevation: | | 234.01 m RL | | | | | | |
| | | | | | | | | |
| Water quality mea | surement: | | | | | | | |
| Temperature (°C) | | 15.5 | 15.5 | | | | | |
| рH | | 6.9 | | | | | | |
| ORP (mV) | | 135 | | | | | | |
| EC (μS/cm) | | 766 | | | | | | |
| TDS (mg/l) | | 509 | | | | | | |
| Sampled using bail | er (3 rd bailer | volume) | | | | | | |
| Date: | | 10/7/2 | 014 | | | | | |
| Time: | | 9:30 | | | | | | |





| Property / Landho | lder: | FA Wheatley and Son Pty Ltd | | | | | |
|--------------------------------|---------------|-----------------------------|--------------------|----------------|---------------|----------|--|
| Bore name | WH02 | | Cad. Lot No: | 15 | Cad. Plan No: | DP750931 | |
| Easting: | 290832.1 | | Northing: | 6438493.8 | Elevation: | 238.3 | |
| Paddock, alluvial fla | at (Sandy Crl | (North), | approx 100 m r | north of WH01. | | | |
| Bore construction: | | | | | | | |
| Bore diameter: | | 170 cm | 170 cm | | | | |
| Casing: | | Steel, c | oncrete | | | | |
| Bore depth: | | n/a | | | | | |
| Bore equipment / | use: | | | | | | |
| | | | ed, backfilled, fo | rmerly stock w | ater. | | |
| Bore equipment: Windm | | | ill (non-function | ning) | | | |
| Water level measu | rement: | | | | | | |
| Reference point elevation: n/a | | | | | | | |
| Reference point de | scription: | n/a | | | | | |
| Measured depth to | water: | n/a | | | | | |
| GWL elevation: | | n/a | | | | | |
| Bore backfilled (ruk | oble, concret | e), GWL | not measured. | | | | |
| Water quality mea | surement: | | | | | | |
| Temperature (°C) | | n/a | | | | | |
| рН | | n/a | | | | | |
| ORP (mV) | | n/a | | | | | |
| EC (μS/cm) | | n/a | | | | | |
| TDS (mg/l) | | n/a | | | | | |
| Bore backfilled (rub | oble, concret | e), wate | r quality sample | not acquired. | | | |
| Date: 10/7/20 | | | 014 | | | | |
| Time: | | 10:00 | | | | | |





| Property / Landho | lder: | Rosella / Lawrence Edward, Sandra Robyn Holdsworth | | | | | |
|------------------------------|-------------|--|------------------|------------------|---------------|----------|--|
| Bore name | ROS01 | | Cad. Lot No: | 2 | Cad. Plan No: | DP625029 | |
| Easting: | 291188.9 | | Northing: | 6437829.9 | Elevation: | 230.3 | |
| Well in alluvium of | Sandy Creek | North, a | approx 150 m ea | ast of Halls Rd. | | | |
| Bore construction: | | | | | | | |
| Bore diameter: | | 92 cm (| 92 cm (internal) | | | | |
| Casing: | | concret | te | | | | |
| Bore depth: | | 6.0 m | | | | | |
| Bore equipment / | use: | | | | | | |
| Bore use: Bore | | | use – stock (ap | prox 20 head) w | ater. | | |
| Bore equipment: Pump | | | Pump – petrol | | | | |
| Water level measu | rement: | | | | | | |
| Reference point elevation: 1 | | | | | | | |
| Reference point de | top of o | concrete casing | | | | | |
| Measured depth to | water: | 4.76 m | | | | | |
| GWL elevation: | | 227.04 m RL | | | | | |
| Water quality mea | surement: | | | | | | |
| Temperature (°C) | | n/a | | | | | |
| рН | | n/a | | | | | |
| ORP (mV) | | n/a | n/a | | | | |
| EC (μS/cm) | | n/a | | | | | |
| TDS (mg/l) | | n/a | | | | | |
| Well covered with | chicken mes | h wire – | water quality sa | ample not taken | | | |
| Date: | | 10/7/2 | 10/7/2014 | | | | |
| Time: 10 | | 10:00 | | | | | |





| Property / Landho | Walter | Walter John and Gwen Elizabeth Pitman | | | | | | |
|---------------------|---------------|---|---|-------------------|------------------|-------------|--|--|
| Bore name | PIT01 | | Cad. Lot No: | 1 | Cad. Plan No: | DP625029 | | |
| Easting: | 291243.1 | | Northing: | 6437765.5 | Elevation: | 229.3 | | |
| Well in alluvium of | Sandy Cree | k North, a | approx 240 m e | ast of Halls Rd., | approx 100 m sou | uth-east of | | |
| ROS01 | | | | | | | | |
| Bore construction | • | | | | | | | |
| Bore diameter: | | 150 x 1 | 50 cm (rectangi | ular) well | | | | |
| Casing: | | timber | | | | | | |
| Bore depth: | | n/a | | | | | | |
| Bore equipment / | use: | | | | | | | |
| Bore use: | bore in | bore in use – stock (approx 50 head) water. | | | | | | |
| | | | pump – electric, powered directly from grid, old non-functioning windmill | | | | | |
| Water level measu | ırement: | | | | | | | |
| Reference point ele | evation: | 0.30 m | | | | | | |
| Reference point de | scription: | Timber edge | | | | | | |
| Measured depth to | water: | 4.06 m | | | | | | |
| GWL elevation: | | 225.54 m RL | | | | | | |
| | | | | | | | | |
| Water quality mea | asurement: | | | | | | | |
| Temperature (°C) | | 15.0 | 15.0 | | | | | |
| рH | | 6.9 | | | | | | |
| ORP (mV) | | 133 | | | | | | |
| EC (μS/cm) | | 1422 | | | | | | |
| TDS (mg/l) | | 971 | | | | | | |
| Bailer used to acqu | uire water sa | mple (3 rd | bailer volume) | | | | | |
| Date: 10/7/2 | | | 014 | | | | | |
| <i>Time:</i> 10:1 | | | | | | | | |





| Property / Landho | Property / Landholder: | | Rosella / Lawrence Edward, Sandra Robyn Holdsworth | | | | | |
|--|------------------------|---|--|-----------------|------------------|-----------|--|--|
| Bore name | PIT02/ROS02 | | Cad. Lot No: | 2 | Cad. Plan No: | DP625029 | | |
| Easting: | 291336.9 | | Northing: | 6437732.2 | Elevation: | 229.1 | | |
| Well located in the small shed at the al | | | uvial flat of the S | Sandy Creek Nor | th (south-wester | n bank of | | |
| creek), approximat | ely 360 m ea | st of Hal | ls Rd. | | | | | |
| Bore construction: | | | | | | | | |
| Bore diameter: | | 1.0 x 1. | 5 m – rectangul | ar | | | | |
| Casing: | | Timber | | | | | | |
| Bore depth: | | 7.7 m | | | | | | |
| Bore equipment / | use: | | | | | | | |
| Bore use: Bore in | | | ore in use – stock (approx 20 head) water. | | | | | |
| Bore equipment: Pump - | | | Pump – electric, 240V (Davey) – pumping!!! | | | | | |
| Water level measu | rement: | | | | | | | |
| Reference point ele | vation: | 0.0 m | | | | | | |
| Reference point des | scription: | ground - Reference point approximately at ground level. | | | | | | |
| Measured depth to | water: | 3.7 m | | | | | | |
| GWL elevation: | | 225.4 n | 225.4 m | | | | | |
| Water quality mea | surement: | | | | | | | |
| Temperature (°C) | | 18.0 | | | | | | |
| рН | | 6.9 | | | | | | |
| ORP (mV) | | 137 | | | | | | |
| EC (μS/cm) | | 1527 | | | | | | |
| TDS (mg/l) | | 1076 | | | | | | |
| Sample acquired us | sing bailer (3 | rd bailer | volume) | | | | | |
| Date: 10/7/2 | | | 014 | | | | | |
| Time: | | 10:30 | | | | | | |









| Property / Landho | lder: | Dorset / John Lawrence, Diane Gay Day, Rodney William | | | | | |
|--|---------------|---|-------------------|--------------------|--------------------|---------------|--|
| Bore name | DOR01 | | Cad. Lot No: | 1 | Cad. Plan No: | DP838220 | |
| Easting: | 290386.4 | | Northing: | 6438064.9 | Elevation: | 251.5 | |
| Bore located south of Sandy Creek Nort | | | h tributary in th | e flat area just b | elow the foothills | . Small wire- | |
| mesh shelter with 1 | flat metal sh | eet roof | on concrete pac | l. | | | |
| Bore construction: | | | | | | | |
| Bore diameter: | | 190 mr | n | | | | |
| Casing: | | Black P | VC | | | | |
| Bore depth: | | 27.0 m | | | | | |
| Bore equipment / | use: | | | | | | |
| Bore use: Bore in | | ore in use, approx 30 heads of stock | | | | | |
| Bore equipment: Pump, e | | Pump, electric (Onga) | | | | | |
| Water level measu | rement: | | | | | | |
| Reference point ele | evation: | 4.0 cm | | | | | |
| Reference point des | scription: | Top of the black PVC casing | | | | | |
| Measured depth to | water: | 7.71 m | 7.71 m | | | | |
| GWL elevation: | | 243.87 | m | | | | |
| Water quality mea | surement: | | | | | | |
| Temperature (°C) | | n/a | | | | | |
| рH | | n/a | | | | | |
| ORP (mV) | | n/a | | | | | |
| EC (μS/cm) | | n/a | | | | | |
| TDS (mg/l) | | n/a | | | | | |
| Water quality samp | ole not acqui | red, bor | e opening partia | lly blocked by p | ump. | | |
| Date: | | 10/7/2 | 014 | | | | |
| Time: | | 11:10 | | | | | |







| Property / Landho | lder: | Trevor | George Woods, | Karen Muriel Ba | ites | |
|----------------------|-------------------------------------|-----------|------------------|-----------------|-------------------|-----------------|
| Bore name | GW200256 | | Cad. Lot No: | 16 | Cad. Plan No: | DP830934 |
| Easting: | 288720.2 | | Northing: | 6436578.9 | Elevation: | 310.9 |
| End of Sandy Creek | End of Sandy Creek Rd. R.O.W. Small | | | the driveway. B | ore backfilled im | mediately after |
| drilled – no water s | truck. | | | | | |
| Bore construction: | | | | | | |
| Bore diameter: | | n/a | | | | |
| Casing: | | n/a | | | | |
| Bore depth: | | n/a | | | | |
| Bore equipment / | use: | | | | | |
| Bore use: | | No | | | | |
| Bore equipment: | | n/a | | | | |
| Water level measu | rement: | | | | | |
| Reference point ele | Reference point elevation: n | | | | | |
| Reference point des | scription: | n/a | | | | |
| Measured depth to | water: | n/a | | | | |
| GWL elevation: | | n/a | | | | |
| Bore does not exist | , no ground | water lev | el measuremen | t taken. | | |
| Water quality mea | surement: | | | | | |
| Temperature (°C) | | n/a | | | | |
| рH | | n/a | | | | |
| ORP (mV) | | n/a | | | | |
| EC (μS/cm) | | n/a | | | | |
| TDS (mg/l) | | n/a | | | | |
| Bore does not exist | , no ground | water qu | ality sample tak | en. | | |
| Date: | | 10/7/2 | 014 | | | |
| Time: | | 12:20 | | | | |

No photos documenting this bore.

| Property / Landho | Property / Landholder: | | John Howard | | | | | |
|--------------------|------------------------|------------------------|------------------|-------------------|----------------------|-----------------|--|--|
| Bore name | GW025631 | GW025631 | | 13 | Cad. Plan No: | DP830934 | | |
| Easting: | 288674.7 | | Northing: | 6436034.7 | Elevation: | 284.9 | | |
| Western bank of t | he Coal Creel | د (Sandy | Creek South?) o | on the alluvial c | reek flat. Approx 4 | 0 m east of | | |
| Sandy Creek Rd R. | O.W. | | | | | | | |
| Bore construction | : | | | | | | | |
| Bore diameter: | | 145 cm | (outside) | | | | | |
| Casing: | | Concre | te | | | | | |
| Bore depth: | | 4.17 m | | | | | | |
| Bore equipment / | use: | | | | | | | |
| Bore use: St | | | Stock | | | | | |
| Bore equipment: Wi | | | Windmill | | | | | |
| Water level meas | urement: | | | | | | | |
| Reference point el | evation: | 0.32 m | | | | | | |
| Reference point de | escription: | Edge of | f the opening in | the green well | lid – elevation of t | the casing top. | | |
| Measured depth to | o water: | 1.67 m | | | | | | |
| GWL elevation: | | 283.54 m RL | | | | | | |
| | | | | | | | | |
| Water quality me | asurement: | | | | | | | |
| Temperature (°C) | | 15.0 | | | | | | |
| рН | | 6.8 | | | | | | |
| ORP (mV) | | 133 | | | | | | |
| EC (μS/cm) | | 2035 | | | | | | |
| TDS (mg/l) | | 1420 | | | | | | |
| Sample obtained u | using bailer (3 | 3 rd bailer | volume) | | | | | |
| Date: 10/7/2014 | | | | | | | | |
| Time: 12:40 | | | | | | | | |





| Property / Landhol | lder: | Peter B | rian Watts | | | | |
|---------------------|----------------|-------------------------|---------------------------|------------------|---------------------|--------------|--|
| Bore name | GW025626 |) | Cad. Lot No: | 11 | Cad. Plan No: | DP830934 | |
| Easting: | 288164.4 | | Northing: | 6435243.4 | Elevation: | 262.0 | |
| NW bank of the Co | al Creek, app | rox 80 n | n south of the re | oad, well in the | Coal Creek alluviu | ım. Bore | |
| equipped with dere | elict windmil | l (easting | g: 288162.4; noi | rthing: 6435240 | 0.0; elevation: 261 | .0) about 5m | |
| away. | | | | | | | |
| Bore construction: | | | | | | | |
| Bore diameter: | | 150 cm | outside | | | | |
| Casing: | concret | :e | | | | | |
| Bore depth: | | 2.45 m | | | | | |
| Bore equipment / | use: | | | | | | |
| Bore use: | Stock – | approx 35 head | ds?. | | | | |
| Bore equipment: | no pum | ıp. | | | | | |
| Water level measu | rement: | | | | | | |
| Reference point ele | vation: | 75 cm | | | | | |
| Reference point des | scription: | Edge of concrete casing | | | | | |
| Measured depth to | water: | 1.10 m | | | | | |
| GWL elevation: | | 260.66 m RL | | | | | |
| Water quality mea | surement: | | | | | | |
| Temperature (°C) | | 15.3 | | | | | |
| рН | | 7.1 | | | | | |
| ORP (mV) | | 142 | | | | | |
| EC (μS/cm) | | 3110 | | | | | |
| TDS (mg/l) | | 2215 | | | | | |
| Sample obtained us | sing bailer (3 | rd bailer | volume) | | | | |
| Date: 10/7/2014 | | | | | | | |
| Time: | | 13:20 | | | | | |







| Property / Landho | lder: | Kailana | Kailana / Robert Geoffrey Gowing | | | | | |
|-----------------------------------|-----------------|----------|----------------------------------|-----------------|----------------------|---------------|--|--|
| Bore name | GOW01 | GOW01 | | 324 | Cad. Plan No: | DP829973 | | |
| Easting: | 286554.4 | | Northing: | 6430771.2 | Elevation: | 197.6 | | |
| Well sunk into allu | vium behind | owner's | house. Reed be | ed covering the | well, well itself no | t accessible. | | |
| Bore construction: | | | | | | | | |
| Bore diameter: | | 150 cm | ?? | | | | | |
| Casing: | | Concre | te | | | | | |
| Bore depth: | Bore depth: n/a | | | | | | | |
| Bore equipment / | use: | | | | | | | |
| Bore use: Do | | | tic, stock | | | | | |
| Bore equipment: | | no pun | пр | | | | | |
| Water level measu | rement: | | | | | | | |
| Reference point elevation: 0.00 n | | | | | | | | |
| Reference point description: Grou | | | k | | | | | |
| Measured depth to | water: | 0.00 m | | | | | | |
| GWL elevation: | | 197.60 | m RL | | | | | |
| Groundwater level | not measure | ed – wat | er spills over the | e well edge and | surface water ele | vation in the | | |
| reeds/swamp is as: | sumed to be | identica | I to the ground | water level. | | | | |
| Pump taking water | - | n creek. | | | | | | |
| Water quality mea | surement: | | | | | | | |
| Temperature (°C) | | 10.2 | | | | | | |
| рH | | 7.7 | | | | | | |
| ORP (mV) | | 59 | | | | | | |
| EC (μS/cm) | | 4180 | | | | | | |
| TDS (mg/l) | | 3121 | | | | | | |
| Surface water scoo | p from the s | wampy i | reed bed. | | | · | | |
| Date: | | 10/7/2 | 014 | | | · | | |
| Time: | | 14:15 | | | | | | |

Time: | 14:15 | 14:15 | Owner claims that the water in the well is different from the water in the creek (cca 15 m distant). Water quality measurement of the creek water seems to confirm this – water in the creek much fresher (EC=890 μ S/cm, TDS=602.2 mg/l)



| Property / Landho | lder: | Ann Michelle Pratt | | | | | |
|--------------------------|--------------|--------------------|---------------------------------|----------------|--------------------|-----------------|--|
| Bore name | GOW02 | | Cad. Lot No: | 37 | Cad. Plan No: | DP750915 | |
| Easting: | 286380.4 | | Northing: | 6433080.7 | Elevation: | 235.3 | |
| Well in the paddoc | k behind ow | ner's ho | use, approx 200 | m east from Ca | astle Rock Rd. Fen | ced off well in | |
| Spring Creek alluvio | um, small pu | impshed | • | | | | |
| Bore construction: | | | | | | | |
| Bore diameter: | | 150 x 1 | 50 cm – rectang | gular well | | | |
| Casing: | | Timber | | | | | |
| Bore depth: | | 8.40 m | | | | | |
| Bore equipment / use: | | | | | | | |
| Bore use: Don | | | Domestic, stock (horse, cattle) | | | | |
| Bore equipment: Electric | | | pump | | | | |
| Water level measu | rement: | | | | | | |
| Reference point ele | vation: | 0.0 | | | | | |
| Reference point des | scription: | ground | | | | | |
| Measured depth to | water: | 2.14 m | | | | | |
| GWL elevation: | | 233.12 | 233.12 m RL | | | | |
| Water quality mea | surement: | | | | | | |
| Temperature (°C) | | 17.9 | | | | | |
| рН | | 7.7 | | | | | |
| ORP (mV) | | 148 | | | | | |
| EC (μS/cm) | | 628 | | | | | |
| TDS (mg/l) | | 417 | | | | | |
| Water quality samp | ole obtained | using ba | iler (3 rd bailer v | olume) | | | |
| Date: 10/7/2 | | 10/7/2 | 014 | | | | |
| Time: | | 14:50 | | | | | |







| Property / Landholder: | | Ian Vincent Ingold, Colleen Anne Ingold | | | | | | |
|------------------------|-------------------------------------|---|-------------------|------------------|-------------------|-------------|--|--|
| Bore name | ING01 | ING01 | | 212 | Cad. Plan No: | DP634465 | | |
| Easting: | 286632.4 | | Northing: | 6429549.5 | Elevation: | 186.8 | | |
| Well located in a sr | Well located in a small shed, on th | | | eek alluvium) be | hind the house, a | pprox 270 m | | |
| east of the Castle R | ock Rd. | | | | | | | |
| Bore construction: | | | | | | | | |
| Bore diameter: | | 140 cm | | | | | | |
| Casing: | | Concre | te | | | | | |
| Bore depth: | | 4.9 m | | | | | | |
| Bore equipment / use: | | | | | | | | |
| Bore use: | Bore use: | | Domestic (garden) | | | | | |
| Bore equipment: Pump | | Pump, | Pump, electric | | | | | |
| Water level measu | rement: | | | | | | | |
| Reference point ele | vation: | 20 cm | | | | | | |
| Reference point de | scription: | Top/edge of the concrete casing | | | | | | |
| Measured depth to | water: | 1.30 m | | | | | | |
| GWL elevation: | | 185.68 m RL | | | | | | |
| Water quality mea | surement: | | | | | | | |
| Temperature (°C) | | 12.7 | | | | | | |
| рН | | 7.2 | | | | | | |
| ORP (mV) | | 157 | | | | | | |
| EC (μS/cm) | | 1506 | | | | | | |
| TDS (mg/l) | | 1037 | | | | | | |
| Sampled from gard | en tap. | | | | | | | |
| Date: | | 10/7/2014 | | | | | | |
| Time: | | 15:30 | | | | | | |





| Property / Landholder: | | Scott H | eywood Jennar | | | | | |
|------------------------|----------------------------|---------------------------------|--|------------|---------------|----------|--|--|
| Bore name | JEN01 | | Cad. Lot No: | 16 | Cad. Plan No: | DP731123 | | |
| Easting: | 286639.9 | | Northing: | 6429854.8 | Elevation: | 190.3 | | |
| Well located behin | d machinery | shed, ap | d, approx 210 m east from Castle Rock Rd. Spring Creek alluvium. | | | | | |
| Bore construction: | : | | | | | | | |
| Bore diameter: | | 140 cm | | | | | | |
| Casing: | | Concre | Concrete | | | | | |
| Bore depth: | | 7.62 m | | | | | | |
| Bore equipment / | use: | | | | | | | |
| Bore use: | | Domes | tic (garden) | | | | | |
| Bore equipment: | | Pump, | electric (power | from grid) | | | | |
| Water level measu | ırement: | | | | | | | |
| Reference point ele | evation: | 120 cm | | | | | | |
| Reference point de | scription: | Top/edge of the concrete casing | | | | | | |
| Measured depth to | water: | 3.17 m | | | | | | |
| GWL elevation: | | 188.32 | | | | | | |
| Water quality mea | asurement: | | | | | | | |
| Temperature (°C) | | 11.5 | | | | | | |
| рН | | 7.2 | | | | | | |
| ORP (mV) | | 219 | | | | | | |
| EC (μS/cm) 1 | | 1411 | | | | | | |
| | | 972 | | | | | | |
| Sampled using bail | er (3 rd bailer | volume) | | | | | | |
| Date: | | 10/7/2014 | | | | | | |
| Time: | | 16:30 | | | | | | |





| Property / Landholder: | | Maree Esther D | Daniels | | | | | |
|------------------------|--------------|-------------------|------------|---------------|-----------|--|--|--|
| Bore name | DDH20 | Cad. Lot No: | 101 | Cad. Plan No: | DP1157712 | | | |
| Easting: | 293115.37 | Northing: | 6439916.10 | Elevation: | 240.30 | | | |
| Bore construction | on: | | | | | | | |
| Bore diameter: | | 50mm | | | | | | |
| Casing: | | PVC | | | | | | |
| Bore depth: | | 46.76 | | | 240.30 | | | |
| Bore equipment | :/use: | | | | | | | |
| Bore use: | | Not used | | | | | | |
| Bore equipment: | | None | | | | | | |
| Water level mea | surement: | | | | | | | |
| Reference point of | elevation: | 0.76 m | | | | | | |
| Reference point of | description: | Top of PVC casing | | | | | | |
| Measured depth | to water: | n/a | | | | | | |
| GWL elevation: | | n/a | | | | | | |
| Water quality m | easurement: | | | | | | | |
| Temperature (°C |) | n/a | | | | | | |
| рН | | 6.48 | | | | | | |
| ORP (mV) | | n/a | | | | | | |
| EC (μS/cm) | | 12460 | | | | | | |
| TDS (mg/l) | | n/a | | | | | | |
| Date: | | 18/6/2014 | | | | | | |
| Time: | | 9:15 | | | | | | |





| Property / Landholder: | | Muswellbrook | Coal Company (M | CC) | C) | | | |
|------------------------|----------------------------|-------------------|--------------------|---------------|----------|--|--|--|
| Bore name | WYL1 | Cad. Lot No: | 101 | Cad. Plan No: | DP750951 | | | |
| Easting: | 291169.47 | Northing: | 6438494.78 | Elevation: | 243.83 | | | |
| Remnant of a bore | , derelict windr | nill, not sampled | by CBE | · | • | | | |
| Bore construction: | • | | | | | | | |
| Bore diameter: | | 0.12 | | | | | | |
| Casing: | | PVC | | | | | | |
| Bore depth: | | 15.7 | | | | | | |
| Bore equipment / | use: | | | | | | | |
| Bore use: | | Not used | | | | | | |
| Bore equipment: | | None | | | | | | |
| Water level measu | rement: | | | | | | | |
| Reference point ele | Reference point elevation: | | 0 | | | | | |
| Reference point de | scription: | Top of the PVS | casing – approx. g | round level | | | | |
| Measured depth to | water: | 10.24 | | | | | | |
| GWL elevation: | | 233.59 | | | | | | |
| Water quality mea | asurement: | | | | | | | |
| Temperature (°C) | | n/a | | | | | | |
| рН | | n/a | | | | | | |
| ORP (mV) | | n/a | | | | | | |
| EC (μS/cm) | | n/a | | | | | | |
| TDS (mg/l) | | n/a | | | | | | |
| | | | | | | | | |
| Date: | Date: | | 14 | | | | | |
| Time: | | 11:15 | | | | | | |





| Property / Landholder: | | Anthony Denis | Lonergan | | | | | |
|------------------------|----------------|------------------------|--------------------|---------------|-----------|--|--|--|
| Bore name | DDH4 | Cad. Lot No: | 101 | Cad. Plan No: | DP1124883 | | | |
| Easting: | 291782.68 | Northing: | 6436624.36 | Elevation: | 257.16 | | | |
| Exploration hole us | sed for ground | water quality sam | pling | • | • | | | |
| Bore construction | : | | | | | | | |
| Bore diameter: | | 50 mm | | | | | | |
| Casing: | | White PVC | | | | | | |
| Bore depth: | | 84.64 | | | | | | |
| Bore equipment / | use: | | | | | | | |
| Bore use: | | Monitoring - wa | ater quality sampl | ing | | | | |
| Bore equipment: | | None | | | | | | |
| Water level measu | ırement: | | | | | | | |
| Reference point ele | evation: | 0.92 | | | | | | |
| Reference point de | scription: | Top of the PVC stickup | | | | | | |
| Measured depth to | water: | 39.8 | | | | | | |
| GWL elevation: | | 218.28 | | | | | | |
| Water quality mea | asurement: | | | | | | | |
| Temperature (°C) | | n/a | | | | | | |
| рН | | 7.74 | | | | | | |
| ORP (mV) | | n/a | | | | | | |
| EC (µS/cm) | | 3890 | | | | | | |
| TDS (mg/l) | | n/a | | | | | | |
| | | | | | | | | |
| Date: | Date: | | | | | | | |
| Time: | | 12:50 | | | | | | |





| Property / Landholder: | | John Edward Lo | onergan, Johanna | Lambertina Lonerg | ambertina Lonergan | | |
|------------------------|-------------|----------------|------------------|-------------------|--------------------|--|--|
| Bore name | JLON1 | Cad. Lot No: | 4 | Cad. Plan No: | DP584230 | | |
| Easting: | 292403.50 | Northing: | 6434331.87 | Elevation: | 259.20 | | |
| Bore sealed up | | | | | | | |
| Bore construction | : | | | | | | |
| Bore diameter: | | n/a | | | | | |
| Casing: | | n/a | | | | | |
| Bore equipment / | use: | | | | | | |
| Bore use: | | stock | | | | | |
| Bore equipment: | | Windmill | | | | | |
| Bore depth: | | n/a | | | | | |
| Water level measu | urement: | | | | | | |
| Reference point ele | evation: | n/a | | | | | |
| Reference point de | escription: | n/a | | | | | |
| Measured depth to | o water: | n/a | | | | | |
| GWL elevation: | | n/a | | | | | |
| Bore opening seale | ed | | | | | | |
| Water quality mea | asurement: | | | | | | |
| Temperature (°C) | | n/a | | | | | |
| рН | | 8.92 | | | | | |
| ORP (mV) | | n/a | | | | | |
| EC (μS/cm) | | 8220 | · | | | | |
| TDS (mg/l) | | n/a | n/a | | | | |
| Sampled from wat | er tank | | | | | | |
| Date: | | 18/6/2014 | | | | | |
| Time: | | 13:50 | | | | | |





| Property / Landholder: | | Colin William H | utchinson (MCC) | | | | | |
|------------------------|------------|------------------------|-----------------|---------------|----------|--|--|--|
| Bore name | YOU1 | Cad. Lot No: | 32 | Cad. Plan No: | DP748710 | | | |
| Easting: | 288149.59 | Northing: | 6434786.27 | Elevation: | 250.42 | | | |
| Dave constructions | | | | | | | | |
| Bore construction: | <u> </u> | 1 10 | | | | | | |
| Bore diameter: | | 1.10 m | | | | | | |
| Casing: | | Concrete | | | | | | |
| Bore equipment / | use: | 1 , | | | | | | |
| Bore use: | | n/a | | | 250.42 | | | |
| Bore equipment: | | n/a | | | | | | |
| Bore depth: | | 2.48 | | | | | | |
| Water level measu | rement: | | | | | | | |
| Reference point ele | evation: | 0.67 | | | | | | |
| Reference point de | | Top of concrete casing | | | | | | |
| Measured depth to | water: | 2.48 | | | | | | |
| GWL elevation: | | 248.61 | 48.61 | | | | | |
| Water quality mea | surament | | | | | | | |
| Temperature (°C) | isurement. | n/a | | | | | | |
| pH | | n/a | | | | | | |
| | | n/a n/a | | | | | | |
| ORP (mV) | | • | | | | | | |
| EC (μS/cm) | | | 5890 | | | | | |
| TDS (mg/l) | | n/a | | | | | | |
| Date: | | 18/6/2014 | | | | | | |
| Time: | | 14:25 | | | | | | |





| Property / Landholder: | | Graeme Carl Sp | parre | | | | | |
|------------------------|--------------|-------------------|------------|---------------|----------|--|--|--|
| Bore name | DDH27 | Cad. Lot No: | 2 | Cad. Plan No: | DP136249 | | | |
| Easting: | 291291.04 | Northing: | 6434348.03 | Elevation: | 244.04 | | | |
| Bore construction | on: | | | | | | | |
| Bore diameter: | | 50 mm | | | | | | |
| Casing: | | PVC | | | | | | |
| Bore depth: | | 63.1 | | | | | | |
| Bore equipmen | t / use: | | | | | | | |
| Bore use: | | Monitoring | | | | | | |
| Bore equipment | <i>:</i> | None | | | | | | |
| Water level me | asurement: | | | | | | | |
| Reference point | elevation: | 0.075 | | | | | | |
| Reference point | description: | Top of PVC casing | | | | | | |
| Measured depth | n to water: | 23.56 | | | | | | |
| GWL elevation: | | 220.55 | | | | | | |
| Water quality m | neasurement: | | | | | | | |
| Temperature (°C | C) | n/a | | | | | | |
| рН | | 8.28 | | | | | | |
| ORP (mV) | | n/a | | | | | | |
| EC (μS/cm) | | 999 | | | | | | |
| TDS (mg/l) | | n/a | | | | | | |
| Date: | | 19/6/2014 | | | | | | |
| Time: | | 8:25 | | | | | | |
| Time: | | 8.25 | | | | | | |





| Property / Landholder: | | Graeme Carl Sp | arre | | | | | |
|------------------------|-------------|---|------------|---------------|----------|--|--|--|
| Bore name | SPAR3 | Cad. Lot No: | 1 | Cad. Plan No: | DP136249 | | | |
| Easting: | 291439.68 | Northing: | 6433548.47 | Elevation: | 220.89 | | | |
| Bore construction | ı : | | | | | | | |
| Bore diameter: | | ~ 1x1 m | | | | | | |
| Casing: | | Timber | | | | | | |
| Bore depth | | 8.2 | | | vel | | | |
| Bore equipment / | use: | | | | | | | |
| Bore use: | | n/a | | | | | | |
| Bore equipment: | | n/a | | | | | | |
| Water level meas | urement: | | | | | | | |
| Reference point el | evation: | 0.10 | | | | | | |
| Reference point de | escription: | Edge of well – approximately ground level | | | | | | |
| Measured depth t | o water: | 2.96 | | | | | | |
| GWL elevation: | | 218.03 | | | | | | |
| Water quality me | asurement: | | | | | | | |
| Temperature (°C) | | n/a | | | | | | |
| рН | | n/a | | | | | | |
| ORP (mV) | | n/a | | | | | | |
| EC (μS/cm) | | n/a | | | | | | |
| TDS (mg/l) | | n/a | | | | | | |
| Water quality not | sampled | | | | | | | |
| Date: | | 19/6/2014 | 6/2014 | | | | | |
| Time: | | 8:45 | | | | | | |





| Property / Landholder: | | Graeme Carl Sparre | | | | | | |
|------------------------|--------------|--------------------|------------------|---------------------|----------|--|--|--|
| Bore name | CRRDH52 | Cad. Lot No: | 2 | Cad. Plan No: | DP136249 | | | |
| Easting: | 291701.57 | Northing: | 6434009.73 | Elevation: | 237.61 | | | |
| Bore constructi | on: | | | | | | | |
| Bore diameter: | | 50 mm | | | | | | |
| Casing: | | PVC | | | | | | |
| Bore depth: | | 16.76 | | | | | | |
| Bore equipmen | t / use: | • | | | | | | |
| Bore use: | | Exploration – b | ore abandoned, u | sed as sampling sit | te | | | |
| Bore equipment | ·• | n/a | n/a | | | | | |
| Water level me | asurement: | | | | | | | |
| Reference point | elevation: | 1.21 | | | | | | |
| Reference point | description: | Top of PVC cas | ing | | | | | |
| Measured depth | h to water: | 16.76 | | | | | | |
| GWL elevation: | | 222.06 | | | | | | |
| Water quality n | neasurement: | | | | | | | |
| Temperature (°0 | C) | n/a | n/a | | | | | |
| рН | | 7.0 | | | | | | |
| ORP (mV) | | n/a | | | | | | |
| EC (μS/cm) | | 2190 | | | | | | |
| TDS (mg/l) | | n/a | | | | | | |
| Date: | | 19/6/2014 | | | | | | |
| Time: | | 9:15 | | | | | | |
| TITIC. | | 1 2.13 | | | | | | |





| Property / Landholder: | | Graeme Carl Sp | Graeme Carl Sparre | | | | | |
|------------------------|--------------|------------------|---------------------|---------------|---------|--|--|--|
| Bore name | SPAR4 | Cad. Lot No: | 4 | Cad. Plan No: | DP21335 | | | |
| Easting: | 290210.33 | Northing: | 6433732.92 | Elevation: | 215.17 | | | |
| Bore construction | on: | | | | | | | |
| Bore diameter: | | 150 mm | | | | | | |
| Casing: | | steel | | | | | | |
| Bore depth: | | 3.78 | | | | | | |
| Bore equipmen | t / use: | | | | | | | |
| Bore use: | | n/a | | | | | | |
| Bore equipment | : | Derelict windm | ill | | | | | |
| Water level mea | asurement: | | | | | | | |
| Reference point | elevation: | 0.45 m | | | | | | |
| Reference point | description: | Top of steel cas | Top of steel casing | | | | | |
| Measured depth | to water: | 3.78 | | | | | | |
| GWL elevation: | | 211.84 | | | | | | |
| Water quality m | neasurement: | | | | | | | |
| Temperature (°C | <i>c)</i> | n/a | | | | | | |
| рН | | 9.34 | | | | | | |
| ORP (mV) | | n/a | | | | | | |
| EC (μS/cm) | | 1669 | | | | | | |
| TDS (mg/l) | | n/a | | | | | | |
| Date: | | 19/6/2014 | | | | | | |
| | | 19/6/2014 | | | | | | |
| Time: | | 9:40 | | | | | | |





| Property / Landholder: | | Graeme Carl Sparre | | | | | | |
|------------------------|-------------|--------------------|----------------------------------|------------|--------|--|--|--|
| Bore name | SPAR2 | Cad. Lot No: | Cad. Lot No: 4 Cad. Plan No: DP2 | | | | | |
| Easting: | 289994.50 | Northing: | 6433497.99 | Elevation: | 217.38 | | | |
| Bore construction | : | | | | | | | |
| Bore diameter: | | 1.10 | | | | | | |
| Casing: | | Concrete | | | | | | |
| Bore depth: | | 7.35 | | | | | | |
| Bore equipment / | use: | | | | | | | |
| Bore use: | | Stock, minor irr | rigation | | | | | |
| Bore equipment: | | Windmill | | | | | | |
| Water level meas | urement: | | | | | | | |
| Reference point el | evation: | 0.48 | | | | | | |
| Reference point de | escription: | Top of concrete | Top of concrete well | | | | | |
| Measured depth to | o water: | 3.30 | | | | | | |
| GWL elevation: | | 214.56 | | | | | | |
| Water quality me | asurement: | | | | | | | |
| Temperature (°C) | | n/a | | | | | | |
| рН | | 7.73 | | | | | | |
| ORP (mV) | | n/a | | | | | | |
| EC (μS/cm) | | 2710 | | | | | | |
| TDS (mg/l) | | n/a | | | | | | |
| Date: | | 19/6/2014 | | | | | | |
| Time: 10:05 | | | | | | | | |







| Property / Landholder: | | Graeme Carl Sparre | | | | | | |
|------------------------|--------------|--------------------|-----------------------|---------------|---------|--|--|--|
| Bore name | CRRDH106 | Cad. Lot No: | 4 | Cad. Plan No: | DP21335 | | | |
| Easting: | 290009.14 | Northing: | 6433457.19 | Elevation: | 213.00 | | | |
| Bore construction | on: | | | | | | | |
| Bore diameter: | | 50 mm | | | | | | |
| Casing: | | PVC | | | | | | |
| Bore depth: | | 4.6 | | | | | | |
| Bore equipment | :/use: | | | | | | | |
| Bore use: | | Monitoring – b | ore used as a stre | am gauge | | | | |
| Bore equipment: | • | n/a | | | | | | |
| Water level mea | surement: | | | | | | | |
| Reference point | elevation: | 2.05 m | | | | | | |
| Reference point | description: | Top of the PVC | Top of the PVC casing | | | | | |
| Measured depth | to water: | 3.33 | | | | | | |
| GWL elevation: | | 211.72 | | | | | | |
| Water quality m | easurement: | | | | | | | |
| Temperature (°C | ") | n/a | | | | | | |
| рН | | 7.46 | | | | | | |
| ORP (mV) | | n/a | | | | | | |
| EC (μS/cm) | | 2740 | | | | | | |
| TDS (mg/l) | | n/a | | | | | | |
| | | 1 | | | | | | |
| Date: | | 19/6/2014 | | | | | | |
| Time: | | 10:15 | | | | | | |







| Property / Landholder: | | Graeme Carl Sp | Graeme Carl Sparre | | | | | |
|------------------------|----------------|-----------------|---------------------|---------------|---------|--|--|--|
| Bore name | SPAR5 | Cad. Lot No: | 4 | Cad. Plan No: | DP21335 | | | |
| Easting: | 289875.92 | Northing: | 6433546.68 | Elevation: | 217.14 | | | |
| Bore constructi | ion: | | | | | | | |
| Bore diameter: | | 150 mm | | | | | | |
| Casing: | | steel | | | | | | |
| Bore depth: | | 3.95 m | | | | | | |
| Bore equipmen | nt / use: | • | | | | | | |
| Bore use: | | Not used, form | erly stock water | | | | | |
| Bore equipment | t: | n/a | | | | | | |
| Water level me | asurement: | | | | | | | |
| Reference point | t elevation: | 0.08 m | | | | | | |
| Reference point | t description: | Top of steel ca | Top of steel casing | | | | | |
| Measured dept | h to water: | 1.61 | | | | | | |
| GWL elevation: | | 215.61 | | | | | | |
| Water quality r | measurement: | | | | | | | |
| Temperature (° | <i>C</i>) | n/a | n/a | | | | | |
| рН | | 7.78 | | | | | | |
| ORP (mV) | | n/a | | | | | | |
| EC (μS/cm) | | 447 | | | | | | |
| TDS (mg/l) | | n/a | n/a | | | | | |
| Date: | | 19/6/2014 | | | | | | |
| Time: | | 10:55 | | | | | | |
| · · · · · · · · | | 1 10.00 | | | | | | |





| Property / Landholder: | | Anthone Denis Lonergan | | | | | |
|------------------------|-------------|------------------------|-------------------------------------|------------|--------|--|--|
| Bore name | DDH4 | Cad. Lot No: | Cad. Lot No: 101 Cad. Plan No: DP1: | | | | |
| Easting: | 291782.68 | Northing: | 6436624.36 | Elevation: | 257.16 | | |
| | | | | | | | |
| Bore construction: | • | 1 | | | | | |
| Bore diameter: | | 50 mm | | | | | |
| Casing: | | PVC | | | | | |
| Bore depth: | | 84.64 | | | | | |
| Bore equipment / | use: | | | | | | |
| Bore use: | | Monitoring | | | | | |
| Bore equipment: | | n/a | | | | | |
| Water level measu | ırement: | | | | | | |
| Reference point ele | evation: | 0.92 | | | | | |
| Reference point de | scription: | Top of PVC casing | | | | | |
| Measured depth to | water: | 39.8 | | | | | |
| GWL elevation: | | 218.28 | | | | | |
| Water quality mea | surament. | | | | | | |
| Temperature (°C) | isar ement. | n/a | | | | | |
| pH | | 7.74 | | | | | |
| ORP (mV) | | n/a | | | | | |
| EC (μS/cm) | | 3890 | | | | | |
| TDS (mg/l) | | n/a | | | | | |
| | | 1 | | | | | |
| Date: | | 18/6/2014 | | | | | |
| Time: 12:50 | | | | | | | |







| Property / Landholder: | | Coal & Allied O | Coal & Allied Operations Pty Ltd | | | | | |
|------------------------|-------------|-----------------|----------------------------------|---------------|----------|--|--|--|
| Bore name | CRRDH105 | Cad. Lot No: | 3 | Cad. Plan No: | DP998239 | | | |
| Easting: | 290674.30 | Northing: | 6432864.43 | Elevation: | 203.95 | | | |
| Bore construction | : | | | | | | | |
| Bore diameter: | - | 50 mm | | | | | | |
| Casing: | | PVC | | | | | | |
| Bore depth: | | 7.9 m | | | | | | |
| Bore equipment / | use: | • | | | | | | |
| Bore use: | | Monitoring | | | | | | |
| Bore equipment: | | n/a | | | | | | |
| Water level meas | urement: | | | | | | | |
| Reference point el | evation: | 2.12 | | | | | | |
| Reference point de | • | Top of the pvc | casing | | | | | |
| Measured depth to | o water: | 6.20 | | | | | | |
| GWL elevation: | | 199.87 | | | | | | |
| Water quality mea | asurement: | | | | | | | |
| Temperature (°C) | | n/a | n/a | | | | | |
| рН | | 7.17 | | | | | | |
| ORP (mV) | | n/a | | | | | | |
| EC (μS/cm) | | 962 | | | | | | |
| TDS (mg/l) | | n/a | | | | | | |
| | | | | | | | | |
| Date: | | 19/6/2014 | | | | | | |
| Time: | Time: 12:40 | | | | | | | |






| Property / Landholder: | | John Edward Lonergan, Johanna Lambertina Lonergan | | | | | | |
|------------------------|------------|---|--------------------------------------|------------|--------|--|--|--|
| Bore name | JLON2 | Cad. Lot No: | Cad. Lot No: 4 Cad. Plan No: DP58423 | | | | | |
| Easting: | 292318.84 | Northing: | 6434390.91 | Elevation: | 252.07 | | | |
| | | | | | | | | |
| Bore construction: | • | T | | | | | | |
| Bore diameter: | | 110 mm | | | | | | |
| Casing: | | Steel | | | | | | |
| Bore depth: | | 39.29 | | | | | | |
| Bore equipment / | use: | | | | | | | |
| Bore use: | | n/a formerly st | ock water | | | | | |
| Bore equipment: | | n/a formerly w | indmill | | | | | |
| Water level measu | rement: | | | | | | | |
| Reference point ele | evation: | 0.60 m | 0.60 m | | | | | |
| Reference point de | scription: | Top of steel casing | | | | | | |
| Measured depth to | water: | 29.48 | | | | | | |
| GWL elevation: | | 228.19 | | | | | | |
| Water quality mea | surement. | | | | | | | |
| Temperature (°C) | isarement. | n/a | | | | | | |
| pH | | 6.74 | | | | | | |
| ORP (mV) | | n/a | | | | | | |
| EC (μS/cm) | | 7570 | | | | | | |
| TDS (mg/l) | | n/a | | | | | | |
| | | | | | | | | |
| Date: | | 18/6/2014 | | | | | | |
| Time: 13:35 | | | | | | | | |





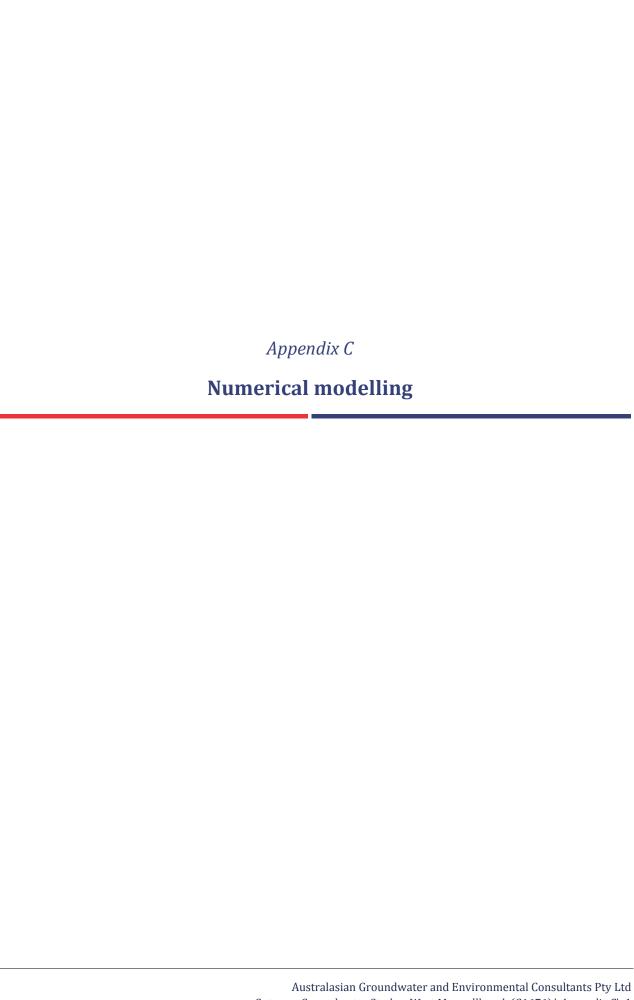

1. Model development and calibration

1.1 Model objectives

A numerical model was developed to assess the impacts of the Proposal on the surrounding groundwater environment. During the process of model development, the requirements of the NSW AIP were considered to ensure the model would predict the:

- volume of groundwater seepage from the highly productive aquifers to pits;
- drawdown (or water take) from highly productive alluvial aquifers of Sandy Creek North, Sandy Creek South, Spring Creek, Coal Creek, Dartbrook (Middle Brook and Kingdon Ponds) and the Hunter River;
- potential for drawdown in surrounding private landholder bores within and outside of PAA, drawdown in bores within the highly productive aquifer zones; and
- potential for changes in groundwater salinity.

1.2 Model design and construction

1.2.1 Conceptualisation

A conceptual understanding of the groundwater regime developed from field measurements, observations and experience is the basis for the development of any numerical groundwater flow model. Section 3 in the main body of this report describes the conceptual groundwater model of West Muswellbrook Project (WMB). The conceptual model describes how the groundwater system operates based upon the available information and represents the natural system in an idealised and simplified way.

1.2.2 Software used

The MODFLOW SURFACT code (referred to as SURFACT for the remainder of the report) was used to simulate of groundwater flow. SURFACT is a commercial derivative of the standard MODFLOW code and has some distinct advantages over the standard MODFLOW for simulating mining projects. Unlike original MODFLOW code, SURFACT can simulate variably saturated conditions, which is beneficial when representing dewatering of strata due to mining. SURFACT also includes adaptive time-steps, and robust numerical solver that helps it converge to a numerical solution.

The MODFLOW pre- and post-processor PMWIN (Chiang and Kinzelbach, 2001) was used to generate some of the input files for the SURFACT model. Where files differ to allow for the additional capabilities of SURFACT, these changes were undertaken through manual editing of the model files.

1.2.3 Model boundaries

The extent of the numerical model boundaries were selected to be sufficiently distant from the area of the proposed mining so as to not influence the drawdown predictions. These boundaries were set as follows:

- The south western model boundary was defined along the line of Mt. Ogilvie fault (in the southern part of the boundary) and it's perceived continuation due north-west. The fault line is considered to be a barrier to groundwater flow with very low permeability.
- The eastern boundary was defined along the subcrop line of Warkworth coal seam. As the target coal seams of the West Muswellbrook Project are Abby Green and Blakefield, incorporating underlying interburden and coal seams enables the modelling of the mining impacts on those layers. The impact of mining in the WMB area is not expected to extend past the Warkworth coal seam outcrop line.

- The northern boundary is an arbitrary cut-off line set in such a distance from the Project so that the mining impacts are unlikely to reach it.
- Southern boundary was placed to the southern edge of Hunter River alluvium (between Mt. Ogilvie fault line in the west and Warkworth seam subcrop line in the east).

1.2.4 Topographic surface and drainage

A publicly available one-second smoothed digital elevation model (DEM-S) with a 30×30 m grid spacing (Gallant *et al.*, 2011) was used to represent the ground surface throughout the model domain. This dataset was merged with a detailed LIDAR derived digital elevation model (provided by client) covering the area of the Project. Further analysis of the DEM-S was conducted (using 1 km² watershed) in order to extract the drainage network. Extracted drainage lines follow the line of lowest topographic surface and were used to define surface drainage and river boundary conditions in the model.

1.2.5 Model layers

The model represents following geologic layers:

- Layer 1 topsoil and alluvium;
- Layer 2 weathered rock (regolith) base defined as base of weathering;
- Layer 3 consolidated sediments of Narrabeen Formation base at the floor of Hawkesbury Sandstone;
- Layer 4 interburden consolidated sediments between Hawkesbury Sandstone and top of Abby Green seam;
- Layer 5 Abby Green seam combined thickness of Abby Green upper and lower seams
- Layer 6 interburden;
- Layer 7 coal seam representing combined thickness of Whybrow, Redbank, Wambo seams. Layer base located at the base of Wambo seam;
- Layer 8 interburden:
- Layer 9 combined Whynot and Blakefield coal seam (target of WMP mining operations). Layer base coincident with Blakefield seam base;
- Layer 10 interburden; and
- Layer 11 combined thickness of Glen Munro, Woodlands Hill, Arrowfield/Bowfield and Warkworth seams. Layer base coincident with base of Warkworth seam.

Figure C 1 to Figure C 3 present the floor contours for the coal seam floors in the model. Table C 1 summarises the thickness of each model layer.

Table C 1 Overview of model layer thickness

| | | Th | ickness | (m) | | |
|-------|-------------------------------------|-----------------|------------|-----------------|-------|---|
| Layer | Min | 1st quartile | Mean | 3rd quartile | Max | Comment |
| L01 | 0.5 m | - topsoil; va | riable thi | ckness in all | uvium | topsoil / alluvium / colluvium |
| L02 | 1.0 | 16.8 | 17.9 | 19.3 | 44.7 | weathered profile / colluvium |
| L03 | 2.0 | 188.5 | 244.6 | 317.7 | 455.6 | Narrabeen Formation - layer base at Hawkesbury Sandstone floor |
| L04 | 2.0 | 132.8 | 248.0 | 360.8 | 427.8 | Interburden |
| L05 | 4.5 m - combined uniform thickness | | | hickness | | coal seam - combined Abby Green - layer base at Abby Green Lower floor |
| L06 | 2.0 | 41.5 | 53.3 | 66.4 | 99.3 | Interburden |
| L07 | 7.0 m | - combined | uniform t | hickness | | coal seam - combined Whybrow, Redbank, Wambo - layer base at Wambo floor |
| L08 | 2.0 | 61.3 | 61.1 | 69.6 | 93.9 | Interburden |
| L09 | 5.0 m - combined uniform thickness | | | hickness | | coal seam - combined Whynot, Blakefield - layer base at Blakefield floor |
| L10 | 2.0 | 117.0 | 134.5 | 155.2 | 265.5 | Interburden |
| L11 | 16.0 m - combined uniform thickness | | | thickness | | coal seam - combined Glen Munro, Woodlands Hill, Arrowfield/Bowfield, Warkworth - layer base at Warkworth floor |

1.2.6 Model grid extent

The model grid consisted of 25,132 cells per model layer (122 columns, 206 rows, 20640 active cells per layer, 11 layers). The upper left corner of the grid was set at coordinates: x = 282490, y = 6451270 (GDA94, MGA zone 56) and was not rotated. The cell size varied from a minimum of 100×100 m in the mining areas to a maximum of 250×250 m outside these zones. Figure C 4 shows the grid and active model domain, as well as the refined grid over the Project Assessment Area (PAA).


1.2.7 Time

The model used days as the unit of time, and simulated the following periods of time:

- January 2004 to December 2013 10 years baseline period. This time period was used to calibrate the model. Once calibrated this period was used to simulate baseline conditions prior to commencement of mining. Stress period length was one month.
- 30 year mining period. Stress period length 1 month.


Base of Layer 3 - Narrabeen Group (Hawkesbury Sandstone)


Base of Layer 5 - Abby Green

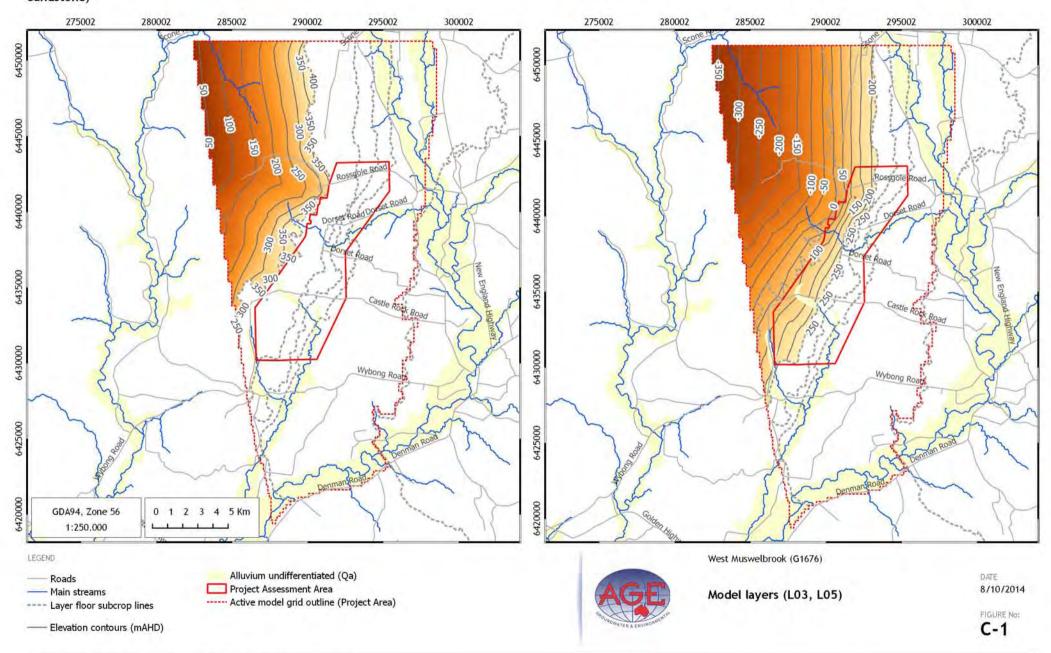


Base of Layer 7 - Wambo

Base of Layer 9 - Blakefield

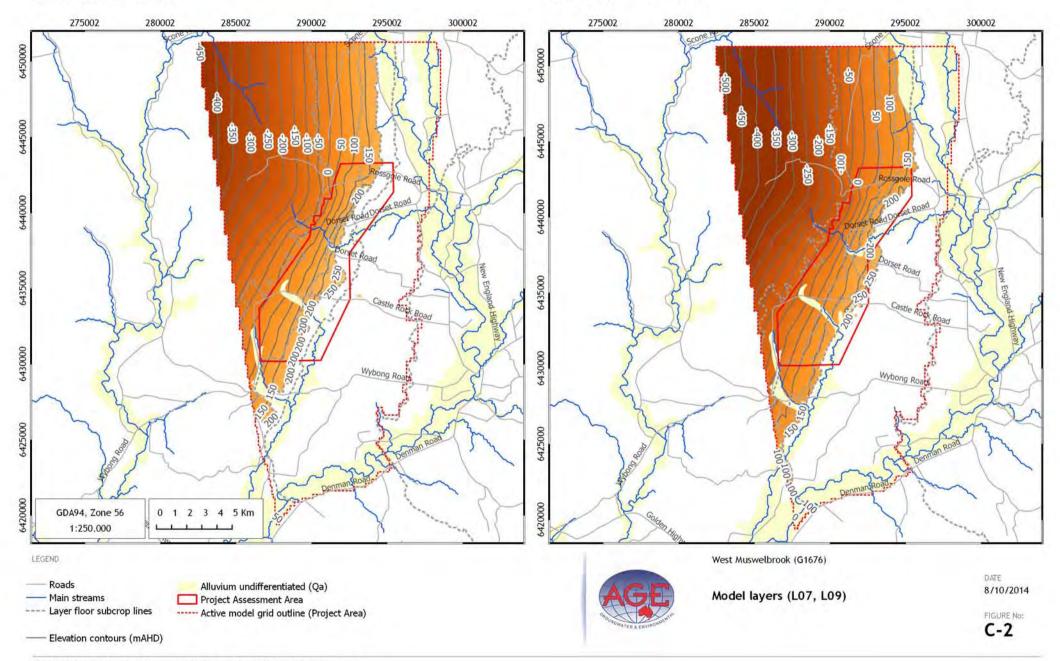

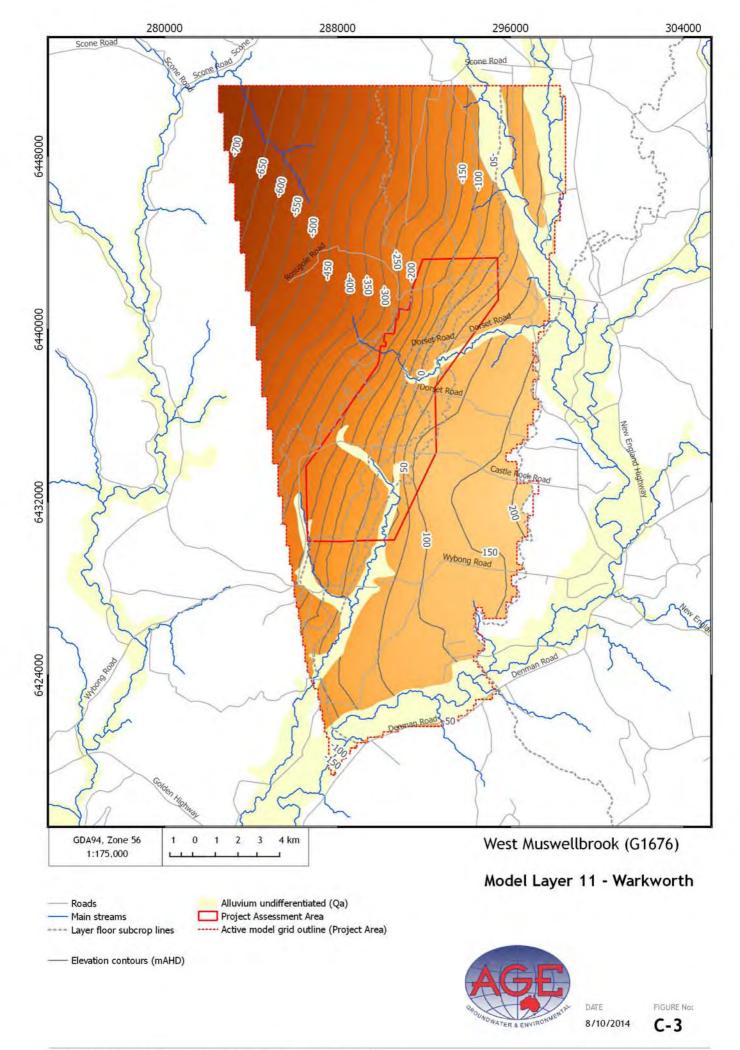

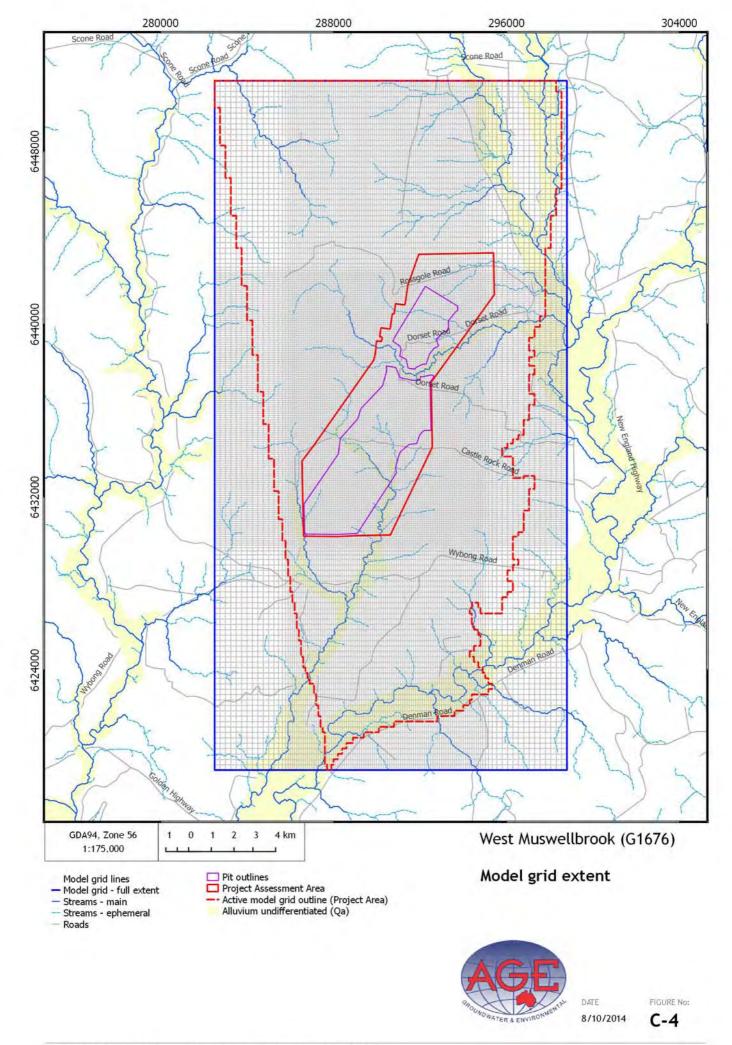

1.2.8 Boundary conditions - river and streams

The SURFACT RIV (river) package was used to represent the surface drainage (both permanent rivers and ephemeral streams) within the active model domain. The river package was set as a transient boundary with variable stage in multiple river/stream reaches. See Table C 4 for the overview of stage elevation change for individual reaches of the stream network during the lead-in (calibration) model period.

Drainage reaches were defined using the available stream gauge data or alluviual groundwater table elevation in designated bores. Refer

Figure C 5 for the location of river cells/reaches:

- Reach 1 ephemeral streams river cells dry; 'drain' mode stage always 0.0 m, elevation of head defined for each cell identical to elevation of stream bed.
- Reach 2 Sandy Creek North (middle) river stage derived from the groundwater level measurement in piezometer RHRDH211. All stage data below 0.12 m considered to be below the ground surface (stream dry, stage set to 0.0 m).
- Reach 3 Sandy Creek North (lower).
- Reach 4 Sandy Creek South (middle) river stage derived from the groundwater level measurement in piezometer CRD107. All stage data below 0.12 m considered to be below the ground surface (stream dry, stage set to 0.0 m).
- Reach 5 Sandy Creek South (lower) derived from stage in Reach 4 (added 0.1 m)
- Reach 6 Dart brook.
- *Reach 7* Kingdon Ponds.
- Reach 8 Hunter River.

Stream bed elevation for individual cell was acquired from DEM-S analysis (see Section 1.2.4 above) and then rectified using the DGPS survey data. See Table C 2 for the overview of stream bed elevation error.

Table C 2 RIV cells stream bed elevation error

| Stream catchment | Stream reach | Cell row | Cell column | Bed elevation DEM (m RL) | Bed elevation surveyed (m RL) | Bed elevation error (m) |
|---------------------|-----------------|-------------|----------------|--------------------------------|-------------------------------------|-------------------------------|
| Dartbrook | 1 | 45 | 118 | 168.9 | 166.4 | -2.5 |
| Sandy Creek North | 1 | 64 | 98 | 195.4 | 196.3 | 0.9 |
| Sandy Creek North | 1 | 67 | 90 | 206.4 | 205.6 | -0.8 |
| Sandy Creek North | 1 | 80 | 67 | 233.2 | 230.7 | -2.5 |
| Sandy Creek North | 1 | 80 | 68 | 232.1 | 232.7 | 0.6 |
| Sandy Creek North | 1 | 94 | 97 | 220.4 | 220.5 | 0.1 |
| Sandy Creek North | 1 | 96 | 99 | 229.7 | 222.5 | -7.2 |
| Sandy Creek North | 2 | 84 | 70 | 226.8 | 228.6 | 1.8 |
| Sandy Creek North | 3 | 60 | 115 | 173.9 | 170.1 | -3.8 |

| Stream catchment | Stream reach | Cell row | Cell column | Bed elevation DEM (m RL) | Bed elevation surveyed (m RL) | Bed elevation error (m) |
|---------------------|-----------------|-------------|----------------|--------------------------------|-------------------------------------|-------------------------------|
| Sandy Creek South | 1 | 113 | 38 | 250.8 | 252.1 | 1.3 |
| Sandy Creek South | 1 | 117 | 64 | 221.2 | 220.5 | -0.7 |
| Sandy Creek South | 1 | 122 | 53 | 221.8 | 222.7 | 0.9 |
| Sandy Creek South | 1 | 127 | 56 | 215.3 | 213.6 | -1.7 |
| Sandy Creek South | 1 | 133 | 61 | 204.1 | 200.6 | -3.5 |
| Sandy Creek South | 4 | 147 | 59 | 185.5 | 186.6 | 1.1 |
| Sandy Creek South | 5 | 171 | 48 | 157.7 | 156.8 | -0.9 |
| Sandy Creek South | 5 | 189 | 26 | 133.4 | 134.0 | 0.6 |
| Spring Creek | 1 | 121 | 21 | 251.3 | 252.4 | 1.1 |
| Spring Creek | 1 | 137 | 19 | 229.7 | 225.5 | -4.2 |
| Spring Creek | 1 | 172 | 30 | 165.3 | 164.1 | -1.2 |

Stream bed conductance for individual river is cells is calculated using the stream length within particular cell (derived from GIS analysis), width of the stream, stream bed thickness and stream bed vertical conductivity. River cell parameters are presented in Table C 3.

 Table C 3
 RIV boundary condition – parametres

| Stream reach | Stream width (m) | Stream bed thickness (m) | Stream bed vert. conductivity (m/day) |
|--|------------------------|--------------------------------|---|
| Reach 1 - ephemeral streams / other drains | 5.00 | 1.00 | 0.10 |
| Reach 2 - Sandy Crk N - middle | 5.00 | 2.00 | 0.10 |
| Reach 3 - Sandy Crk N - lower | 7.00 | 2.00 | 0.10 |
| Reach 4 - Sandy Crk S - middle | 5.00 | 2.00 | 0.10 |
| Reach 5 - Sandy Crk S - lower | 7.00 | 2.00 | 0.10 |
| Reach 6 - Dartbrook | 7.00 | 2.50 | 0.10 |
| Reach 7 - Kingdon Ponds | 7.00 | 3.00 | 0.10 |
| Reach 8 - Hunter River | 10.00 | 4.00 | 0.10 |

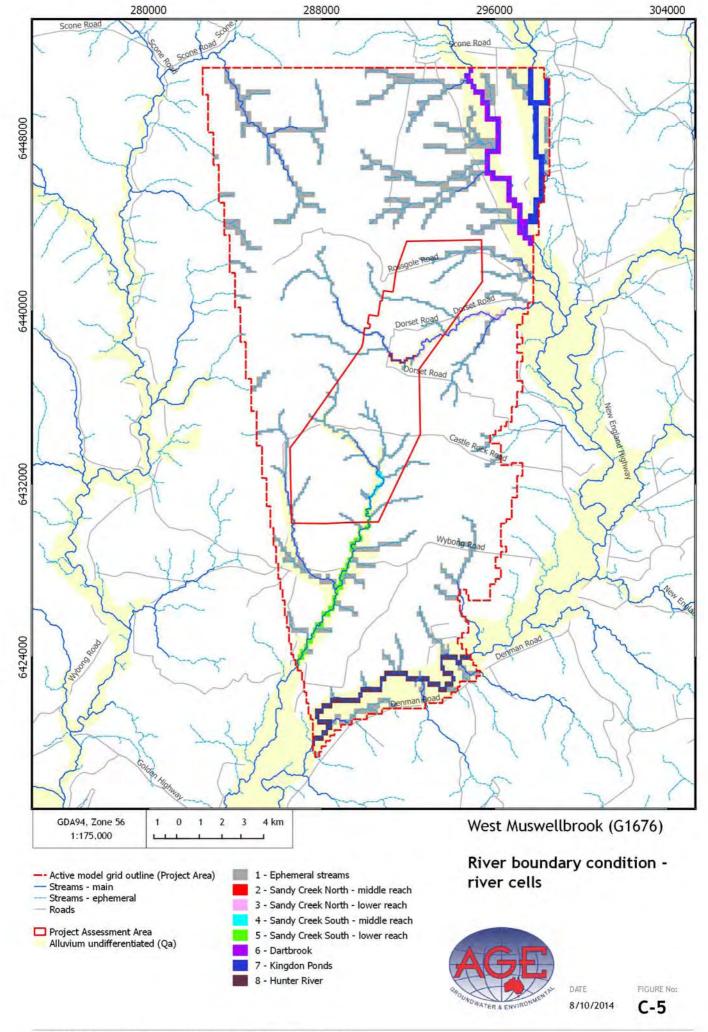


Table C 4 RIV Reaches – transient stage during model calibration period

| Stress period | Date | | | | | am reach (| | - | |
|---------------|----------|---------|---------|---------|---------|------------|---------|---------|---------|
| | | Reach 1 | Reach 2 | Reach 3 | Reach 4 | Reach 5 | Reach 6 | Reach 7 | Reach 8 |
| 1 | Jan 2004 | 0.000 | 0.000 | 0.000 | 0.979 | 1.079 | 0.184 | 0.114 | 1.023 |
| 2 | Feb 2004 | 0.000 | 0.000 | 0.000 | 0.979 | 1.079 | 0.224 | 0.153 | 0.957 |
| 3 | Mar 2004 | 0.000 | 0.000 | 0.000 | 0.979 | 1.079 | 0.330 | 0.387 | 0.862 |
| 4 | Apr 2004 | 0.000 | 0.000 | 0.000 | 0.979 | 1.079 | 0.221 | 0.410 | 0.823 |
| 5 | May 2004 | 0.000 | 0.000 | 0.000 | 0.979 | 1.079 | 0.178 | 0.420 | 0.826 |
| 6 | Jun 2004 | 0.000 | 0.000 | 0.000 | 0.979 | 1.079 | 0.160 | 0.420 | 0.788 |
| 7 | Jul 2004 | 0.000 | 0.000 | 0.000 | 0.979 | 1.079 | 0.159 | 0.428 | 0.830 |
| 8 | Aug 2004 | 0.000 | 0.000 | 0.000 | 0.979 | 1.079 | 0.159 | 0.411 | 0.860 |
| 9 | Sep 2004 | 0.000 | 0.000 | 0.000 | 0.979 | 1.079 | 0.215 | 0.411 | 0.884 |
| 10 | Oct 2004 | 0.000 | 0.000 | 0.000 | 0.979 | 1.079 | 0.220 | 0.415 | 1.022 |
| 11 | Nov 2004 | 0.000 | 0.000 | 0.000 | 0.979 | 1.079 | 0.247 | 0.410 | 0.881 |
| 12 | Dec 2004 | 0.000 | 0.000 | 0.000 | 0.979 | 1.079 | 0.189 | 0.419 | 1.057 |
| 13 | Jan 2005 | 0.000 | 0.000 | 0.000 | 0.959 | 1.059 | 0.181 | 0.410 | 1.061 |
| 14 | Feb 2005 | 0.000 | 0.000 | 0.000 | 0.938 | 1.038 | 0.172 | 0.407 | 0.949 |
| 15 | Mar 2005 | 0.000 | 0.000 | 0.000 | 0.919 | 1.019 | 0.166 | 0.362 | 0.936 |
| 16 | Apr 2005 | 0.000 | 0.000 | 0.000 | 0.897 | 0.997 | 0.158 | 0.341 | 0.895 |
| 17 | May 2005 | 0.000 | 0.000 | 0.000 | 0.897 | 0.997 | 0.157 | 0.345 | 0.929 |
| 18 | Jun 2005 | 0.000 | 0.000 | 0.000 | 0.877 | 0.977 | 0.166 | 0.345 | 0.891 |
| 19 | Jul 2005 | 0.000 | 0.000 | 0.000 | 0.858 | 0.958 | 0.290 | 0.345 | 0.891 |
| 20 | Aug 2005 | 0.000 | 0.000 | 0.000 | 0.834 | 0.934 | 0.250 | 0.342 | 0.808 |
| 21 | Sep 2005 | 0.000 | 0.000 | 0.000 | 0.817 | 0.917 | 0.202 | 0.339 | 0.863 |
| 22 | Oct 2005 | 0.000 | 0.000 | 0.000 | 0.819 | 0.919 | 0.246 | 0.325 | 0.924 |
| 23 | Nov 2005 | 0.000 | 0.000 | 0.000 | 0.796 | 0.896 | 0.209 | 0.317 | 0.999 |
| 24 | Dec 2005 | 0.000 | 0.000 | 0.000 | 0.776 | 0.876 | 0.204 | 0.300 | 1.028 |
| 25 | Jan 2006 | 0.000 | 0.000 | 0.000 | 0.756 | 0.856 | 0.167 | 0.290 | 1.114 |
| 26 | Feb 2006 | 0.000 | 0.000 | 0.000 | 0.748 | 0.848 | 0.160 | 0.274 | 1.145 |
| 27 | Mar 2006 | 0.000 | 0.000 | 0.000 | 0.779 | 0.879 | 0.159 | 0.294 | 1.120 |
| 28 | Apr 2006 | 0.000 | 0.000 | 0.000 | 0.773 | 0.873 | 0.155 | 0.322 | 1.101 |
| 29 | May 2006 | 0.000 | 0.000 | 0.000 | 0.792 | 0.892 | 0.150 | 0.340 | 1.043 |
| 30 | Jun 2006 | 0.000 | 0.000 | 0.000 | 0.613 | 0.713 | 0.151 | 0.345 | 0.876 |

| Stress period | Date | | | Sta | ge for stre | am reach (| (m) | | |
|---------------|----------|---------|---------|---------|-------------|------------|---------|---------|---------|
| | | Reach 1 | Reach 2 | Reach 3 | Reach 4 | Reach 5 | Reach 6 | Reach 7 | Reach 8 |
| 31 | Jul 2006 | 0.000 | 0.000 | 0.000 | 0.535 | 0.635 | 0.153 | 0.346 | 0.966 |
| 32 | Aug 2006 | 0.000 | 0.000 | 0.000 | 0.392 | 0.492 | 0.161 | 0.352 | 0.948 |
| 33 | Sep 2006 | 0.000 | 0.000 | 0.000 | 0.247 | 0.347 | 0.167 | 0.327 | 0.928 |
| 34 | Oct 2006 | 0.000 | 0.000 | 0.000 | 0.135 | 0.235 | 0.076 | 0.117 | 0.951 |
| 35 | Nov 2006 | 0.000 | 0.000 | 0.000 | 0.964 | 1.064 | 0.094 | 0.110 | 0.972 |
| 36 | Dec 2006 | 0.000 | 0.000 | 0.000 | 0.323 | 0.423 | 0.017 | 0.085 | 0.759 |
| 37 | Jan 2007 | 0.000 | 0.000 | 0.000 | 0.927 | 1.027 | 0.007 | 0.089 | 0.768 |
| 38 | Feb 2007 | 0.000 | 0.000 | 0.000 | 0.183 | 0.283 | 0.011 | 0.088 | 0.694 |
| 39 | Mar 2007 | 0.000 | 0.000 | 0.000 | 0.285 | 0.385 | 0.013 | 0.085 | 0.665 |
| 40 | Apr 2007 | 0.000 | 0.294 | 0.294 | 0.342 | 0.442 | 0.013 | 0.082 | 0.687 |
| 41 | May 2007 | 0.000 | 0.295 | 0.295 | 0.293 | 0.393 | 0.011 | 0.107 | 0.696 |
| 42 | Jun 2007 | 0.000 | 0.328 | 0.328 | 0.293 | 0.393 | 0.445 | 0.529 | 1.302 |
| 43 | Jul 2007 | 0.000 | 0.328 | 0.328 | 0.243 | 0.343 | 0.299 | 0.469 | 0.709 |
| 44 | Aug 2007 | 0.000 | 0.472 | 0.472 | 0.167 | 0.267 | 0.296 | 0.447 | 0.766 |
| 45 | Sep 2007 | 0.000 | 0.343 | 0.343 | 0.675 | 0.775 | 0.217 | 0.421 | 0.544 |
| 46 | Oct 2007 | 0.000 | 0.356 | 0.356 | 0.625 | 0.725 | 0.174 | 0.404 | 0.532 |
| 47 | Nov 2007 | 0.000 | 0.334 | 0.334 | 0.452 | 0.552 | 0.186 | 0.422 | 0.663 |
| 48 | Dec 2007 | 0.000 | 0.327 | 0.327 | 0.479 | 0.579 | 0.413 | 0.682 | 1.102 |
| 49 | Jan 2008 | 0.000 | 0.335 | 0.335 | 0.377 | 0.477 | 0.311 | 0.480 | 0.760 |
| 50 | Feb 2008 | 0.000 | 0.329 | 0.329 | 0.485 | 0.585 | 0.328 | 0.478 | 0.976 |
| 51 | Mar 2008 | 0.000 | 0.336 | 0.336 | 0.536 | 0.636 | 0.234 | 0.454 | 0.746 |
| 52 | Apr 2008 | 0.000 | 0.348 | 0.348 | 0.453 | 0.553 | 0.228 | 0.449 | 0.748 |
| 53 | May 2008 | 0.000 | 0.391 | 0.391 | 0.944 | 1.044 | 0.214 | 0.434 | 0.547 |
| 54 | Jun 2008 | 0.000 | 0.384 | 0.384 | 0.927 | 1.027 | 0.411 | 0.558 | 0.978 |
| 55 | Jul 2008 | 0.000 | 0.398 | 0.398 | 0.763 | 0.863 | 0.282 | 0.513 | 0.672 |
| 56 | Aug 2008 | 0.000 | 0.385 | 0.385 | 0.684 | 0.784 | 0.248 | 0.515 | 0.661 |
| 57 | Sep 2008 | 0.000 | 0.355 | 0.355 | 0.639 | 0.739 | 0.464 | 0.575 | 1.254 |
| 58 | Oct 2008 | 0.000 | 0.328 | 0.328 | 0.864 | 0.964 | 0.312 | 0.492 | 0.756 |
| 59 | Nov 2008 | 0.000 | 0.346 | 0.346 | 0.600 | 0.700 | 0.259 | 0.473 | 0.690 |
| 60 | Dec 2008 | 0.000 | 0.364 | 0.364 | 0.437 | 0.537 | 0.309 | 0.505 | 0.869 |
| 61 | Jan 2009 | 0.000 | 0.362 | 0.362 | 0.151 | 0.251 | 0.188 | 0.468 | 0.615 |

| Stress period | Date | | | Sta | ge for stre | am reach (| (m) | | |
|---------------|----------|---------|---------|---------|-------------|------------|---------|---------|---------|
| | | Reach 1 | Reach 2 | Reach 3 | Reach 4 | Reach 5 | Reach 6 | Reach 7 | Reach 8 |
| 62 | Feb 2009 | 0.000 | 0.322 | 0.322 | 0.126 | 0.226 | 0.415 | 0.540 | 1.052 |
| 63 | Mar 2009 | 0.000 | 0.139 | 0.139 | 0.129 | 0.229 | 0.371 | 0.485 | 0.537 |
| 64 | Apr 2009 | 0.000 | 0.000 | 0.000 | 0.126 | 0.226 | 0.319 | 0.475 | 0.780 |
| 65 | May 2009 | 0.000 | 0.000 | 0.000 | 0.000 | 0.100 | 0.290 | 0.474 | 0.773 |
| 66 | Jun 2009 | 0.000 | 0.000 | 0.000 | 0.000 | 0.100 | 0.267 | 0.481 | 0.938 |
| 67 | Jul 2009 | 0.000 | 0.000 | 0.000 | 0.000 | 0.100 | 0.256 | 0.480 | 0.605 |
| 68 | Aug 2009 | 0.000 | 0.000 | 0.000 | 0.000 | 0.100 | 0.212 | 0.490 | 0.548 |
| 69 | Sep 2009 | 0.000 | 0.000 | 0.000 | 0.000 | 0.100 | 0.180 | 0.519 | 0.599 |
| 70 | Oct 2009 | 0.000 | 0.000 | 0.000 | 0.000 | 0.100 | 0.170 | 0.554 | 0.661 |
| 71 | Nov 2009 | 0.000 | 0.000 | 0.000 | 0.000 | 0.100 | 0.182 | 0.556 | 0.756 |
| 72 | Dec 2009 | 0.000 | 0.000 | 0.000 | 0.000 | 0.100 | 0.157 | 0.515 | 0.824 |
| 73 | Jan 2010 | 0.000 | 0.000 | 0.000 | 0.000 | 0.100 | 0.241 | 0.478 | 0.774 |
| 74 | Feb 2010 | 0.000 | 0.000 | 0.000 | 0.000 | 0.100 | 0.175 | 0.459 | 0.679 |
| 75 | Mar 2010 | 0.000 | 0.000 | 0.000 | 0.496 | 0.596 | 0.181 | 0.447 | 0.770 |
| 76 | Apr 2010 | 0.000 | 0.000 | 0.000 | 0.293 | 0.393 | 0.274 | 0.477 | 1.028 |
| 77 | May 2010 | 0.000 | 0.000 | 0.000 | 0.525 | 0.625 | 0.175 | 0.489 | 1.038 |
| 78 | Jun 2010 | 0.000 | 0.000 | 0.000 | 0.744 | 0.844 | 0.311 | 0.494 | 0.879 |
| 79 | Jul 2010 | 0.000 | 0.000 | 0.000 | 0.715 | 0.815 | 0.398 | 0.544 | 0.851 |
| 80 | Aug 2010 | 0.000 | 0.286 | 0.286 | 0.683 | 0.783 | 0.399 | 0.638 | 1.187 |
| 81 | Sep 2010 | 0.000 | 0.279 | 0.279 | 0.589 | 0.689 | 0.355 | 0.575 | 0.731 |
| 82 | Oct 2010 | 0.000 | 0.286 | 0.286 | 0.454 | 0.554 | 0.393 | 0.593 | 0.715 |
| 83 | Nov 2010 | 0.000 | 0.283 | 0.283 | 0.536 | 0.636 | 0.476 | 0.707 | 1.119 |
| 84 | Dec 2010 | 0.000 | 0.256 | 0.256 | 0.669 | 0.769 | 0.436 | 0.609 | 0.987 |
| 85 | Jan 2011 | 0.000 | 0.292 | 0.292 | 0.727 | 0.827 | 0.320 | 0.541 | 0.590 |
| 86 | Feb 2011 | 0.000 | 0.145 | 0.145 | 0.834 | 0.934 | 0.222 | 0.516 | 0.626 |
| 87 | Mar 2011 | 0.000 | 0.292 | 0.292 | 0.434 | 0.534 | 0.195 | 0.513 | 0.657 |
| 88 | Apr 2011 | 0.000 | 0.363 | 0.363 | 0.373 | 0.473 | 0.201 | 0.518 | 1.137 |
| 89 | May 2011 | 0.000 | 0.448 | 0.448 | 0.177 | 0.277 | 0.216 | 0.531 | 0.623 |
| 90 | Jun 2011 | 0.000 | 0.458 | 0.458 | 0.000 | 0.100 | 0.405 | 0.570 | 1.374 |
| 91 | Jul 2011 | 0.000 | 0.442 | 0.442 | 0.000 | 0.100 | 0.262 | 0.532 | 0.963 |
| 92 | Aug 2011 | 0.000 | 0.455 | 0.455 | 0.000 | 0.100 | 0.291 | 0.540 | 1.145 |

| Stress period | Date | | | Sta | ge for stre | am reach (| (m) | | |
|---------------|----------|---------|---------|---------|-------------|------------|---------|---------|---------|
| | | Reach 1 | Reach 2 | Reach 3 | Reach 4 | Reach 5 | Reach 6 | Reach 7 | Reach 8 |
| 93 | Sep 2011 | 0.000 | 0.484 | 0.484 | 0.000 | 0.100 | 0.285 | 0.569 | 1.104 |
| 94 | Oct 2011 | 0.000 | 0.542 | 0.542 | 0.000 | 0.100 | 0.306 | 0.618 | 0.866 |
| 95 | Nov 2011 | 0.000 | 0.535 | 0.535 | 0.198 | 0.298 | 0.397 | 0.682 | 0.975 |
| 96 | Dec 2011 | 0.000 | 0.488 | 0.488 | 0.129 | 0.229 | 0.397 | 0.606 | 0.921 |
| 97 | Jan 2012 | 0.000 | 0.466 | 0.466 | 0.195 | 0.295 | 0.253 | 0.582 | 0.720 |
| 98 | Feb 2012 | 0.000 | 0.437 | 0.437 | 0.167 | 0.267 | 0.507 | 0.666 | 1.389 |
| 99 | Mar 2012 | 0.000 | 0.417 | 0.417 | 0.131 | 0.231 | 0.458 | 0.653 | 1.164 |
| 100 | Apr 2012 | 0.000 | 0.444 | 0.444 | 0.000 | 0.100 | 0.302 | 0.553 | 0.654 |
| 101 | May 2012 | 0.000 | 0.456 | 0.456 | 0.128 | 0.228 | 0.293 | 0.546 | 0.591 |
| 102 | Jun 2012 | 0.000 | 0.452 | 0.452 | 0.122 | 0.222 | 0.379 | 0.530 | 0.852 |
| 103 | Jul 2012 | 0.000 | 0.351 | 0.351 | 0.000 | 0.100 | 0.447 | 0.583 | 1.106 |
| 104 | Aug 2012 | 0.000 | 0.155 | 0.155 | 0.000 | 0.100 | 0.309 | 0.528 | 0.873 |
| 105 | Sep 2012 | 0.000 | 0.000 | 0.000 | 0.179 | 0.279 | 0.260 | 0.520 | 0.556 |
| 106 | Oct 2012 | 0.000 | 0.000 | 0.000 | 0.494 | 0.594 | 0.221 | 0.497 | 0.553 |
| 107 | Nov 2012 | 0.000 | 0.000 | 0.000 | 0.132 | 0.232 | 0.209 | 0.483 | 0.607 |
| 108 | Dec 2012 | 0.000 | 0.000 | 0.000 | 0.396 | 0.496 | 0.204 | 0.478 | 0.635 |
| 109 | Jan 2013 | 0.000 | 0.450 | 0.450 | 0.313 | 0.413 | 0.325 | 0.526 | 0.887 |
| 110 | Feb 2013 | 0.000 | 0.449 | 0.449 | 0.293 | 0.393 | 0.640 | 0.571 | 0.809 |
| 111 | Mar 2013 | 0.000 | 0.423 | 0.423 | 0.184 | 0.284 | 0.575 | 0.678 | 1.150 |
| 112 | Apr 2013 | 0.000 | 0.268 | 0.268 | 0.277 | 0.377 | 0.368 | 0.592 | 0.514 |
| 113 | May 2013 | 0.000 | 0.629 | 0.629 | 0.331 | 0.431 | 0.348 | 0.582 | 0.654 |
| 114 | Jun 2013 | 0.000 | 0.000 | 0.000 | 0.374 | 0.474 | 0.375 | 0.563 | 0.656 |
| 115 | Jul 2013 | 0.000 | 0.545 | 0.545 | 0.713 | 0.813 | 0.425 | 0.555 | 0.643 |
| 116 | Aug 2013 | 0.000 | 0.441 | 0.441 | 0.449 | 0.549 | 0.334 | 0.545 | 0.552 |
| 117 | Sep 2013 | 0.000 | 0.000 | 0.000 | 0.449 | 0.549 | 0.309 | 0.561 | 0.588 |
| 118 | Oct 2013 | 0.000 | 0.000 | 0.000 | 0.449 | 0.549 | 0.320 | 0.595 | 0.692 |
| 119 | Nov 2013 | 0.000 | 0.000 | 0.000 | 0.449 | 0.549 | 0.346 | 0.579 | 0.862 |
| 120 | Dec 2013 | 0.000 | 0.000 | 0.000 | 0.449 | 0.549 | 0.274 | 0.506 | 0.637 |

1.2.9 Boundary condition - recharge

The SURFACT recharge package (RCH) was used to simulate the recharge boundary condition. The rate of recharge was calculated using two SILO daily rainfall datasets, processed to provide monthly transient data:

- Aberdeen Main Road (station no: 61000) measured daily rainfall; and
- Aberdeen Rossgole (interpolated daily rainfall datadrill location latitude: -32.10°, longitude: 150.75°, elevation: 524 m)

Each of the rainfall datasets were used as an input for simple soil moisture/recharge model (see Section 3.5.1 of this document) and three transient base recharge datasets were calculated:

- Base RCH 1 for top of the Rossgole plateau (basalts, sandstones);
- Base RCH 2 for slope colluvium; and
- Base RCH 3 for downslope areas (topsoil, regolith, alluvium zones).

Additionally, ten recharge zones (Figure C 6) were used to distribute the recharge spatially. The model applied recharge over the calibration period as a fixed proportion (recharge factor for individual recharge zone) of one of the three the base recharge datasets, as described above. See Table C 5 for list of recharge zones and associated base recharge datasets and recharge factors. See Table C 6 for the actual transient base recharge values.

Table C 5 Recharge zones, associated recharge factors and corresponding base RCH dataset

| Recharge zone | Recharge factor | Applied to base RCH dataset |
|---|-----------------|-----------------------------|
| zone 01 - topsoil/regolith | 0.050 | 3 |
| zone 02 - alluvium - Hunter River | 1.000 | 3 |
| zone 03 - alluvium - Dartbrook, Middle Brook, Kingdon Ponds | 1.000 | 3 |
| zone 04 - alluvium - Sandy Crk North | 1.000 | 3 |
| zone 05 - alluvium - Sandy Crk South | 1.000 | 3 |
| zone 06 - basalts, sandstone - top of the plateau | 1.000 | 1 |
| zone 07 - cliff face | 0.000 | 1 |
| zone 08 - slope colluvium - general | 0.800 | 3 |
| zone 09 - slope colluvium to alluvium feed-in | 1.000 | 2 |
| zone 10 - coal seam subcrop/outcrop | 0.100 | 3 |

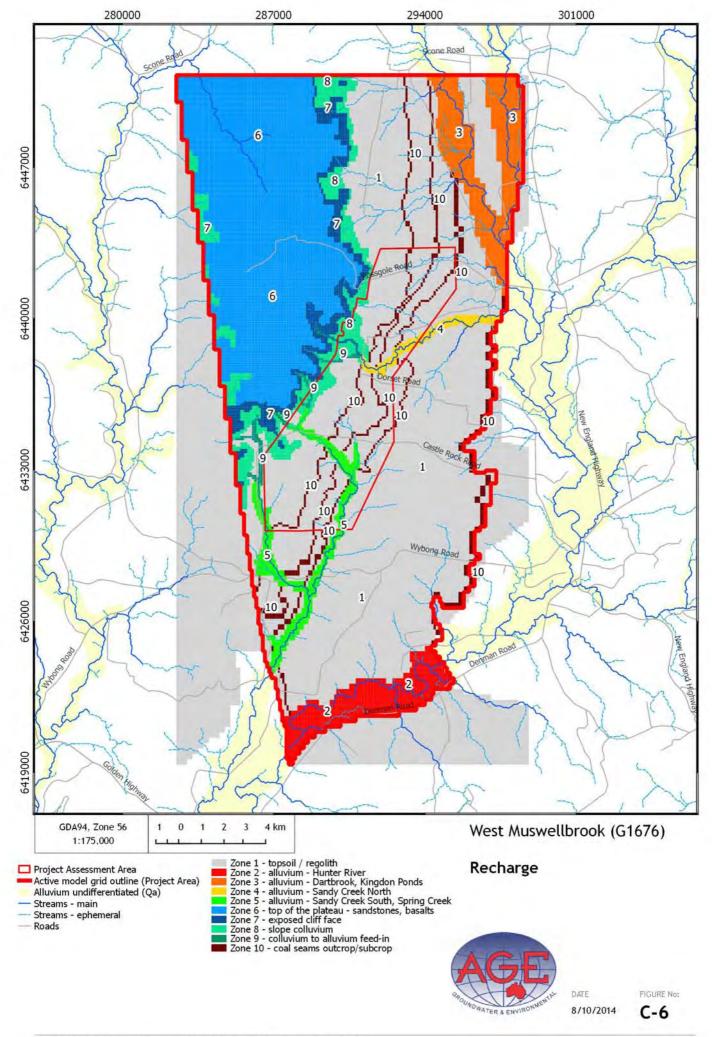


 Table C 6
 Base transient recharge rates

| | - | | | | | | nge rates | | |
|----------|----|-----------------------|-----------------------|-----------------------|----------|------------|-----------------------|-----------------------|-----------------------|
| Date | SP | Base RCH1 (mm/day) | Base RCH2 (mm/day) | Base RCH3 (mm/day) | Date | SP | Base RCH1 (mm/day) | Base RCH2 (mm/day) | Base RCH3 (mm/day) |
| Jan 2004 | 1 | 0.000000 | 0.000000 | 0.000000 | Jan 2009 | 61 | 0.000000 | 0.000000 | 0.000000 |
| Feb 2004 | 2 | 0.000000 | 0.000000 | 0.000000 | Feb 2009 | 62 | 0.561765 | 1.796345 | 1.375168 |
| Mar 2004 | 3 | 0.000000 | 0.000000 | 0.000000 | Mar 2009 | 63 | 0.000000 | 0.000000 | 0.000000 |
| Apr 2004 | 4 | 0.000000 | 0.000000 | 0.000000 | Apr 2009 | 64 | 0.000000 | 0.000000 | 0.000000 |
| May 2004 | 5 | 0.000000 | 0.000000 | 0.000000 | May 2009 | 65 | 0.000000 | 0.000000 | 0.000000 |
| Jun 2004 | 6 | 0.000000 | 0.000000 | 0.000000 | Jun 2009 | 66 | 0.000000 | 0.000000 | 0.000000 |
| Jul 2004 | 7 | 0.000000 | 0.000000 | 0.000000 | Jul 2009 | 67 | 0.000000 | 0.000000 | 0.000000 |
| Aug 2004 | 8 | 0.000000 | 0.000000 | 0.000000 | Aug 2009 | 68 | 0.000000 | 0.000000 | 0.000000 |
| Sep 2004 | 9 | 0.000000 | 0.000000 | 0.000000 | Sep 2009 | 69 | 0.000000 | 0.000000 | 0.000000 |
| Oct 2004 | 10 | 0.000000 | 0.000000 | 0.000000 | Oct 2009 | 70 | 0.000000 | 0.000000 | 0.000000 |
| Nov 2004 | 11 | 0.000000 | 0.000000 | 0.000000 | Nov 2009 | 71 | 0.000000 | 0.000000 | 0.000000 |
| Dec 2004 | 12 | 0.000000 | 0.193464 | 0.000000 | Dec 2009 | 72 | 0.000000 | 0.123444 | 0.000000 |
| Jan 2005 | 13 | 0.000000 | 0.000000 | 0.000000 | Jan 2010 | 73 | 0.000000 | 0.987049 | 0.343783 |
| Feb 2005 | 14 | 0.000000 | 0.000000 | 0.000000 | Feb 2010 | 74 | 0.000000 | 0.000000 | 0.000000 |
| Mar 2005 | 15 | 0.000000 | 0.000000 | 0.000000 | Mar 2010 | 75 | 0.000000 | 0.000000 | 0.000000 |
| Apr 2005 | 16 | 0.000000 | 0.000000 | 0.000000 | Apr 2010 | 76 | 0.000000 | 0.219219 | 0.000000 |
| May 2005 | 17 | 0.000000 | 0.000000 | 0.000000 | May 2010 | 77 | 0.000000 | 0.000000 | 0.000000 |
| Jun 2005 | 18 | 0.000000 | 0.000000 | 0.000000 | Jun 2010 | 78 | 0.000000 | 0.000000 | 0.000000 |
| Jul 2005 | 19 | 0.000000 | 0.499721 | 0.000000 | Jul 2010 | <i>7</i> 9 | 0.000000 | 0.070126 | 0.000000 |
| Aug 2005 | 20 | 0.000000 | 0.000000 | 0.000000 | Aug 2010 | 80 | 0.000000 | 0.137881 | 0.000000 |
| Sep 2005 | 21 | 0.000000 | 0.000000 | 0.000000 | Sep 2010 | 81 | 0.000000 | 0.000000 | 0.000000 |
| Oct 2005 | 22 | 0.000000 | 0.000000 | 0.000000 | Oct 2010 | 82 | 0.000000 | 0.000000 | 0.000000 |
| Nov 2005 | 23 | 0.000000 | 0.000000 | 0.000000 | Nov 2010 | 83 | 0.000000 | 0.000000 | 0.000000 |
| Dec 2005 | 24 | 0.000000 | 0.000000 | 0.000000 | Dec 2010 | 84 | 0.000000 | 0.202934 | 0.000000 |
| Jan 2006 | 25 | 0.000000 | 0.000000 | 0.000000 | Jan 2011 | 85 | 0.000000 | 0.000000 | 0.000000 |
| Feb 2006 | 26 | 0.000000 | 0.000000 | 0.000000 | Feb 2011 | 86 | 0.000000 | 0.000000 | 0.000000 |
| Mar 2006 | 27 | 0.000000 | 0.000000 | 0.000000 | Mar 2011 | 87 | 0.000000 | 0.000000 | 0.000000 |
| Apr 2006 | 28 | 0.000000 | 0.000000 | 0.000000 | Apr 2011 | 88 | 0.000000 | 0.000000 | 0.000000 |
| May 2006 | 29 | 0.000000 | 0.000000 | 0.000000 | May 2011 | 89 | 0.000000 | 0.000000 | 0.000000 |
| Jun 2006 | 30 | 0.000000 | 0.000000 | 0.000000 | Jun 2011 | 90 | 0.695452 | 2.002900 | 1.938632 |
| Jul 2006 | 31 | 0.000000 | 0.000000 | 0.000000 | Jul 2011 | 91 | 0.000000 | 0.000000 | 0.000000 |
| Aug 2006 | 32 | 0.000000 | 0.000000 | 0.000000 | Aug 2011 | 92 | 0.000000 | 0.000000 | 0.000000 |

| Date | SP | Base RCH1 (mm/day) | Base RCH2 (mm/day) | Base RCH3 (mm/day) | Date | SP | Base RCH1 (mm/day) | Base RCH2 (mm/day) | Base RCH3 (mm/day) |
|----------|----|-----------------------|-----------------------|-----------------------|----------|-----|-----------------------|-----------------------|-----------------------|
| Sep 2006 | 33 | 0.000000 | 0.000000 | 0.000000 | Sep 2011 | 93 | 0.000000 | 0.000000 | 0.000000 |
| Oct 2006 | 34 | 0.000000 | 0.000000 | 0.000000 | Oct 2011 | 94 | 0.000000 | 0.000000 | 0.000000 |
| Nov 2006 | 35 | 0.000000 | 0.000000 | 0.000000 | Nov 2011 | 95 | 0.204872 | 1.369663 | 0.724536 |
| Dec 2006 | 36 | 0.000000 | 0.000000 | 0.000000 | Dec 2011 | 96 | 0.000000 | 0.000000 | 0.000000 |
| Jan 2007 | 37 | 0.000000 | 0.000000 | 0.000000 | Jan 2012 | 97 | 0.000000 | 0.000000 | 0.000000 |
| Feb 2007 | 38 | 0.000000 | 0.000000 | 0.000000 | Feb 2012 | 98 | 0.000000 | 0.377910 | 0.000000 |
| Mar 2007 | 39 | 0.000000 | 0.000000 | 0.000000 | Mar 2012 | 99 | 0.000000 | 0.000000 | 0.000000 |
| Apr 2007 | 40 | 0.000000 | 0.000000 | 0.000000 | Apr 2012 | 100 | 0.000000 | 0.000000 | 0.000000 |
| May 2007 | 41 | 0.000000 | 0.000000 | 0.000000 | May 2012 | 101 | 0.000000 | 0.000000 | 0.000000 |
| Jun 2007 | 42 | 2.665852 | 3.485639 | 2.803082 | Jun 2012 | 102 | 0.000000 | 0.000000 | 0.000000 |
| Jul 2007 | 43 | 0.000000 | 0.000000 | 0.000000 | Jul 2012 | 103 | 0.000000 | 0.442747 | 0.000000 |
| Aug 2007 | 44 | 0.000000 | 0.000000 | 0.000000 | Aug 2012 | 104 | 0.000000 | 0.000000 | 0.000000 |
| Sep 2007 | 45 | 0.000000 | 0.000000 | 0.000000 | Sep 2012 | 105 | 0.000000 | 0.000000 | 0.000000 |
| Oct 2007 | 46 | 0.000000 | 0.000000 | 0.000000 | Oct 2012 | 106 | 0.000000 | 0.000000 | 0.000000 |
| Nov 2007 | 47 | 0.000000 | 0.000000 | 0.000000 | Nov 2012 | 107 | 0.000000 | 0.000000 | 0.000000 |
| Dec 2007 | 48 | 0.000000 | 1.193605 | 0.000000 | Dec 2012 | 108 | 0.000000 | 0.000000 | 0.000000 |
| Jan 2008 | 49 | 0.000000 | 0.000000 | 0.000000 | Jan 2013 | 109 | 0.000000 | 1.029487 | 0.702650 |
| Feb 2008 | 50 | 0.000000 | 0.000000 | 0.459404 | Feb 2013 | 110 | 0.366924 | 0.424340 | 0.342232 |
| Mar 2008 | 51 | 0.000000 | 0.000000 | 0.000000 | Mar 2013 | 111 | 0.844275 | 1.172817 | 0.456392 |
| Apr 2008 | 52 | 0.000000 | 0.000000 | 0.000000 | Apr 2013 | 112 | 0.000000 | 0.000000 | 0.000000 |
| May 2008 | 53 | 0.000000 | 0.000000 | 0.000000 | May 2013 | 113 | 0.000000 | 0.000000 | 0.000000 |
| Jun 2008 | 54 | 0.000000 | 1.573260 | 0.000000 | Jun 2013 | 114 | 0.000000 | 0.000000 | 0.000000 |
| Jul 2008 | 55 | 0.075179 | 0.090007 | 0.000000 | Jul 2013 | 115 | 0.000000 | 0.000000 | 0.000000 |
| Aug 2008 | 56 | 0.000000 | 0.000000 | 0.000000 | Aug 2013 | 116 | 0.000000 | 0.000000 | 0.000000 |
| Sep 2008 | 57 | 0.499164 | 0.499164 | 0.000000 | Sep 2013 | 117 | 0.000000 | 0.000000 | 0.000000 |
| Oct 2008 | 58 | 0.000000 | 0.000000 | 0.000000 | Oct 2013 | 118 | 0.000000 | 0.000000 | 0.000000 |
| Nov 2008 | 59 | 0.000000 | 0.000000 | 0.000000 | Nov 2013 | 119 | 0.492079 | 1.530593 | 1.790232 |
| Dec 2008 | 60 | 0.000000 | 0.000000 | 0.000000 | Dec 2013 | 120 | 0.000000 | 0.000000 | 0.000000 |

1.2.10 Boundary condition - evapotranspiration

Transient EVT rate was adopted directly from SILO interpolated dataset. A FAO56 daily EVT rate was processed to produce monthly EVT rate for Aberdeen Rossgole datadrill location (lat: -32.10°, lon: 150.75°, elev: 524 m; see Table C 8 for actual monthly EVT rates).

Similarly to the spatial distribution of recharge, zones were used to apply different EVT rates to different areas of the model. The EVT zones were defined as follows:

- Zone 01 plateau basalts and sandstones, identical to recharge Zone 06;
- Zone 02 exposed cliff face identical to recharge Zone 07; and
- Zone 03 lowland area identical to combined recharge Zones 01-05 and 08-10.

Because SILO data is available for both main zones, a comparison between actual FAO56 EVT rates at Zone 01 and Zone 03 was undertaken and a relation between the 'base' EVT rate (Zone 01 – Aberdeen Rossgole) and the EVT rate in Zone 03 was established. The EVT rate for Zone 03 could be then calculated as a percentage (factor) of the base EVT rate.

See Figure C 6 for the recharge zonation overview and Table C 7 for the EVT factors applied to individual EVT zones.

Table C 7 EVT factors for individual zones

| Zone | EVT factor |
|--|------------|
| Zone 01 – Rossgole plateau - basalts, sandstones | 1.000 |
| Zone 02 - steep cliffs | 1.000 |
| Zone 03 - lowland area | 1.070 |

 Table C 8
 Base transient evapotranspiration rate

| Date | SP | EVT rate (mm/mth) | Date | SP | EVT rate (mm/mth) | Date | SP | EVT rate (mm/mth) |
|----------|----|----------------------|----------|----|----------------------|----------|-----|----------------------|
| Jan 2004 | 1 | 169.1 | May 2007 | 41 | 64.4 | Sep 2010 | 81 | 83.0 |
| Feb 2004 | 2 | 155.9 | Jun 2007 | 42 | 31.4 | Oct 2010 | 82 | 98.8 |
| Mar 2004 | 3 | 105.5 | Jul 2007 | 43 | 44.0 | Nov 2010 | 83 | 115.4 |
| Apr 2004 | 4 | 88.7 | Aug 2007 | 44 | 65.8 | Dec 2010 | 84 | 128.1 |
| May 2004 | 5 | 65.4 | Sep 2007 | 45 | 93.3 | Jan 2011 | 85 | 157.0 |
| Jun 2004 | 6 | 45.3 | Oct 2007 | 46 | 143.5 | Feb 2011 | 86 | 136.6 |
| Jul 2004 | 7 | 46.2 | Nov 2007 | 47 | 124.0 | Mar 2011 | 87 | 107.9 |
| Aug 2004 | 8 | 67.5 | Dec 2007 | 48 | 130.6 | Apr 2011 | 88 | 77.9 |
| Sep 2004 | 9 | 91.3 | Jan 2008 | 49 | 134.5 | May 2011 | 89 | 54.2 |
| Oct 2004 | 10 | 124.9 | Feb 2008 | 50 | 101.7 | Jun 2011 | 90 | 37.5 |
| Nov 2004 | 11 | 147.9 | Mar 2008 | 51 | 119.4 | Jul 2011 | 91 | 44.2 |
| Dec 2004 | 12 | 160.4 | Apr 2008 | 52 | 68.2 | Aug 2011 | 92 | 60.8 |
| Jan 2005 | 13 | 164.3 | May 2008 | 53 | 60.2 | Sep 2011 | 93 | 95.7 |
| Feb 2005 | 14 | 145.5 | Jun 2008 | 54 | 35.0 | Oct 2011 | 94 | 100.2 |
| Mar 2005 | 15 | 117.5 | Jul 2008 | 55 | 44.4 | Nov 2011 | 95 | 132.0 |
| Apr 2005 | 16 | 94.9 | Aug 2008 | 56 | 57.9 | Dec 2011 | 96 | 122.4 |
| May 2005 | 17 | 60.8 | Sep 2008 | 57 | 88.5 | Jan 2012 | 97 | 138.2 |
| Jun 2005 | 18 | 41.9 | Oct 2008 | 58 | 120.2 | Feb 2012 | 98 | 110.5 |
| Jul 2005 | 19 | 48.1 | Nov 2008 | 59 | 117.7 | Mar 2012 | 99 | 101.3 |
| Aug 2005 | 20 | 69.5 | Dec 2008 | 60 | 149.8 | Apr 2012 | 100 | 76.4 |
| Sep 2005 | 21 | 85.9 | Jan 2009 | 61 | 172.8 | May 2012 | 101 | 61.7 |
| Oct 2005 | 22 | 114.6 | Feb 2009 | 62 | 128.2 | Jun 2012 | 102 | 35.1 |
| Nov 2005 | 23 | 129.9 | Mar 2009 | 63 | 119.6 | Jul 2012 | 103 | 41.1 |
| Dec 2005 | 24 | 198.4 | Apr 2009 | 64 | 68.8 | Aug 2012 | 104 | 74.7 |
| Jan 2006 | 25 | 159.7 | May 2009 | 65 | 51.0 | Sep 2012 | 105 | 107.1 |
| Feb 2006 | 26 | 145.0 | Jun 2009 | 66 | 39.1 | Oct 2012 | 106 | 145.8 |
| Mar 2006 | 27 | 122.0 | Jul 2009 | 67 | 45.1 | Nov 2012 | 107 | 150.7 |
| Apr 2006 | 28 | 93.0 | Aug 2009 | 68 | 82.9 | Dec 2012 | 108 | 168.4 |
| May 2006 | 29 | 61.4 | Sep 2009 | 69 | 103.7 | Jan 2013 | 109 | 174.3 |
| Jun 2006 | 30 | 41.4 | Oct 2009 | 70 | 122.4 | Feb 2013 | 110 | 118.8 |

| Date | SP | EVT rate (mm/mth) | Date | SP | EVT rate (mm/mth) | Date | SP | EVT rate (mm/mth) |
|----------|----|----------------------|----------|----|----------------------|----------|-----|----------------------|
| Jul 2006 | 31 | 44.5 | Nov 2009 | 71 | 168.1 | Mar 2013 | 111 | 109.5 |
| Aug 2006 | 32 | 71.7 | Dec 2009 | 72 | 164.7 | Apr 2013 | 112 | 84.1 |
| Sep 2006 | 33 | 102.9 | Jan 2010 | 73 | 166.8 | May 2013 | 113 | 60.1 |
| Oct 2006 | 34 | 141.3 | Feb 2010 | 74 | 120.7 | Jun 2013 | 114 | 32.3 |
| Nov 2006 | 35 | 160.2 | Mar 2010 | 75 | 115.1 | Jul 2013 | 115 | 44.3 |
| Dec 2006 | 36 | 157.8 | Apr 2010 | 76 | 80.2 | Aug 2013 | 116 | 77.3 |
| Jan 2007 | 37 | 184.6 | May 2010 | 77 | 55.1 | Sep 2013 | 117 | 115.2 |
| Feb 2007 | 38 | 138.5 | Jun 2010 | 78 | 36.9 | Oct 2013 | 118 | 158.0 |
| Mar 2007 | 39 | 116.2 | Jul 2010 | 79 | 36.7 | Nov 2013 | 119 | 142.8 |
| Apr 2007 | 40 | 84.8 | Aug 2010 | 80 | 59.0 | Dec 2013 | 120 | 175.5 |

1.2.11 Starting heads

Initially, a steady state model was run before the beginning of the lead-in calibration period, however the resulting heads did not conform to our conceptual understanding of the interconnectivity of the groundwater flow system, namely the disconnect between the Hawkesbury Sandstone and underlying Permian strata. Starting heads for the calibration period were combined from the steady state model final heads as follows:

- Heads for layer 1 and 2 were adopted without change.
- Heads for layer 3 to 11 were adopted from the steady state model outputs for the area eastwards from the outcrop of individual seams/layers; an elevation of the layer 5 roof was used for starting head value for all the layers westwards of the outcrop line of individual model layer.

In order to accommodate the change of starting heads due to change of hydraulic parameters during the calibration process, the heads at the end of individual calibration run were used as starting heads for the next iteration in the calibration process.

1.3 Model calibration

Calibration of a groundwater flow model is a process that demonstrates that a model is capable of replicating observed field data. Calibration is accomplished by finding a set of parameters, boundary conditions and stresses that produce simulated heads and fluxes that match field measured values within an acceptable range of error.

1.3.1 Calibration method

The model calibration method was primarily driven by adjusting selected parameters within realistic ranges to match transient groundwater levels. The calibration strategy initially involved manual testing and adjusting parameters to obtain an initial fit against the observation data. The final calibration was completed using PEST (independent Parameter Estimation tool; Doherty, 2006) to refine the manual calibration.

The calibration period lasted from January 2004 to December 2013 (10 years, monthly stress periods), a time interval for which the transient observations of groundwater table (29 bores), stream flow (stream stage), evapotranspiration and rainfall are available. The calibration run does simulate the behaviour of the hydrogeologic systems under historical (observed) climatic conditions and represents the antecedent state of the system prior the commencement of mining activities.

There were two main objectives of the calibration process: (1) create a set of starting heads that would be as close to physical reality as possible and (2) replicate the trends (recharge/discharge) observed in the transient groundwater level datasets. The automatic calibration process was partially guided by changing weights of individual observations so that the 'starting head' observation dataset had initially higher weights than the 'transient trends' observation dataset. Weights were also used to exclude some (erroneous or unreliable) of the observations from the calibration.

The only parameters adjusted during the calibration process were those associated with hydraulic properties (horizontal and vertical hydraulic conductivity, specific yield, specific storage). Parameters associated with recharge, EVT and vertical conductivity of the stream beds were not being calibrated. Due to the lack of actual field measurements specific for individual hydrostratigraphic units, some of the parameters were tied to another parameter; this process prevented the tied parameters to move independently and aided with the calibration process. The following parameter groups were tied together: all interburden units, all coal seams, all coal seam subcrop zones. Slope colluvium properties were tied to Sandy Creek North, Sandy Creek South and Spring Creek alluvium properties. All parameters were only adjusted within realistic parameter bounds, and were not allowed to move to extremes just to meet statistical objectives.

1.3.2 Calibration targets

Groundwater level information for transient calibration was collated from multiple sources. Mainly, publicly available records (NSW Office of Water – Pineena database) and records provided by client (groundwater data from the exploration drilling program) were used. Where the target aquifer information was not available, it was estimated based on additional background information (bore construction, bore depth, bore location). Records with water level data but with no other information were ultimately removed from calibration dataset.

In total, measurements from 93 private bores, exploration bores and wells were used to compile the 'starting head' observation dataset. Out of these, 29 bores had at least two field measurements and could be used to compile the 'transient trends' observation dataset. All observation bores used during the calibration process are shown on the map (Figure C-7) as well as presented in Table C 9.

 Table C 9
 Observation bores used during the calibration process

| Bore ID | Easting | Northing | Dataset*) | Bore ID | Easting | Northing | Dataset*) |
|----------|-----------|------------|-----------|----------|-----------|------------|-----------|
| BRO3 | 296022.07 | 6439457.32 | SH, TT | CRRDH6 | 287992.15 | 6427104.05 | SH |
| CAD2 | 294131.81 | 6439790.20 | SH, TT | CRRDH67 | 290912.40 | 6433195.40 | SH |
| COR3 | 293689.07 | 6439180.32 | SH, TT | CRRDH77 | 290920.37 | 6433498.98 | SH |
| CRRDH105 | 290674.30 | 6432864.43 | SH, TT | CRRDH9 | 287678.76 | 6426077.69 | SH |
| CRRDH106 | 290009.14 | 6433457.19 | SH, TT | CRRDH90 | 290746.94 | 6432984.87 | SH |
| CRRDH107 | 290870.20 | 6432412.80 | SH, TT | GW012975 | 297328.12 | 6440165.15 | SH |
| CRRDH52 | 291701.57 | 6434009.73 | SH, TT | GW032886 | 293025.75 | 6450646.97 | SH |
| DAY1 | 292850.35 | 6441989.50 | SH, TT | GW032890 | 289728.68 | 6433755.22 | SH |
| GDAY1 | 290818.30 | 6438405.69 | SH, TT | GW037397 | 294913.86 | 6448096.98 | SH |
| GW024561 | 290209.06 | 6433726.36 | SH, TT | GW040500 | 297418.55 | 6442200.53 | SH |
| GW027311 | 292056.03 | 6422787.41 | SH, TT | GW040509 | 297473.03 | 6440784.28 | SH |
| GW032887 | 293602.07 | 6449839.06 | SH, TT | GW040566 | 297535.66 | 6441586.64 | SH |
| GW067260 | 297559.55 | 6443887.60 | SH, TT | GW044912 | 293000.48 | 6428769.28 | SH |
| GW080433 | 296333.03 | 6445791.20 | SH, TT | GW053572 | 291175.82 | 6438530.47 | SH |
| PIT1 | 291243.59 | 6437765.25 | SH, TT | GW080074 | 296435.04 | 6430363.39 | SH |
| PIT2 | 291337.60 | 6437735.42 | SH, TT | GW080907 | 287273.03 | 6425261.40 | SH |
| RHDDH20 | 293115.37 | 6439916.10 | SH, TT | GW080908 | 297568.08 | 6440763.31 | SH |
| RHDDH27 | 291291.04 | 6434348.03 | SH, TT | GW080909 | 287363.03 | 6425117.40 | SH |
| RHDDH4 | 291782.68 | 6436624.36 | SH, TT | RHDDH105 | 293030.48 | 6437111.57 | SH |
| RHRDH211 | 292437.20 | 6437962.70 | SH, TT | RHDDH116 | 292587.58 | 6439229.02 | SH |
| RHRDH212 | 293426.10 | 6438850.10 | SH, TT | RHDDH216 | 292704.03 | 6435859.82 | SH |
| RHRDH213 | 291214.52 | 6438080.75 | SH, TT | RHDDH217 | 292690.30 | 6436869.88 | SH |
| SPAR2 | 289994.50 | 6433497.99 | SH, TT | RHDDH22 | 291695.37 | 6434266.24 | SH |
| SPAR4 | 290210.33 | 6433732.92 | SH, TT | RHDDH23 | 292831.56 | 6437261.06 | SH |
| SPAR5 | 289875.92 | 6433546.68 | SH, TT | RHDDH28a | 291346.31 | 6433733.46 | SH |
| WEK2 | 288753.59 | 6434415.55 | SH, TT | RHDDH48 | 292677.46 | 6435440.76 | SH |
| WM3 | 294773.07 | 6439840.32 | SH, TT | RHDDH49 | 292981.47 | 6437565.30 | SH |
| WYL1 | 291169.47 | 6438494.78 | SH, TT | RHRDH114 | 293280.65 | 6439687.63 | SH |
| YOU1 | 288149.59 | 6434786.27 | SH, TT | RHRDH115 | 292792.31 | 6439123.99 | SH |
| CRDDH14 | 286849.20 | 6424724.40 | SH | RHRDH117 | 293195.10 | 6439773.34 | SH |
| CRDDH15 | 286962.15 | 6425364.98 | SH | RHRDH121 | 293244.84 | 6440010.05 | SH |
| CRDDH16 | 286807.07 | 6425603.09 | SH | RHRDH155 | 292285.00 | 6434895.59 | SH |
| CRDDH24 | 288880.91 | 6429021.45 | SH | RHRDH159 | 293524.79 | 6440517.62 | SH |

| Bore ID | Easting | Northing | Dataset*) | Bore ID | Easting | Northing | Dataset*) |
|-----------|-----------|------------|-----------|----------|-----------|------------|-----------|
| CRDDH25R | 289913.95 | 6431714.88 | SH | RHRDH162 | 293643.96 | 6440688.71 | SH |
| CRDDH3 | 287353.71 | 6423209.92 | SH | RHRDH163 | 293026.41 | 6439612.93 | SH |
| CRDDH46 | 287195.77 | 6422650.89 | SH | RHRDH164 | 292975.12 | 6439625.25 | SH |
| CRLDH108R | 289754.20 | 6434186.50 | SH | RHRDH165 | 292771.74 | 6439430.57 | SH |
| CRLDH97 | 291130.90 | 6433832.80 | SH | RHRDH166 | 292768.11 | 6439173.68 | SH |
| CRRDH102 | 290637.00 | 6432788.31 | SH | RHRDH167 | 292643.22 | 6439144.13 | SH |
| CRRDH109 | 290352.46 | 6432094.78 | SH | RHRDH169 | 292590.03 | 6438795.42 | SH |
| CRRDH12 | 288449.70 | 6428009.07 | SH | RHRDH202 | 292666.69 | 6435561.68 | SH |
| CRRDH19 | 288809.54 | 6428523.64 | SH | RHRDH31 | 291942.56 | 6434532.65 | SH |
| CRRDH22 | 288971.20 | 6429468.90 | SH | RHRDH42 | 292797.73 | 6439483.15 | SH |
| CRRDH28 | 290461.85 | 6432650.04 | SH | RHRDH78 | 292236.70 | 6438025.90 | SH |
| CRRDH38 | 289580.14 | 6430796.92 | SH | RHRDH79 | 292516.70 | 6438469.50 | SH |
| CRRDH44 | 289232.26 | 6430068.48 | SH | RHRDH80 | 292456.70 | 6438493.36 | SH |
| CRRDH59 | 291277.13 | 6433610.38 | SH | | | | |


Note: *) Dataset type: SH – starting head, TT – transient trend

1.3.3 Data exclusions

Two types of groundwater table data were used: manual measurements (bores 'dipped' by electronic meter) and automatic measurements (data recorded by automatic loggers). Given the model stress period length (one month for both calibration and predictive part of the model run), the use of the high density (15 minutes intervals) data for the transient calibration was not practical and did not contribute to the quality of the calibration. The dataset was thus resampled from the 15 minutes intervals to monthly intervals in order to speed up the processing of the modelled results.

During the calibration process, several bores with detrimental influence on the calibration process were identified. These observations were either not relevant to the performance of model in critical areas or identified as faulty and/or unreliable. Such observations were removed from the calibration entirely or weighted out by setting their contribution towards the objective function to zero.

Bores removed entirely out of the calibration in spite of the existence of groundwater observation data and target aquifer unit were JLON1 and JLON2. These bores were removed because the model conceptualization did not allow a match of measured and modelled heads to acceptable degree - the aquifer in which these bores are located was not modelled as a separate hydrostratigraphic unit.

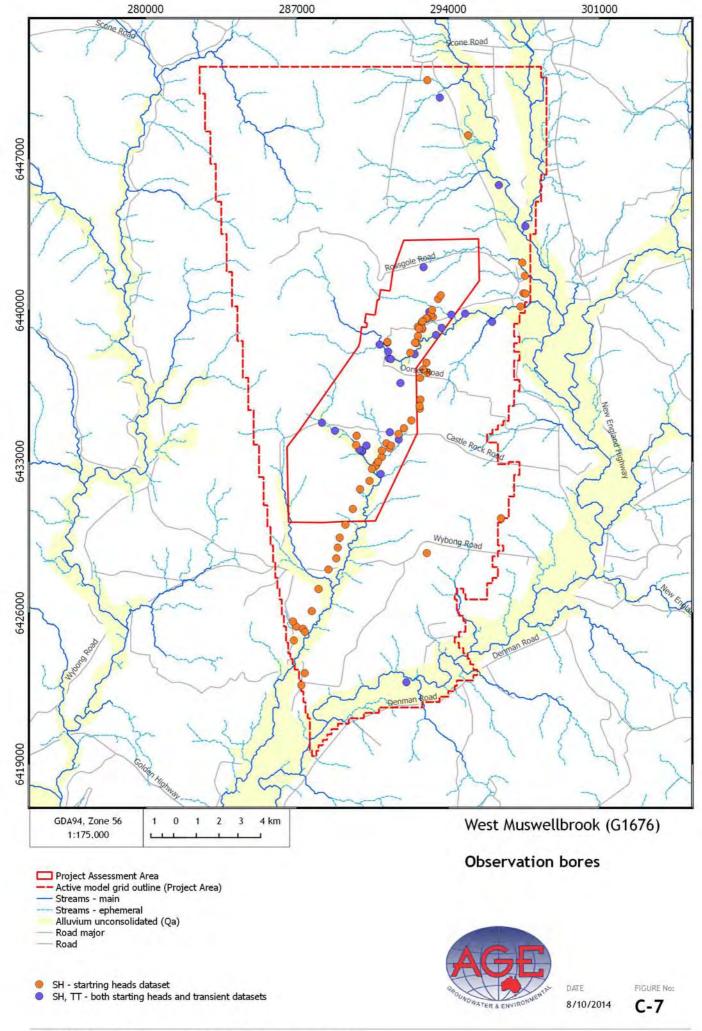

Bores removed partially from calibration by weighting were COR3 and DAY1. Some of the observations for these bores were preserved, the observations noted as unreliable by data collectors were weighted out. In spite of zero weighting, these observations were included in the final statistical overview.

1.3.4 Calibration run - results

The groundwater flow model was calibrated as an inverse problem where model parameters (hydraulic properties of aquifer) were adjusted in order to achieve the best possible fit between measured and calculated observations. PEST and BeoPEST (Doherty, 2006; Doherty, 2010; Doherty, 2011) were used to aid the calibration process.

Adjustable parameters for all model layers within the calibration process were:

- horizontal hydraulic conductivity (HC);
- vertical hydraulic conductivity (VHC) converted to vertical conductance term (VCONT); and
- specific yield and specific storage.

The first two model layers were divided into multiple zones representing regolith and weathered regolith zone, alluviums of individual streams and rivers, slope colluvium, subcrops of coal seams. All other model layers comprised of a single zone. The hydraulic properties of individual zones of layers 1, 2 (weathered regolith, alluvium, coal seam subcrops), 3 (Hawkesbury Sandstone), 4, 6, 8, 10 (interburden) were assigned uniform values. The horizontal hydraulic conductivity of the coal seams were set to decrease with depth according to Equation 1.

$$HC = HC_0 \times e^{(-0.022*depth)}$$
 (Eq. 1)

Where:

HC is horizontal hydraulic conductivity at specific depth

 HC_0 is horizontal hydraulic conductivity at depth of 0 m (surface)

depth is depth of the floor of the coal seam

The Equation 1 was derived from the data collected during the previous field campaigns. The assumed decrease of hydraulic conductivity of all the modelled coal seams is shown in Figure C 8.

The vertical hydraulic conductivity (VHC) is derived from the horizontal hydraulic conductivity using the value of VHC factor according to Equation 2. Because of this relationship between HC and VHC, the value of VHC varies with depth together with value of HC.

$$VHC = HC \times VHC_{factor}$$
 (Eq. 2)

Heads at the end of the calibration run and beginning of the prediction run for model layer 1 (unconfined aquifer – alluvium and weathered regolith) and model layer 9 (Blakefield – deepest targeted coal seam) are presented in Figure C 9. Estimated values of base hydraulic parameters are presented in Table C 10.

Although the site-specific values for alluvial areas are not known (see main report, Section 3.3.1), the calibrated values of hydraulic conductivities (~ 0.5 to 5.0 m/day) and specific yield (~ 3.0 to 7.5%) for alluvium and colluvium are within bounds expected for unconsolidated unconfined aquifer. Calibrated values of hydraulic properties for coal seams and interburden correspond to the permeability data collected during previous work in and around the Study Area (see Figure C 8).

Table C 10 Calibrated hydraulic properties

| Layer | Zone | Description | HC, HC ₀ (*) (m/day) | VHC factor (-) | SS (-) | SY (-) |
|-------|-------|---|------------------------------------|--------------------------|--------------------------|--------------------------|
| 1 | 1 | topsoil/regolith | 2.0554×10 ⁻⁰¹ | 8.9198×10 ⁻⁰¹ | 1.0000×10 ⁻⁰⁵ | 1.0013×10 ⁻⁰³ |
| | 2 | alluvium - Hunter River | 5.0859×10 ⁺⁰⁰ | 1.8162×10 ⁻⁰³ | 1.2498×10 ⁻⁰⁴ | 3.1451×10 ⁻⁰² |
| | 3 | alluvium - Middle Brook / Kingdon Ponds | 5.1129×10 ⁺⁰⁰ | 5.9466×10 ⁻⁰³ | 1.0000×10 ⁻⁰⁴ | 7.5416×10 ⁻⁰² |
| | 4 | alluvium - Sandy Crk North | 1.0007×10 ⁺⁰⁰ | 6.8974×10 ⁻⁰³ | 3.0485×10 ⁻⁰⁴ | 7.5785×10 ⁻⁰² |
| | 5 | alluvium - Sandy Crk South | 1.0007×10+00 | 6.8974×10 ⁻⁰³ | 3.0485×10 ⁻⁰⁴ | 7.4561×10 ⁻⁰² |
| | 6 | basalts, sandstone - top of the plateau | 1.0000×10 ⁻⁰¹ | 9.0000×10 ⁻⁰¹ | 1.0000×10 ⁻⁰⁴ | 1.0000×10 ⁻⁰³ |
| | 7 | cliff face | 1.0000×10 ⁻⁰¹ | 5.0000×10 ⁻⁰³ | 5.0000×10 ⁻⁰⁶ | 5.0000×10 ⁻⁰³ |
| | 8 | slope colluvium | 8.6769×10 ⁻⁰¹ | 6.2125×10 ⁻⁰³ | 3.0485×10 ⁻⁰⁴ | 3.7893×10 ⁻⁰² |
| | 9 | slope colluvium - Sandy Crk North feed-in | 8.6789×10 ⁻⁰¹ | 5.8473×10 ⁻⁰³ | 3.0485×10 ⁻⁰⁴ | 3.7893×10 ⁻⁰² |
| | 10-12 | slope colluvium - Coal Crk, Sandy Crk South, Spring Crk feed-in zone | 8.6769×10 ⁻⁰¹ | 6.2125×10 ⁻⁰³ | 3.0485×10 ⁻⁰⁴ | 3.7281×10 ⁻⁰² |
| | 13-16 | coal seam subcrops | 3.0656×10 ⁺⁰⁰ | 6.0410×10 ⁻⁰¹ | 1.0000×10 ⁻⁰³ | 7.2057×10 ⁻⁰³ |
| 2 | 1 | layer 02 - weathered regolith | 8.6810×10 ⁻⁰² | 4.9554×10 ⁻⁰² | 5.0001×10 ⁻⁰⁵ | 5.0065×10 ⁻⁰³ |
| | 2 | coal seam subcrops | 3.0656×10 ⁺⁰⁰ | 6.0410×10 ⁻⁰¹ | 1.0000×10 ⁻⁰³ | 7.2057×10 ⁻⁰³ |
| 3 | 1 | Hawkesbury Sandstone (Narrabeen Grp) | 1.0000×10 ⁻⁰¹ | 5.0000×10 ⁻⁰³ | 5.0000×10 ⁻⁰⁶ | 5.0000×10 ⁻⁰³ |
| 4 | 1 | interburden | 3.3884×10 ⁻⁰⁴ | 9.9873×10 ⁻⁰³ | 5.0890×10 ⁻⁰⁶ | 2.1742×10 ⁻⁰³ |
| 5 | 1 | coal seam - combined Abby Green | 5.7079×10 ⁻⁰² | 1.0013×10 ⁻⁰³ | 1.7640×10 ⁻⁰⁶ | 2.2421×10 ⁻⁰³ |
| 6 | 1 | interburden | 4.2578×10 ⁻⁰⁴ | 9.9874×10 ⁻⁰³ | 1.0010×10 ⁻⁰⁶ | 2.0628×10 ⁻⁰³ |
| 7 | 1 | coal seam - combined Whybrow, Redbank, Wambo | 5.7079×10 ⁻⁰² | 1.0013×10 ⁻⁰³ | 1.7640×10 ⁻⁰⁶ | 2.2421×10 ⁻⁰³ |
| 8 | 1 | interburden | 4.2578×10 ⁻⁰⁴ | 9.9874×10 ⁻⁰³ | 1.0010×10 ⁻⁰⁶ | 2.0628×10 ⁻⁰³ |
| 9 | 1 | coal seam - combined Whynot, Blakefield (target seam) | 5.7079×10 ⁻⁰² | 1.0013×10 ⁻⁰³ | 1.7640×10 ⁻⁰⁶ | 2.2421×10 ⁻⁰³ |
| 10 | 1 | interburden | 4.2578×10 ⁻⁰⁴ | 9.9874×10 ⁻⁰³ | 1.0010×10 ⁻⁰⁶ | 2.0628×10 ⁻⁰³ |
| 11 | 1 | coal seam - combined Woodlands Hill, Arrowfield, Bowfield, Warkworth | 5.7079×10 ⁻⁰² | 1.0013×10 ⁻⁰³ | 1.7640×10 ⁻⁰⁶ | 2.2421×10 ⁻⁰³ |

Note:

(*)(*) HC represents actual horizontal hydraulic conductivity value for model layer – used for L1-L4, and L6, L8, L10. HC_0 represents horizontal hydraulic conductivity at depth 0 m (intercept value, in italics) and is applied to the coal seams layers (L5, L7, L9, L11). Actual hydraulic conductivity of the coal seams is decreasing with depth (see Section 3.3.4)


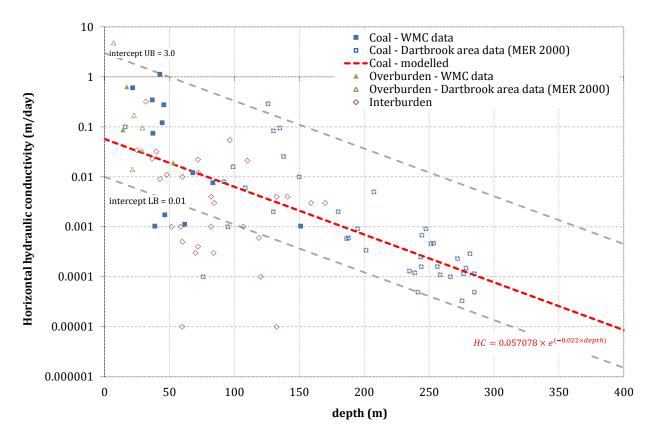


Figure C 8 Change of hydraulic conductivity with depth – field and model data

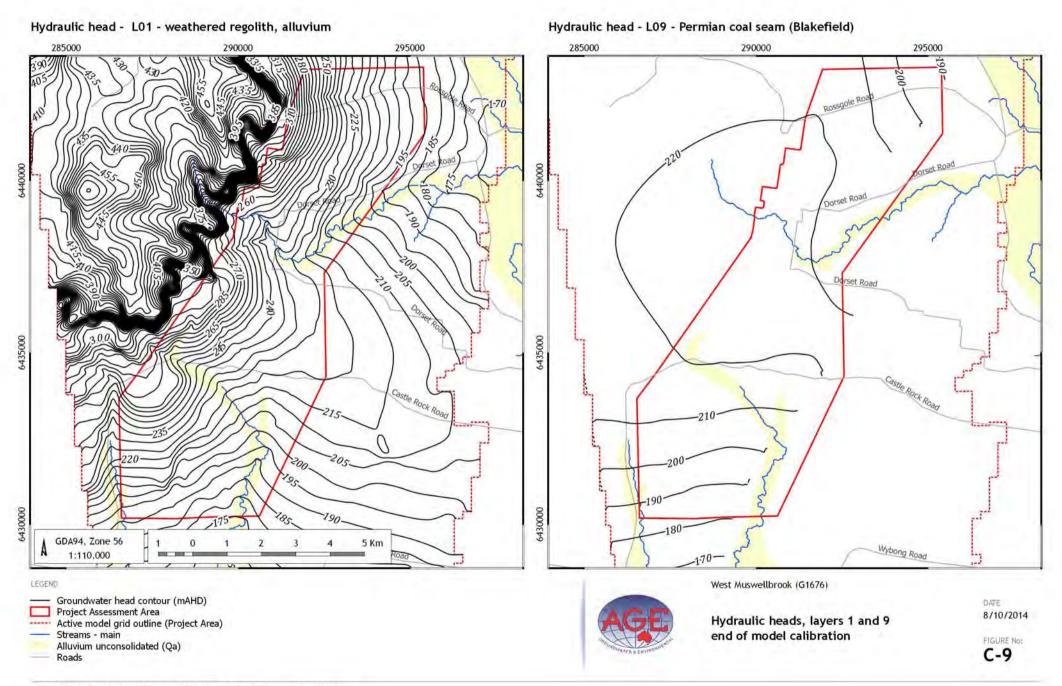

1.3.5 Calibration run - volumetric budget

Quantifying flow processes within the groundwater model, the water budget is often used as an important measure of model quality. The budget is by default calculated for the whole model domain and presented in a regular model output file, however the calculated and recorded cell-by-cell flows can be used to quantify intra- and inter-aquifer flows within the model domain. Although zone-based budgets were not calculated for the lead-in calibration period, they form a basis for evaluation of mining impacts (model prediction) and are discussed later in Section 1.4.

In terms of the water budget for the whole model domain, the inflow terms are: river and recharge. Correspondingly, the outflow terms are: river and evapotranspiration.

The budget error (water balance error) is one of the measures of the quality of model setup. The water balance error for the calibration period varies between -0.18% and 0.12%, the average value is 0.0007% (Figure C 10). The value of water balance error is safely below maximum recommended value of 1% for every time step of the model run (Barnett *et al*, 2012).

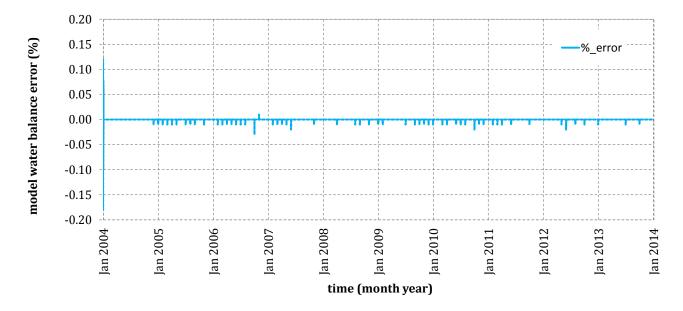


Figure C 10 The water balance error for the calibration period

With respect to model inputs, the recharge represents 42% and rivers represent 8% of the volumetric inflows. River boundary condition also represents the largest sink; about 31% of the overall volume is extracted by baseflow, followed by 19% of volume lost to evapotranspiration. The cumulative water budget for individual types of boundary conditions is summarized in Table C 11 and Figure C 11.

Table C 11 Water budget overview - cumulative volume and average rates

| | cumulativ | ve volume | average rate *) | | | |
|-----------|------------------------|-----------|-----------------|------------|--|--|
| | (m ³) (ML) | | (m³/day) | (ML/month) | | |
| RCH (in) | 41993163 | 41993.2 | 11497 | 349.9 | | |
| RIV (in) | 8443566 | 8443.6 | 2312 | 70.4 | | |
| EVT (out) | 18837622 | 18837.6 | 5158 | 156.9 | | |
| RIV (out) | 30988850 | 30988.9 | 8484 | 258.2 | | |

Note: *)the average rates were calculated over the period of the whole calibration run (10 years).

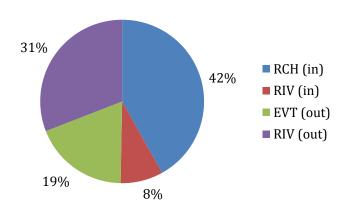


Figure C 11 Water budget overview – representation of individual boundary conditions

1.3.6 Quality of model calibration

The quality of the calibration can be assessed by checking the model performance measures against the specific calibration criteria. The recommended performance measures (Hill and Tiedeman, 2007) include:

- Water balance error discussed in previous Section 1.3.5;
- Qualitative measures (representing goodness of fit between the calculated/modelled and measured groundwater heads). This assessment was undertaken by analysis of scatter diagrams comparing modelled and measured heads as well as visual check of hydrographs presenting modelled and measured heads; and
- Quantitative measures assessment undertaken by calculating the calibration statistics.

The goodness of fit between the modelled and observed groundwater heads was examined with respect to 'starting heads' and 'transient trends' observation datasets as discussed in Section 1.3.1. For these purposes scatter diagrams as well as spatial distribution of residuals for both datasets were analysed.

See Figure C 12 for the comparison of the 'starting heads' measured and modelled data. See Figure C 13 for the map of the 'starting heads' observations in unconfined (weathered regolith or alluvium) and confined (Permian coal measure) aquifer.


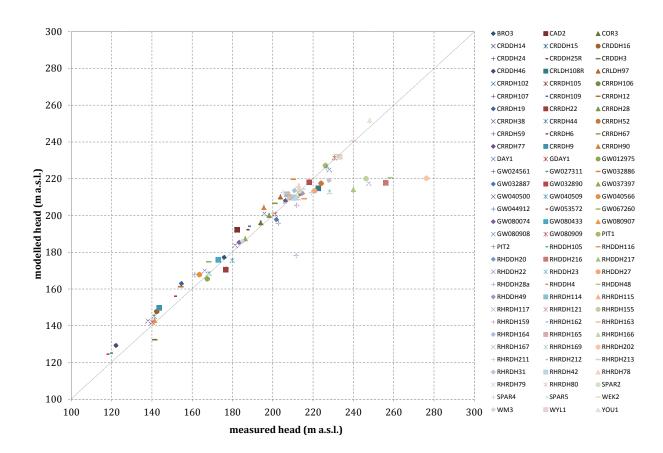


Figure C 12 Scatter diagram - 'starting heads' dataset - all bores

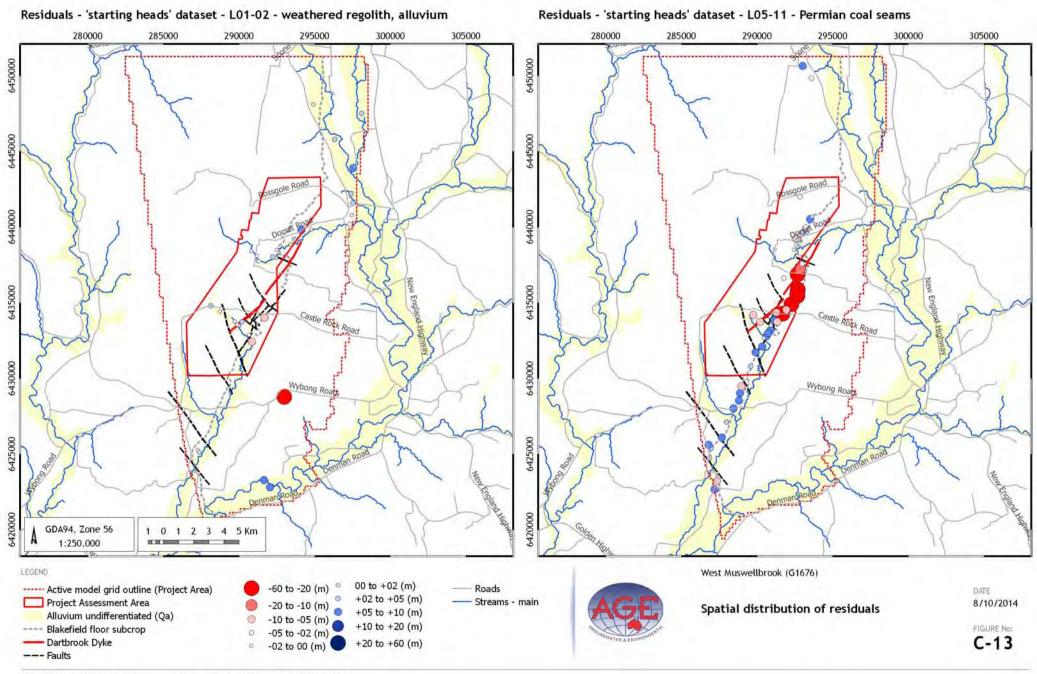

With respect to the 'starting head' target dataset, most of the data points show acceptable fit; however, the scatter diagram (Figure C 12) and the map (Figure C 13) identifies a group of bores in which the model under predicts the groundwater head – see Table C 12.

Table C 12 Bores with 'starting heads' residual greater than 10 m

| Bore | Easting | Northing | Hydrostrat. unit | Measured head (m a.s.l.) | Modelled head (m a.s.l.) | Residual *) (m) |
|---------------|-----------|------------|----------------------|-----------------------------|-----------------------------|--------------------|
| RHRDH202 (L9) | 292666.69 | 6435561.68 | Blakefield coal seam | 276.300 | 220.199 | -56.101 |
| RHDDH216 (L9) | 292704.03 | 6435859.82 | Blakefield coal seam | 256.100 | 217.666 | -38.434 |
| RHDDH48 (L9) | 292677.46 | 6435440.76 | Blakefield coal seam | 258.300 | 220.574 | -37.726 |
| RHDDH22 (L9) | 291695.37 | 6434266.24 | Blakefield coal seam | 247.700 | 217.446 | -30.254 |
| RHRDH155 (L9) | 292285.00 | 6434895.59 | Blakefield coal seam | 246.300 | 220.038 | -26.262 |
| RHDDH217 (L9) | 292690.30 | 6436869.88 | Blakefield coal seam | 240.000 | 214.110 | -25.890 |
| RHDDH23 (L9) | 292831.56 | 6437261.06 | Blakefield coal seam | 228.200 | 212.849 | -15.352 |
| GW044912 (L2) | 293000.48 | 6428769.28 | weathered regolith | 211.600 | 178.107 | -33.493 |

Note:

Most of the identified bores are measuring groundwater level in Blakefield coal seam (model layer 9). These bores are all clustered in one area, between Sandy Creek North and Coal Creek alluvium, just west of the Blakefield coal seam subcrop line. This area appears to be structurally complex and is divided into disparate blocks bounded by various splays of the Lyndale and W220 faults. Based on the field observation, the groundwater head in the area seems to be at least partially disconnected (the groundwater flow is restricted) from the wider groundwater system. Given the simplified nature of the model, these observations could not be properly fitted without compromising the model calibration.

The reason for the misfit of the observations in the weathered regolith bore GW044912 is not clear and the bore should be visited and the observation data verified.

The 'transient trends' dataset shows mostly an acceptable fit. Because the transient dataset could not be evaluated simply based on the residuals of individual observations (there are multiple observations for each bore, thus collated into *observation group*), an approach of examining the weighted contribution of individual observation groups towards the objective function was chosen. As every bore (observation group) contains variable amount of measurements (individual observations), a bore with good fit but more observations might contribute more to the objective function than poorly fitting bore with less observations. A contribution of every observation group is therefore weighted using the number of individual observations. See Table C 13 for the overview of all the bores of 'transient trends' dataset and Figure C 14 and Table C 13 to see the spatial distribution of the calibration fit and scatter diagram respectively. Figure C 15 shows the transient scatter and Figure C 16 presents all the hydrographs comparing observed and modelled data.

In terms of the quantitative calibration measures (calibration statistics), the model shows overall good fit with the RMS value of 4.34 (m) and SRMS value of 2.7%. See Table C 14 for the full overview of statistical measures.

^{*)} Residual calculated as 'modelled – measured' head. Negative residual means model is underpredicting in the particular location (modelled heads are lower than measured heads), positive residual means model is overpredicting (modelled heads are higher than measured heads).

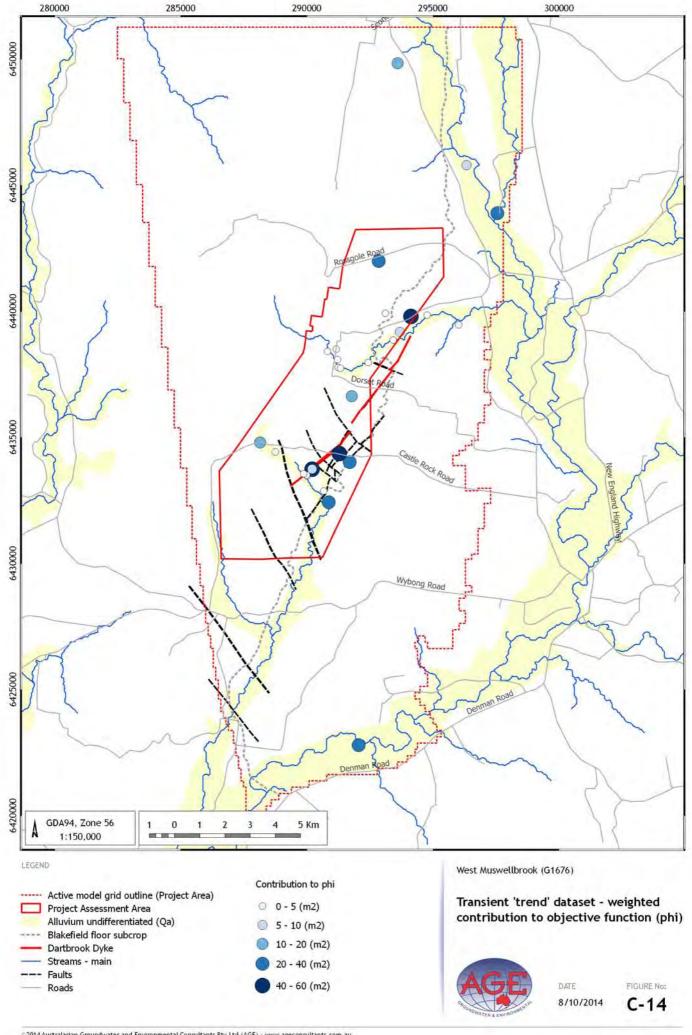


Table C 13 Weighted contribution towards objective function for individual observation groups (bores) – 'transient trends' dataset

| Bore | Easting | Northing | Contrib to phi (m²) | No of observations | Wghtd contrib to phi (m²) |
|---------------|----------|-----------|---------------------|--------------------|------------------------------|
| BRO3 (L1) | 296022.1 | 6439457.3 | 108.82 | 37 | 2.94 |
| CAD2 (L2) | 294130.0 | 6439790.0 | 1650.58 | 34 | 48.55 |
| COR3 (L1) | 293689.1 | 6439180.3 | 321.29 | 36 | 8.92 |
| CRRDH105 (L1) | 290674.3 | 6432864.4 | 109.54 | 80 | 1.37 |
| CRRDH106 (L1) | 290009.1 | 6433457.2 | 137.46 | 96 | 1.43 |
| CRRDH107 (L1) | 290870.2 | 6432412.8 | 3188.98 | 93 | 34.29 |
| CRRDH52 (L2) | 291701.6 | 6434009.7 | 1049.74 | 28 | 37.49 |
| DAY1 (L5) | 292850.4 | 6441989.5 | 1179.37 | 31 | 38.04 |
| GDAY1 (L1) | 290818.3 | 6438405.7 | 36.07 | 28 | 1.29 |
| GW024561 (L9) | 290209.1 | 6433726.4 | 200.73 | 5 | 40.15 |
| GW027311 (L1) | 292056.0 | 6422787.4 | 65.75 | 3 | 21.92 |
| GW032887 (L7) | 293602.1 | 6449839.1 | 91.14 | 7 | 13.02 |
| GW067260 (L1) | 297559.6 | 6443887.6 | 61.27 | 2 | 30.63 |
| GW080433 (L1) | 296333.0 | 6445791.2 | 699.93 | 110 | 6.36 |
| PIT1 (L1) | 291243.6 | 6437765.3 | 53.95 | 39 | 1.38 |
| PIT2 (L1) | 291337.6 | 6437735.4 | 41.95 | 39 | 1.08 |
| RHDDH20 (L9) | 293115.4 | 6439916.1 | 95.57 | 49 | 1.95 |
| RHDDH27 (L9) | 291290.0 | 6434348.0 | 1496.56 | 27 | 55.43 |
| RHDDH4 (L9) | 291782.4 | 6436622.6 | 431.96 | 39 | 11.08 |
| RHRDH211 (L1) | 292437.2 | 6437962.7 | 69.83 | 86 | 0.81 |
| RHRDH212 (L1) | 293426.1 | 6438850.1 | 101.56 | 70 | 1.45 |
| RHRDH213 (L1) | 291214.5 | 6438080.8 | 16.05 | 27 | 0.59 |
| SPAR2 (L1) | 289994.5 | 6433498.0 | 57.59 | 26 | 2.22 |
| SPAR4 (L1) | 290210.3 | 6433732.9 | 165.31 | 25 | 6.61 |
| SPAR5 (L1) | 289875.9 | 6433546.7 | 26.22 | 26 | 1.01 |
| WEK2 (L1) | 288753.6 | 6434415.6 | 14.99 | 10 | 1.5 |
| WM3 (L1) | 294773.1 | 6439840.3 | 75.25 | 37 | 2.03 |
| WYL1 (L5) | 291169.5 | 6438494.8 | 113.47 | 37 | 3.07 |
| YOU1 (L1) | 288149.6 | 6434786.3 | 411.58 | 36 | 11.43 |

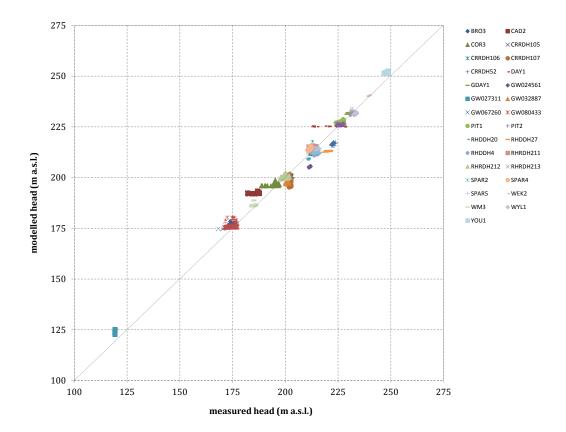



Figure C 15 Scatter diagram – 'transient trends' dataset – selected bores


Table C 14 Overall calibration statistics


| Calibration measure | Value | |
|--------------------------------------|-------|----------|
| sum of residuals (SR): | [m] | 3142.10 |
| mean sum of residuals (MSR): | [m] | 2.56 |
| scaled mean sum of residuals (SMSR): | [%] | 1.62 |
| sum of squares (SSQ): | [m2] | 23085.39 |
| mean sum of squares (MSSQ): | [m2] | 18.81 |
| root mean square (RMS): | [m] | 4.34 |
| root mean fraction square (RMFS): | [m] | 2.00 |
| scaled RMFS (SRMFS): | [%] | 2.61 |
| scaled RMS (SRMS): | [%] | 2.74 |


Figure C 16 Hydrographs – observed vs. modelled heads – 'transient trend' observation bores (below)

Dartbrook, Middle Brook, Kingdon Ponds catchment area

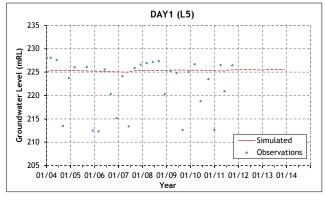


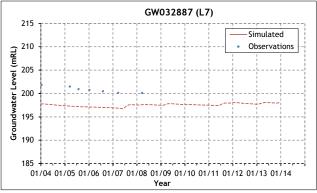


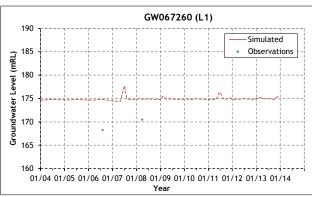


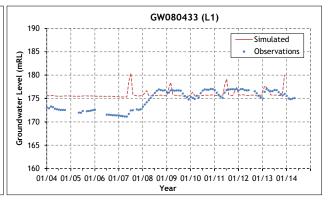


Sandy Creek North catchment area

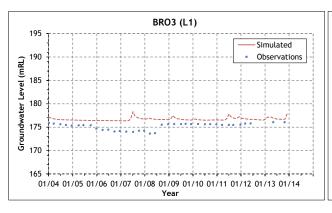


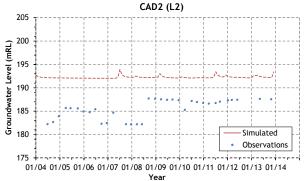


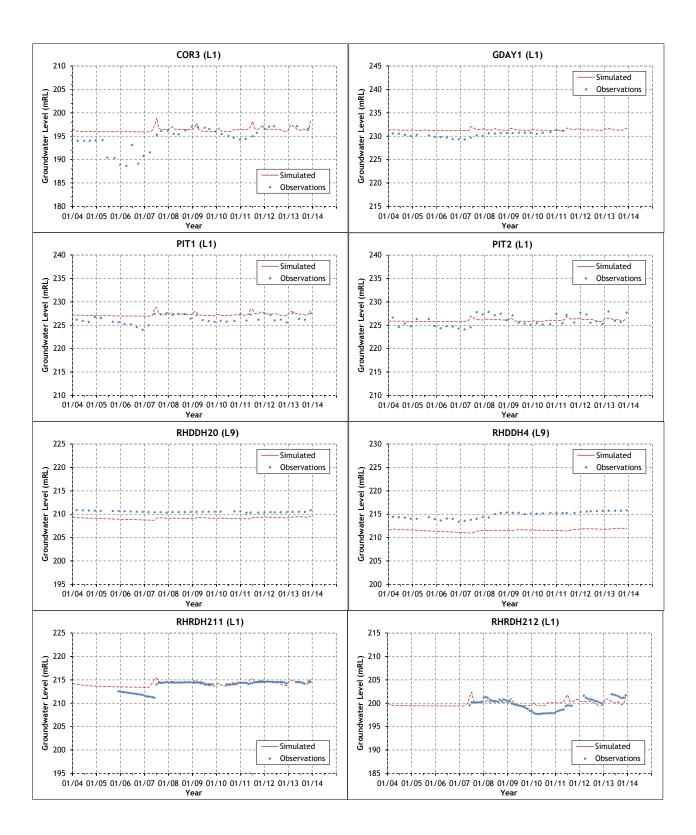

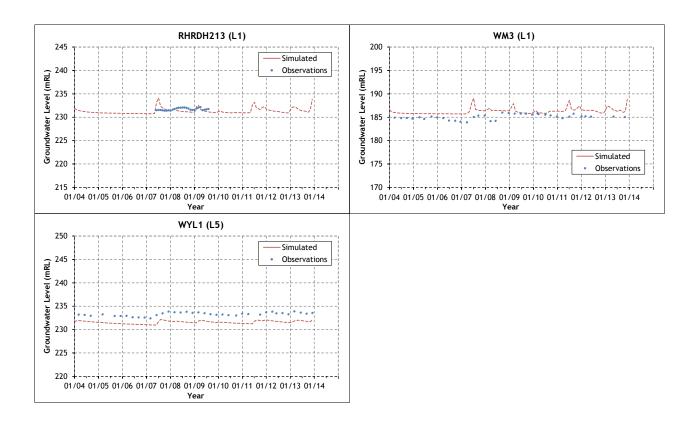


Coal Creek, Sandy Creek South

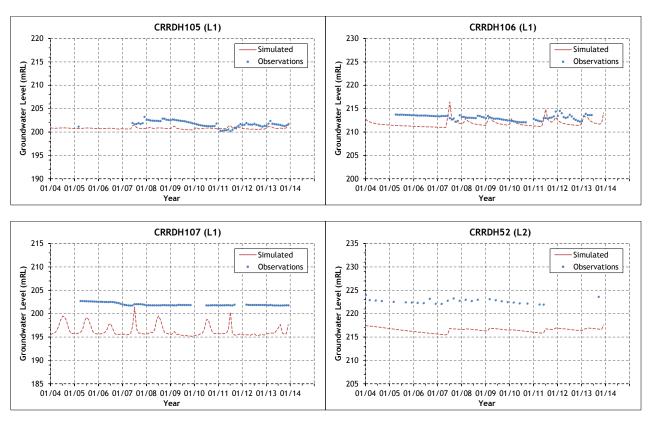

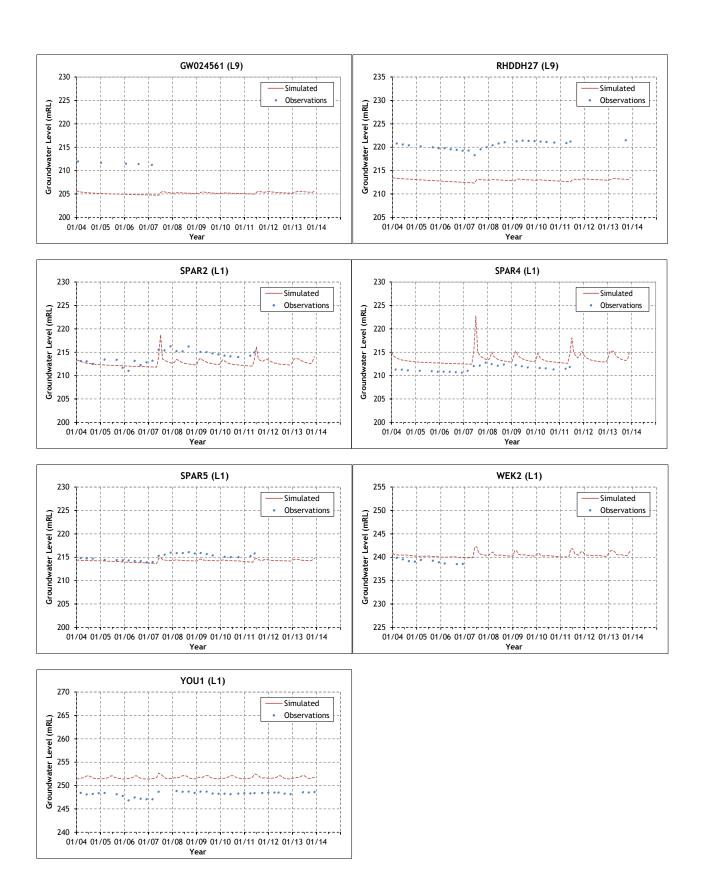

Hunter River alluvium

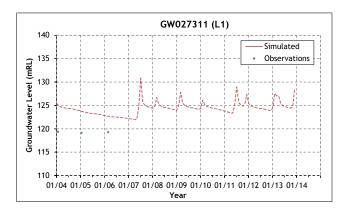

1.4 Model predictions

1.4.1 Prediction goals

As specified earlier in Section 1.1, the AIP requires analysis of the following:

- volume of groundwater seepage from the highly productive aquifers (HPA) to pits;
- drawdown (or water take) from highly productive alluvial aquifers of Sandy Creek North, Sandy Creek South, Spring Creek, Coal Creek, Dartbrook (Middle Brook and Kingdon Ponds) and the Hunter River; and
- potential for drawdown in surrounding private landholder bores within and outside of PAA, drawdown in bores within the highly productive aquifer zones; and

The prediction goals are addressed by examination of model outputs, mainly by analysis of the volumetric budgets (and their change expressed as comparison of mine and no-mine scenario runs) and drawdown contours and hydrographs, again expressed as a comparison between mine and no-mine scenario runs.

1.4.2 Mining progression, location of drain cells

The open cut mining was simulated using SURFACT drain (DRN) package. The cells were located to the floors of individual model layers. Mining progression was defined as a progression of strips going down to the base of Wambo and Blakefield coal seams, moving in north-to-south direction (Figure C 17 and Figure C 18) in annual timesteps. A conductance term of 100 m/day was applied to all drain cells. The mine was simulated using a simple transient model, the hydraulic properties within model layers were not changed to simulate the emplacement of spoil.


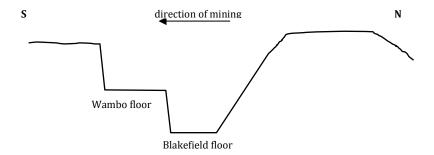


Figure C 17 Mining progression - simplified cross section

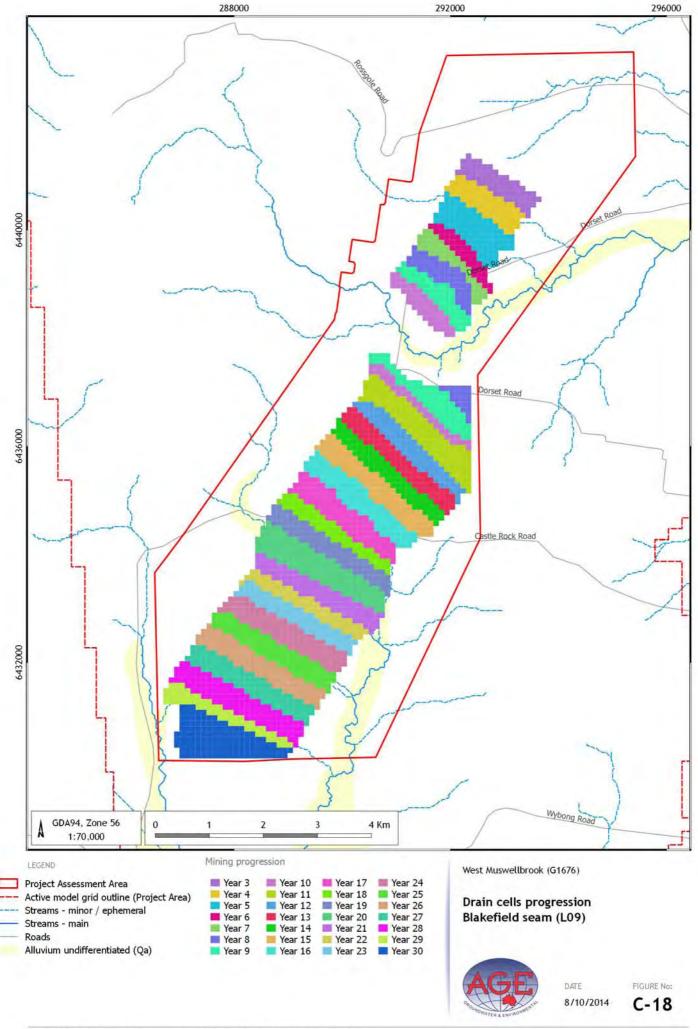

1.4.3 Predictive run - volumetric budget

Similarly to the calibration period, the volumetric water balance was calculated. Globally, the inflow terms are: river and recharge. The outflow terms are: river, drains (simulating mining progression) and evapotranspiration. In terms of the inter-aquifer processes, the flows were calculated between alluvial zones of Dartbrook (Middle Brook, Kingdon Ponds), Sandy Creek North, Sandy Creek South, Spring Creek, Hunter River and weathered regolith. Also investigated were the RIV boundary condition flow terms , which define either baseflow (water removed from the model domain) or recharge through the stream bed (water added into the model domain).

The water balance error for the mining period varies between -0.06% and 0.01%, the average value is -0.0012% (Figure C 19). The value of water balance error is below maximum recommended value of 1% for every time step of the model run (Barnett *et al*, 2012).

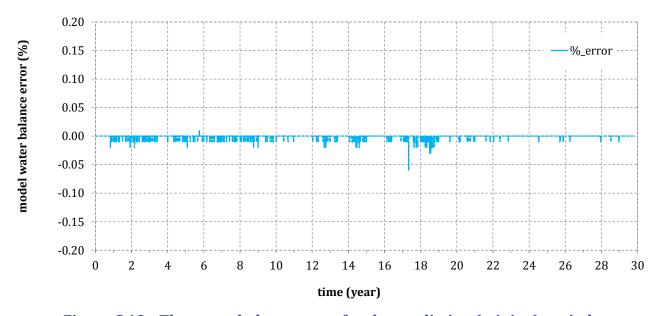


Figure C 19 The water balance error for the prediction (mining) period

With respect to model inputs, the recharge represents 42% and rivers represent 9% of the volumetric inflows. River boundary condition also represents the largest sink; about 31% of the overall volume is extracted by baseflow, followed by 18% of volume lost to evapotranspiration. The volume of water taken out by the proposed mine is about 1% of the overall water budget. The cumulative water budget for individual types of boundary conditions is summarized in Table C 15 and Figure C 20.

| | <u> </u> | | | | | | | |
|-----------|------------|-----------|-------|------------|--|--|--|--|
| | Cumulative | volume | Aver | age rate | | | | |
| | (m3) | (m3) (ML) | | (ML/month) | | | | |
| RCH (in) | 125976603 | 125976.6 | 11497 | 349.9 | | | | |
| RIV (in) | 25424073 | 25424.1 | 2320 | 70.6 | | | | |
| DRN (out) | 3276659 | 3276.7 | 299 | 9.1 | | | | |
| EVT (out) | 54895756 | 54895.8 | 5010 | 152.5 | | | | |
| RIV (out) | 89772945 | 89772.9 | 8193 | 249.4 | | | | |

Table C 15 Volumetric budget overview

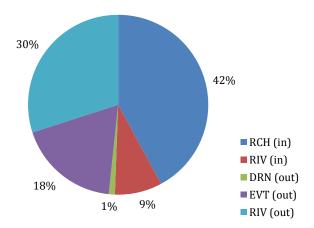


Figure C 20 Water budget overview – representation of individual boundary conditions

As the drain (DRN) boundary condition was used to simulate the mining progression, the volumetric budget of drains represents the estimate of all the water extracted from the weathered regolith (less productive aquifer), alluvium (predominantly highly productive aquifer) and Permian strata and interburden (less productive aquifer) by the Project. The only direct water-take of water from highly productive alluvium happens when the mining intersects the Coal Creek alluvium. Other parts of the highly productive alluvium aquifer systems are influenced indirectly by reduced recharge into the alluvium.

The drain output is presented in the form of two graphs: actual drain model output (Figure C 21) and summary annual water output (Figure C 22).

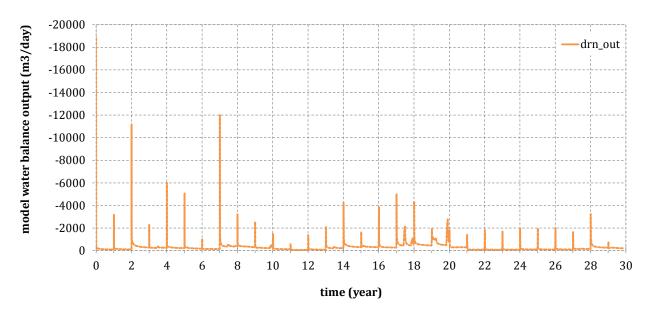


Figure C 21 Model water balance output - DRN boundary condition

The raw drain output shows inflow peaks at the moment of drain cell movement (beginning of the year). These peak inflow rates however last only for a brief period of time (hours). Then the groundwater gradients normalize and inflow rates become much more realistic. It is possible to say that the peak inflow rates are the artificial product of the annual step of drain cells emplacement and the initial peak inflow rates are not representative of actual expected inflow rates.

In order to avoid the 'peak inflow rate' issue, the inflow rates were used to calculate actual cumulative volumes for every year of mining (Figure C 22). The predicted mine inflow then fluctuates between 26 ML/year (\sim 2.2 ML/month in year 12) and 318 ML/year (\sim 26.5 ML/month in year 20) with average rate of 109 ML/year (\sim 9.1 ML/month).

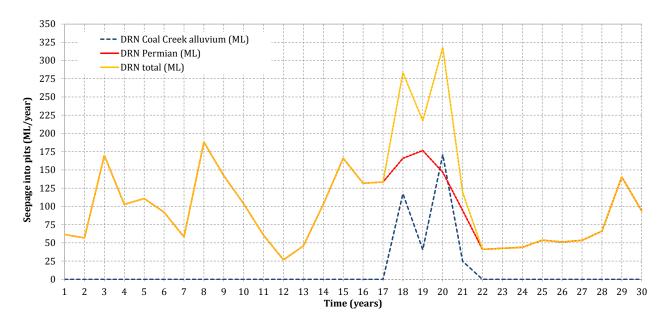


Figure C 22 DRN boundary condition - summary annual output

The peak drain outflows are happening around year 8 and 18 to 20. These time period represent times when the north pit is approaching the highly productive Sandy Creek North alluvium (years 8 and 9) and when the south pit mines through the Coal Creek (Sandy Creek South) alluvium.

The drain budget also does not account for the one-off volume of water removed by mining up the saturated alluvium sediments of Coal Creek. Based on the measured area of the mined alluvium (93.142 ha), estimated saturated thickness (2 m) and estimated specific yield (7.4%), the volume of groundwater contained in the alluvial sediments is approximately 137.9 ML.

1.4.4 Predictive run – zone budgets

Zone budgets were extracted for the individual alluvial areas of Dartbrook (Middle Brook and Kingdon Ponds), Sandy Creek North, Sandy Creek South (including Coal Creek), Spring Creek and Hunter River. The groundwater gradient mostly causes the groundwater flows from weathered regolith to alluvium, occasional periodic and short term reversals of flow are caused by rainfall events and associated higher recharge to alluvium. The flow rates into the alluvium are on average 420 m³/day for Dartbrook and Kingdon Ponds, 280 m³/day for Sandy Creek North, 358 m³/day for Coal Creek, 280 m³/day for Sandy Creek South, 133 m³/day for Spring Creek and 233 m³/day for Hunter River. See Table C 16 for the summary statistics of flow rates for individual alluvial zones and Figure C 23 for transient flow rates to alluvial zones surrounding the Project.

The impact of the Project on the alluvium flows (change of flow rates) were examined by comparing the water budgets of two model scenarios: scenario where the mine is implemented ('mine' run) and scenario without the mine ('no-mine' run) under otherwise unchanged conditions. The comparison of budgets for individual alluvial zones (see Figure C 24) shows several trends:

- The Sandy Creek North alluvium is not being mined, however the mining activity north and south of the alluvial zone temporarily changes the groundwater flow regime in the vicinity of the alluvium (lowered groundwater flow gradients from the outside towards alluvium) resulting in the decrease of inflows into the alluvium by approximately 180 m³/day (1.15 ML/year) between years 7 and 9 of mining.
- Coal Creek alluvium is being mined out during mining year 17. The flow into alluvium gradually decreases from year 14, any potential inflow is lost after year 17. The loss of inflow for Coal Creek alluvium averages at approximately 255 m³/day (93 ML/year). Due to the planned diversion of Coal Creek, the loss of inflow will likely to be lower. This option was however not addressed by modelling due to lack of available information about the diversion.
- Sandy Creek South alluvium is being affected indirectly as the mine progresses alongside the creek in a NE to SW direction. Predicted inflows into alluvium start to decrease past mining year 12 with an average decrease in inflow of 15 m³/day (5.7 ML/year).
- As the mining activity moves towards south-west, predicted inflows into Spring Creek alluvium start to gradually decrease around mining year 25. On average, the loss of alluvial inflow represents 30 m³/day (10.9 ML/year) peaking towards the very end of the mining at 163 m³/day (59.6 ML/year).
- The decrease of inflows into alluvial zones of Dartbrook and Hunter River is negligible.
- The predicted combined loss of alluvial inflows due to the mining activities associated with the Project is dominated by loss of inflows into the Coal Creek alluvium. The peak value occurs towards the end of mining due to combination of effects on Spring Creek and Coal Creek alluvium. The average combined loss of seepage into all alluvial aquifers is 240 m³/day (87 ML/year), peaking at 616 m³/day (225 ML/year)
- The less water seeps into the alluvial aquifer, the less water is able to seep through the stream bed into the creeks in the form of baseflow. The predicted loss of recharge into alluvium then directly translates into the loss of baseflow.

Due to the simplified conceptualization imposed on the numerical model, following items that can significantly impact the model budgets were not considered:

- During the modelling of the mining progression, hydraulic properties of the mined area were
 not changed to simulate spoil emplacement. Spoil has usually higher hydraulic conductivity
 and storage than native rock and accepts more diffuse recharge. Placement of spoil will likely
 influence the change of flow into alluvium of Sandy Creek North as the hydraulic system will
 not return into pre-mining equilibrium.
- The model does not take into account the diversion of the Coal Creek. The Coal Creek diversion
 will impact the area of recharge at the western and southern side of the pit well as stage in
 Sandy Creek South and possibly Spring Creek. The details of this surface water project were
 not available at the time.

Table C 16 Summary of inflow rates into individual alluvial zones

| Alluvium zone | Min (m3/day) | 1 st quartile (m3/day) | Average (m3/day) | 3 rd quartile (m3/day) | Max (m3/day) |
|--------------------------|-----------------|--------------------------------------|---------------------|--------------------------------------|-----------------|
| Dartbrook, Kingdon Ponds | -4394.2 | 364.6 | 419.4 | 518.5 | 2564.1 |
| Sandy Crk North | -387.1 | 255.6 | 282.4 | 333.0 | 630.3 |
| Coal Crk *) | 32.2 | 303.5 | 357.9 | 408.4 | 660.5 |
| Sandy Crk South | -548.6 | 230.7 | 279.7 | 343.1 | 761.9 |
| Spring Crk | -1029.7 | 109.4 | 133.2 | 222.6 | 558.9 |
| Hunter River | -262.7 | 219.2 | 233.4 | 252.8 | 690.8 |

Note: *) Statistics for Coal Creek alluvium are calculated only up to year 17 when the drain cells intersect the alluvium. After that point, the alluvium (and all inflows into it) are removed from calculations

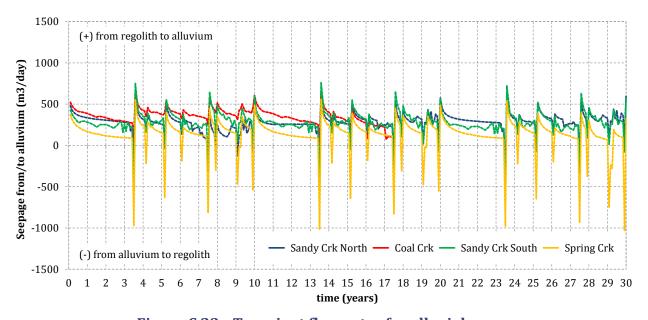


Figure C 23 Transient flow rates for alluvial zones

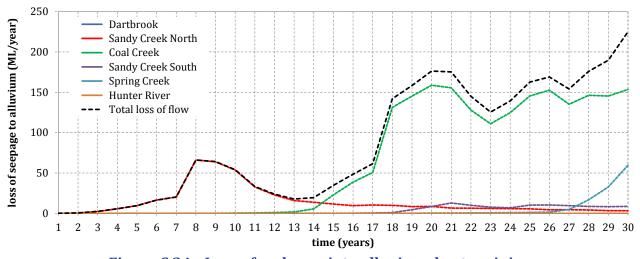


Figure C 24 Loss of recharge into alluvium due to mining

Table C 17 Summary of loss of recharge rates into affected alluvial zones

| | Min (m3/day) | 1st quartile (m3/day) | Mean (m3/day) | 3rd quartile (m3/day) | Max (m3/day) |
|--------------------------------|-----------------|--------------------------|------------------|--------------------------|-----------------|
| Sandy Creek North | 0.28 | 13.11 | 39.45 | 41.96 | 180.91 |
| Coal Creek | 0.00 | 0.14 | 254.78 | 398.93 | 434.70 |
| Sandy Creek South | 0.00 | 0.00 | 14.75 | 25.56 | 35.00 |
| Spring Creek *) | 0.00 | 0.00 | 29.78 | 29.65 | 163.25 |
| Cumulative loss of recharge +) | 0.28 | 53.89 | 238.75 | 430.49 | 615.84 |

^{*)} Although the majority of Spring Creek alluvium is not classified as a highly productive alluvium, it was included for sake of completeness.

1.4.5 Predictive run – drawdowns and impacted bores.

Drawdowns, calculated as a difference between 'no-mine' and 'mine' heads were calculated for layers 2, representing the unconfined weathered regolith and alluvial aquifers and layer 9, representing the deepest coal seam mined within the Project area. 1 m and 2 m contours of cumulative drawdown were then used to select bores impacted by the mining activity. In total, 37 bores were impacted by mining.

Table C 18 Bores impacted by drawdown greater than 1 m

| Bore | Easting | Northing | Model layer | Max draw- down (m) | Max drawdown date | Mined out | НРА | PAA |
|-----------|----------|-----------|----------------|-----------------------|---------------------|--------------|-----|-----|
| GOW01 | 286554.4 | 6430771.2 | 1 | 4.1 | 28 years, 12 months | no | no | no |
| GW016279 | 288584.1 | 6434625.0 | 1 | 13.3 | 17 years, 5 months | yes | yes | yes |
| GW022292 | 289217.7 | 6434391.7 | 1 | 16.7 | 18 years, 11 months | yes | yes | yes |
| GW032889 | 290775.4 | 6433807.7 | 1 | 11.0 | 17 years, 7 months | yes | yes | yes |
| GW052617 | 289781.1 | 6433756.3 | 1 | 14.1 | 19 years, 11 months | yes | yes | yes |
| GW078457X | 289728.7 | 6433755.2 | 1 | 14.1 | 19 years, 11 months | yes | yes | yes |
| GW200257 | 290635.5 | 6432950.7 | 1 | 9.7 | 20 years, 12 months | yes | yes | yes |
| ING01 | 286632.4 | 6429549.5 | 1 | 2.7 | 29 years, 1 month | no | no | no |
| JEN01 | 286639.9 | 6429854.8 | 1 | 4.1 | 29 years, 1 month | no | no | no |
| PIT1 | 291243.6 | 6437765.2 | 1 | 1.7 | 8 years, 12 months | no | yes | yes |
| PIT2 | 291337.6 | 6437735.4 | 1 | 2.0 | 8 years, 12 months | no | yes | yes |
| ROS01 | 291189.0 | 6437830.0 | 1 | 1.8 | 8 years, 12 months | no | yes | yes |
| SPAR2 | 289994.5 | 6433498.0 | 1 | 18.6 | 19 years, 11 months | yes | yes | yes |
| SPAR5 | 289875.9 | 6433546.7 | 1 | 16.0 | 19 years, 11 months | yes | yes | yes |
| WEK2 | 288753.6 | 6434415.6 | 1 | 16.9 | 18 years, 7 months | yes | yes | yes |
| WEK3 | 288701.4 | 6434592.8 | 1 | 18.6 | 17 years, 8 months | yes | yes | yes |

⁺⁾ The statistics for the cumulative recharge losses are calculated from the cumulative value of recharge for the nominated alluvial areas and is not a simple sum of individual statistical parameters.


| Bore | Easting | Northing | Model layer | Max draw- down (m) | Max drawdown date | Mined out | НРА | PAA |
|-----------|----------|-----------|----------------|-----------------------|---------------------|-----------|-----|-----|
| GW011315 | 293175.4 | 6435582.6 | 2 | 2.1 | 23 years, 8 months | no | no | no |
| GW024558 | 289109.7 | 6434543.5 | 2 | 17.7 | 17 years, 7 months | yes | yes | yes |
| GW025631 | 288674.7 | 6436034.7 | 2 | 1.6 | 16 years, 1 month | no | yes | yes |
| GW029518 | 293482.3 | 6434664.5 | 2 | 1.9 | 23 years, 9 months | no | no | no |
| GW037914 | 287239.7 | 6430036.3 | 2 | 10.9 | 29 years, 10 months | no | no | no |
| GW038412 | 291506.7 | 6437736.1 | 2 | 2.6 | 9 years, 1 month | no | yes | yes |
| GW057443X | 292938.7 | 6431787.7 | 2 | 1.1 | 23 years, 8 months | no | no | no |
| GW057600X | 293230.8 | 6432872.2 | 2 | 1.9 | 23 years, 8 months | no | no | no |
| GW078471 | 291577.2 | 6436442.1 | 2 | 4.4 | 9 years, 1 month | yes | no | yes |
| ROS2 | 290848.4 | 6437830.8 | 2 | 3.1 | 8 years, 12 months | yes | no | yes |
| SPAR1 | 291428.6 | 6433506.5 | 2 | 5.9 | 21 years, 3 months | no | yes | yes |
| SPAR3 | 291439.7 | 6433548.5 | 2 | 5.8 | 21 years, 4 months | no | yes | yes |
| SPAR4 | 290210.3 | 6433732.9 | 2 | 15.5 | 19 years, 1 month | yes | yes | yes |
| WILCROW01 | 290912.9 | 6438672.7 | 2 | 1.1 | 9 years, 4 months | no | no | yes |
| WYL1 | 291169.5 | 6438494.8 | 2 | 5.2 | 9 years, 12 months | yes | no | yes |
| DAY1 | 292850.4 | 6441989.5 | 5 | 11.6 | 3 years, 1 month | no | no | yes |
| DOR01 | 290386.4 | 6438064.9 | 5 | 37.3 | 9 years, 1 month | no | no | yes |
| GW026995 | 287862.7 | 6432791.8 | 5 | 66.8 | 24 years, 4 months | yes | no | yes |
| GW033267 | 292046.3 | 6442091.9 | 5 | 12.9 | 4 years, 5 months | no | no | yes |
| GW200213 | 290444.4 | 6438126.0 | 5 | 37.1 | 9 years, 1 month | no | no | yes |
| GW200214 | 290518.1 | 6438166.9 | 5 | 37.7 | 9 years, 1 month | no | no | yes |


Note: PAA – Project Assessment Area, HPA – Highly productive aguifer


Out of these, 16 bores lie within the footprint of the mine and will be destroyed and 21 bores lie outside of the mine footprint and will be likely impacted by drawdown. 19 of the 37 bores are located in the highly productive aquifer (HPA) and 29 of the bores lie within the PAA. List of impacted bores is presented in Table C 18 and each of the impacted bores is shown on the map of the cumulative drawdown for layers 2 and 9 (Figure C 25).


The time progression of drawdown is shown on series of the drawdown maps (again presented for model layers 2 and 9) for mining years 3 (the Blakefield seam is initially mined), year 10 (mining reaches Sandy Creek North, mining south of the Sandy Creek North alluvium starts), year 20 (Sandy Creek South alluvium was mined, approximately half way through southern pit) and year 30 (end of mining). Drawdown contours are presented in Figure C 26 to Figure C 29.

Figure 30 shows hydrographs of when predicted drawdowns will occur at private bores outside the mine footprint.

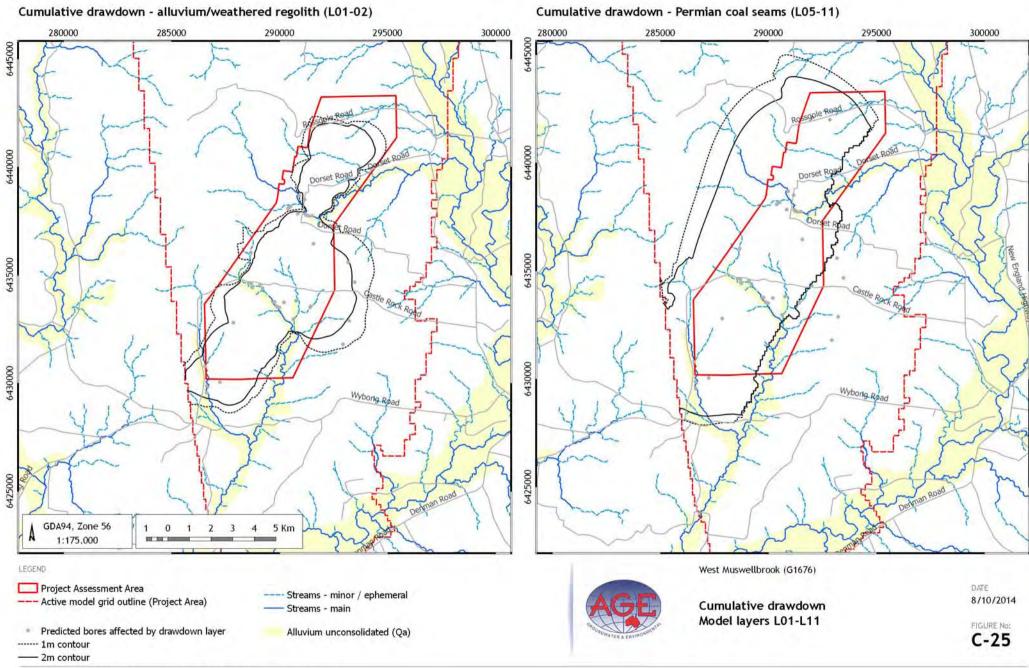

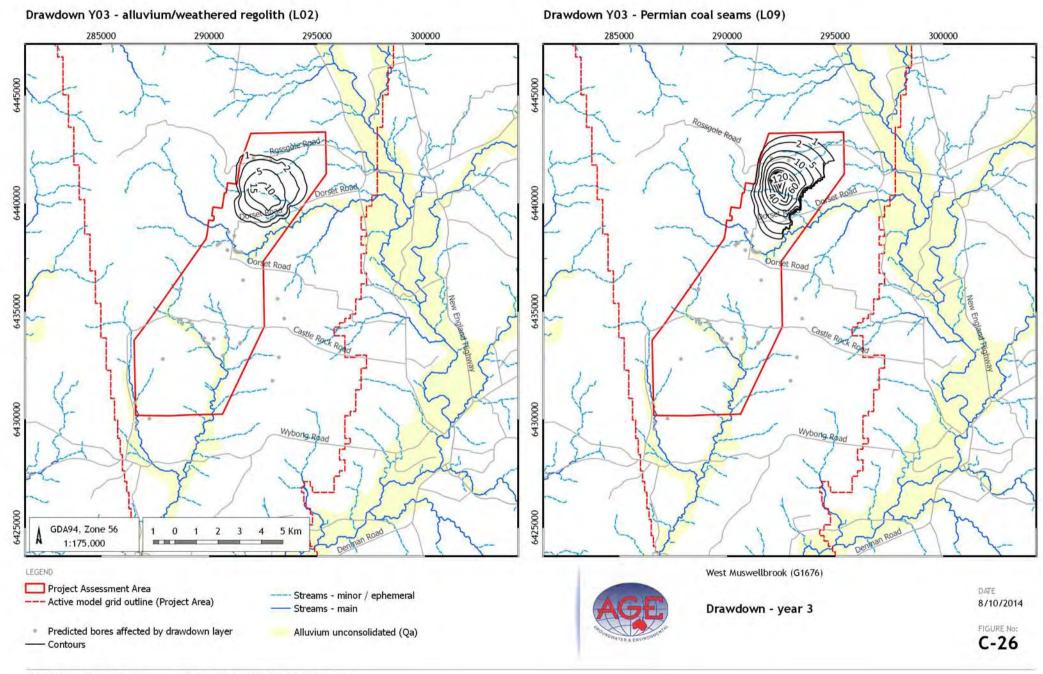

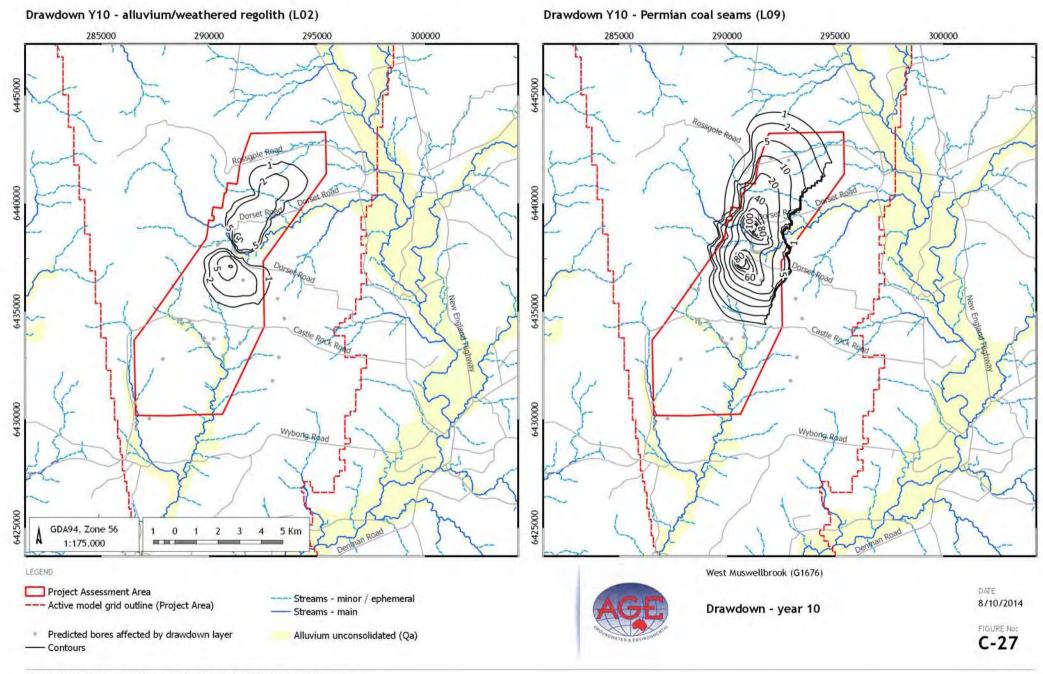

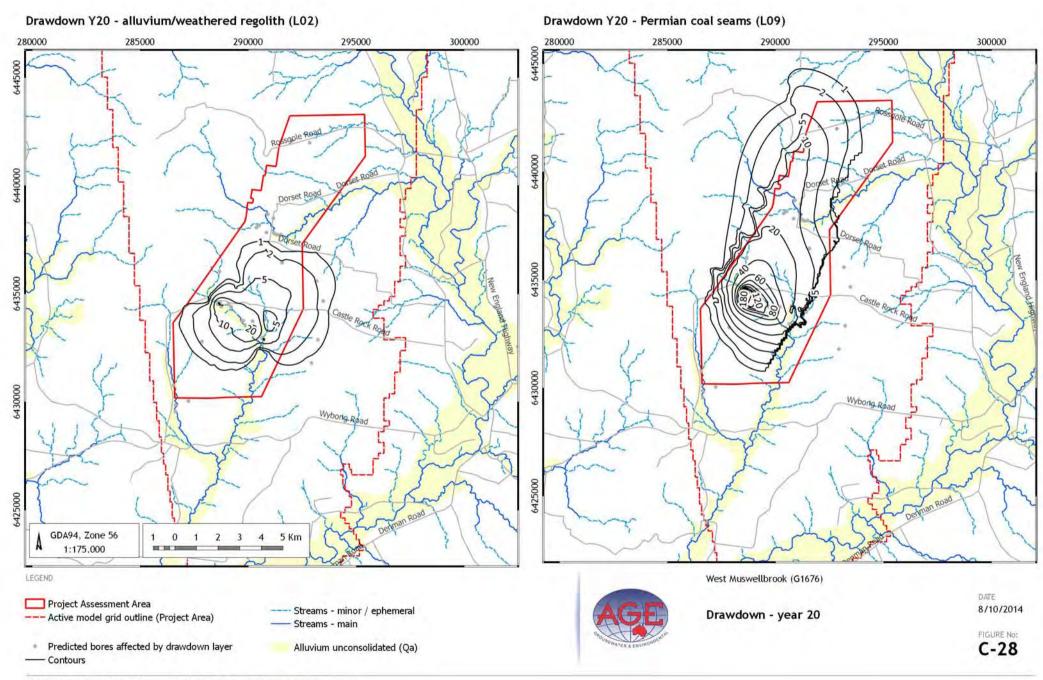



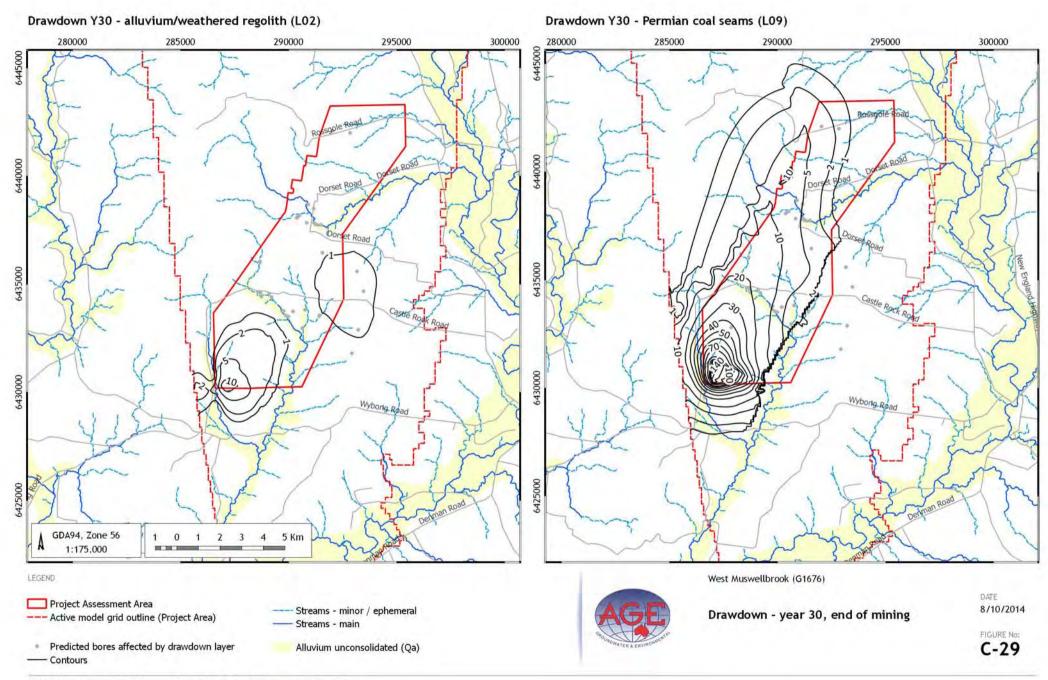



Figure C 30 Hydrographs – drawdowns on affected bores outside of mine footprint (below)



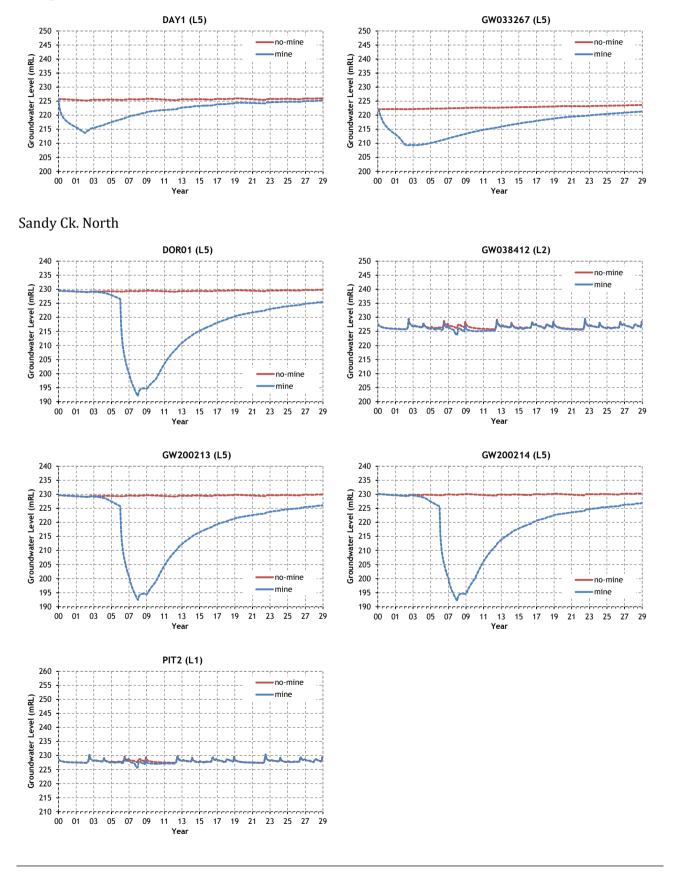



Coal Creek

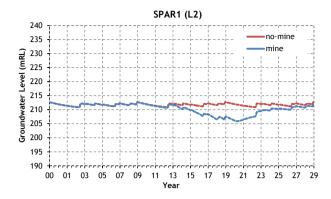


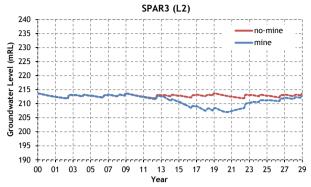

Spring Creek

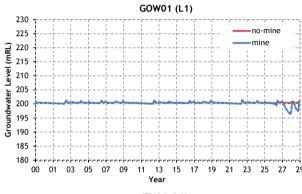

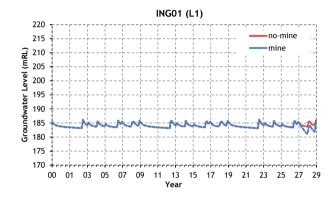

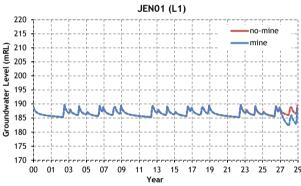

Weathered regolith east of Blakefield seam subcrop:

