

ARBORICULTURAL IMPACT ASSESSMENT REPORT

Centre of Excellence

Address: 27 Vines Drive, Richmond

Prepared for: NBRS Architecture

DOC No: ARB-2106-001

JOB No: 2106

REV: G

DATE: 13.12.2021

PREPARED BY:

Guy Sturt

B L Arch (UNSW) AILA Registered Landscape Architect

Dip. Arboriculture AQF5 Consulting Arborist

STURT NOBLE ARBORICULTURE

Suite 91, 330 Wattle Street, ULTIMO NSW 2007

Tel. (02) 9211 3744



CONTENTS

1.0	INTRODUCTION	3
1.1	Purpose of this Report	3
1.2	Background	3
1.3	The Proposal	3
1.4	Foreseeable Construction Impacts	4
2.0	PLANNING CONTROLS	6
2.1	Council Consent	6
3.0	THE EXISTING SITE	7
3.1	The Site	7
3.2	Soils	7
3.3	The Trees	8
4.0	ABORICULTURE IMPACT ASSESSMENT	9
4.1	Construction Assumptions	9
4.2	Trees to be removed	9
4.3	Trees to be retained	10
4.4	Works within Tree Protection Zones	10
4.5	Pruning works	10
4.6	Ongoing management of trees to be retained	10
5.0	MITIGATION MEASURES	11
5.1	Tree Protection Measures	11
5.2	Tree Protection Zones	11
5.3	Tree Protection Fencing	12
5.4	Trunk, Branch & Ground Protection	12
5.5	Demolition Works within Tree Protection Zones	13
5.6	Excavations within Tree Protection Zones	13
5.7	Underground Services	13
5.8	Grading and Level Changes	14
5.9	Canopy pruning	14
5.10	Root Investigation	14
5.11	Root Pruning	15
5.12	Tree Damage/ Decline	15
6.0	CONCLUSION	16
7.0	DISCLAIMER	18
8.0	REFERENCES	19
	APPENDIX 1: METHODOLOGY	20

APPENDIX 2:	PLANS	24
APPENDIX 3:	TREE ASSESSMENT SCHEDULE	25
APPENDIX 4:	TYPICAL TREE PROTECTION DETAILS	26

1.0 INTRODUCTION

1.1 Purpose of this Report

Sturt Noble Arboriculture was engaged by NBRS Architecture to assess existing trees, prepare an Arboricultural Impact Assessment Report and Tree Protection Recommendations in relation to the proposed construction of Centre for Excellence in Richmond.

The purpose of this report is to address the Secretary's Educational Assessment Requirements (SEARs) for the project, dated 19th March 2021. Specifically, to:

- Identify the number and location of existing trees on site
- Detail the size and percentage canopy density of each tree
- To assess and review the condition of existing trees by undertaking a Visual Tree Assessment
- Assess each individual tree's suitability to be retained as a sustainable part of the proposed development in the long term, considering the likely impacts of works proposed.
- Provide recommendations for tree removal, retention and protection
- Provide detailed justification for each tree to be removed or retained and protected
- Provide recommendations where appropriate to enable trees to be retained or have better long term health outcomes and minimize potentials for hazard.
- To provide information on appropriate tree protection measures, appropriate setbacks, constraints and tree management procedures during site works.

This report has been carried out as per the Methodology outlined in **Appendix 1**

1.2 Background

The preparation of this report has been prepared in awareness and consideration of the following standards, controls and guidelines:

- Hawkesbury City Council DCP 2013
- Australian Standard AS4970-2009 *Protection of Trees on Development Sites*
- Australian Standard AS4373-2007 *Pruning of Amenity Trees*
- Australian Standard AS2303-2015 *Tree Stock for Landscape Use*

It has also taken into consideration advice from the following reports:

- Arboricultural Impact Assessment Report prepared by Urban Arbor 10/10/2017
- Biodiversity Development Assessment Report prepared by Narla Environmental Pty Ltd. Final v4. 3rd of December 2021.

1.3 The Proposal

This impact assessment has been prepared based on the following plans:

- 79528_REV-A, PLAN SHOWING DETAIL AND LEVELS OVER PART LOT 2 D.P.1051798 & PART LOT 3 D.P.1105163 WESTERN SYDNEY UNIVERSITY HAWKESBURY CAMPUS, 11/02/2021 prepared by Rygate Surveyors
- 20417-NBRS-A—SD-0102, Proposed Site Plan prepared by NBRS Architecture
- Site remediation plan by Richard Crookes Construction 20417-NBRS-SSDA-0104.

Refer to plans in **Appendix 2**

The proposed works to the site include:

- Construction of three academic blocks (Block B, C and D)
- Short term dormitory site accommodation with capacity for 62 patrons (Block F)
- Dining hall, conference space and canteen (Block E)
- Administrative building (Block A)
- Support facilities for management and maintenance of site
- External works to accommodate circulation and covered walkways between buildings
- Pedestrian walkways
- Student and staff amenities
- Covered outdoor learning areas
- Staff car parking area and mini-bus drop off and pick up area. The parking located in front of Block A is for visitors
- Short-term accommodation car parking area. The parking near Block F is for staff
- Green house
- Demolition of existing fences
- Construction of several new administration, educational and accommodation buildings
- Construction of two new carparking areas
- Installation of associated landscape hardscapes and softscapes
- Nominated planting areas
- Associated works
- Remediation of contaminated soil

1.4 Foreseeable Construction Impacts

Foreseeable impacts noted from the proposed development, construction type and anticipated methodology include:

- Excavations for new buildings
- Excavations for new carparking areas
- Excavations for new hardscape areas
- Remediation/ removal of contaminated soil
- Ripping or cultivation of soil for landscaped areas.

- Soil level changes including the placement of fill material for the footings and to make up grades to landscape areas.
- Laying impermeable paving to paths, carparks and slabs.
- Movement and storage of plant, equipment & vehicles;
- Erection of site sheds;
- Storage of building materials, waste and waste receptacles.

2.0 PLANNING CONTROLS

2.1 Council Consent

Hawkesbury City Council's DCP notes the following trees and vegetation are prescribed (protected):

- Any tree with a height greater than 4 metres, or a branch spread greater than 3m, or a trunk circumference greater than 500mm at 1m above ground level
- Native trees or vegetation on land zoned SP1 Special Activities
- Trees within 40m of a watercourse

Hawkesbury City Council's DCP notes the following matters for consideration. Is the tree or vegetation:

- Significant as a single specimen or as part of a group
- Of historic or cultural significance
- Registered on Council's Significant Tree Register
- Prominent due to its height, size, position or age
- Endemic, rare or threatened

Hawkesbury City Council's DCP notes the following shall not generally be considered as valid reasons to ringbark, cut down, top, lop, remove, injure, slash poison or wilfully destroy trees or vegetation:

- To construct a building when the structure could be relocated away from the tree or vegetation

Under these planning controls, the following should be noted:

- Trees 12 – 23A (*Lagerstroemia indica*) are exempt from the TPO due to their low height and small DBH

3.0 THE EXISTING SITE

3.1 The Site

The site is located at 27 Vines Drive, Richmond on part Lot 2 D.P.1051798. The site is currently occupied by grassy fields and grazing land, with Western Sydney University Village to the north-west, Western Sydney University recreational buildings to the north-east, and grassy fields and grazing land to all other sides. The site is almost flat with a creekline to the south-western boundary, a concrete drain to the north-western boundary and a grassed swale to the eastern boundary.

The site currently contains a mix of endemic and exotic trees.

Area of Investigation – 24,000m²



3.2 Soils

The site soil is made up of heavy clays and clayey sands with some large boulders throughout. This type of soil covers a wide area between the lower terraces of the Hawkesbury/Nepean River system and west of South Creek. The soil lies over the Londonderry Clay formation and the landscape is generally flat terraces with some gently undulating low rises.

Most of the remnant natural vegetation that can be found on this soil type is located in the Castlereagh State Forest. There are some small areas of uncleared scrub located between small farms and quarries. This soil type has high erodibility and generally low fertility. It can be a flood hazard, become seasonally waterlogged or be a water erosion hazard.

It is noted contaminated soil from past Agricultural activity has been identified on a portion of the site at the South West.

3.3 The Trees

Twenty-eight (28) trees located within the area of investigation have been surveyed as part of this assessment. The trees consist of a mix of eleven (11) Australian endemic trees and seventeen (17) exotic trees. Refer to **Appendix 2** for tree locations

Each of the trees assessed has been allocated a Sustainable Retention Index Value (SRIV) that is based on their health, vigour, structure and age class. The SRIV does not take into account the impact of the proposed development.

7 trees outside of the main site area have been identified in vicinity of the remediation area but will be retained and protected.

A complete and detailed tree assessment schedule was prepared and is included in **Appendix 3**.

In addition trees assessed in Biodiversity Development Assessment Report prepared by Narla Environmental located in the area of agricultural plots were viewed.

The majority of these trees are located immediately adjacent to the drainage line and outside the existing fenceline (and site boundary). Most of these are endemic tree specimens of *Angophora floribunda* and *Eucalyptus tereticornis* further down the channel. These range in size from juvenile to mature specimens and have high value to be retained as remnant trees as a group.

With regard to contamination; I note that it has yet to be fully tested as to where excavation is required. Any trees within the contamination area will not be able to be retained and any potential to retain trees around the contamination area will be based on the final Validation Inspection.

4.0 ABORICULTURE IMPACT ASSESSMENT

4.1 Construction Assumptions

It is assumed for this report that excavation for buildings will not extend greater than 500mm from the building envelopes and this limit can be considered to be the extent of disturbance to the root zones with the exception of service lines.

Further detail of site works are required particularly details of excavation extent of services (water, telecoms and electrical) and level changes particularly within the TPZ of any trees proposed for retention. This should be provided prior to construction so any additional impacts can be assessed.

4.2 Trees to be removed

The plans show that seven trees (7) will need to be removed to accommodate the proposed development. A further five (5) juvenile street trees can either be removed or transplanted.

Table 1: Trees to be removed

Development footprint critical to the following trees	Other (poor condition, other studies, etc)	Remediation of contaminated land.
5, 6, 7, 8, 9, 26, 27		Trees assessed in Biodiversity Development Assessment Report prepared by Narla Environmental (<i>Angophora floribunda</i> and <i>Eucalyptus tereticornis</i>)

Trees 5 – 9 are native trees of moderate landscape significance. Trees 5, 6, 8 and 9 are in fair condition with short – medium term retention potential. Tree 7 is suppressed with short-term retention potential. All five trees are required to be removed to allow for the proposed development footprint.

Trees 26 and 27 are non-native trees in poor condition. They are required to be removed to allow excavation of an OSD dam on site and should be replaced with trees endemic to the area.

Table 2: Trees to be removed or transplanted

Development footprint critical to the following trees	Other (poor condition, other studies, etc)	Dead / Weed species to be removed (exempt and can be removed without consent)
15, 16, 21, 22, 23		

Trees 15, 16, 21, 22 and 23 are newly planted street trees and are required to be removed to accommodate the proposed development. They have high potential to be transplanted due to their youth and high quality.

The SSD should seek approval for the removal of Tree Nos. 5, 6, 7, 8, 9, 26 and 27.

4.3 Trees to be retained

With implementation of the tree protection measures it should be possible to retain all other trees on the developed site. The plans show that fourteen (14) trees are proposed to be retained.

Table 2: Trees to be retained

Clear of all works	Minor Encroachment	Major Encroachment
1-4, 10-14, 17-20, 24		

Proposed site design and Construction of the development and associated infrastructure/ facilities should consider the Tree Protection Zones as discussed in the following sections to minimise any adverse impact.

7 trees outside of the main site area have been identified in vicinity of the remediation area but will be retained and protected.

4.4 Works within Tree Protection Zones

- Any disturbance to soils within TPZ's could destabilise the trees or impact on long term health. Should any changes to soil within the TPZ/ SRZ be proposed further discussion and assessment must be undertaken.
- It is noted little major demolition is required on this site.

The plan in **Appendix 2** indicates trees TPZ's and SRZ's and should be used to inform later design decisions and temporary tree protection fences.

4.5 Pruning works

In addition to Tree Protection Zones, the extent of the canopy (canopy dripline) should also be considered, particularly in relation to construction activities and along access points.

Significant pruning of trees to accommodate digging machinery is generally not acceptable. Trees may not be pruned by more than 10% without consent.

Branches should be temporarily pushed or tied where possible to minimise the amount of pruning works.

4.6 Ongoing management of trees to be retained

A number of the trees identified to be retained have structural defects and/or deadwood at the time of assessment. Ongoing monitoring and maintenance should be undertaken especially for trees located in areas of high use and activity.

5.0 MITIGATION MEASURES

5.1 Tree Protection Measures

It is recommended that a site specific Tree Protection Plan (TPP) is prepared to guide the construction process to ensure all trees designated for retention remain as a sustainable part of the landscape in the long term.

The plan shall be prepared by a consulting arborist (AQF Level 5) and should at a minimum include a detailed plan of the locations of, and specifications for, tree protection measures.

The TPP shall include a monitoring schedule relating to critical points during the works (hold points) where the Project Arborist is required to visit the site and confirm that works are being undertaken as conditioned by Council/as required.

The following tree protection measures shall be implemented prior to the commencement of any site works, and shall remain in place for the duration of the development.

5.2 Tree Protection Zones

The Tree Protection Zones recommended for all trees within the site are to be retained and shall be equivalent to the Tree Protection Zone as specified in this report. This is a radial distance measured from the centre of the trunk of the subject trees.

The following activities are prohibited within the specified Tree Protection Zones:-

- Excavations and trenching (with exception of the approved foundations and underground services);
- Ripping or cultivation of soil;
- Excavation within soil remediation areas
- Mechanical removal of vegetation;
- Soil disturbance or movement of natural rock;
- Soil level changes including the placement of fill material (excluding any suspended floor or slab);
- Movement and storage of plant, equipment & vehicles;
- Erection of site sheds;
- Affixing of signage or hoardings to trees;
- Storage of building materials, waste and waste receptacles;
- Disposal of waste materials and chemicals including paint, solvents, cement slurry, fuel, oil and other toxic liquids;
- Other physical damage to the trunk or root system; and
- Any other activity likely to cause damage to the tree.

Place a 50-75mm layer of coarse organic mulch over the entire surface of the TPZ. Where the TPZ is adjacent to construction activities first lay down geotextile fabric

beneath the mulch to facilitate easy removal of the mulch at completion and any accidental spillage of construction materials.

Install drip irrigation around the root zone if required by the Project Arborist.

5.3 Tree Protection Fencing

All trees within the site to be retained shall be protected prior to and during construction from all activities that may result in detrimental impact by erecting a suitable protective fence beneath the canopy to the full extent of the Tree Protection Zone (excluding the footprint of the proposed works and areas within adjoining properties).

As a minimum the fence should consist of temporary chain wire panels 1.8 metres in height, supported by steel stakes as required and fastened together and supported to prevent sideways movement. The fence shall be erected prior to the commencement of any work on-site and shall be maintained in good condition for the duration of construction. Where tree protection zones merge together a single fence encompassing the area is deemed to be adequate.

Appropriate signage shall be installed on the fencing to prevent unauthorised movement of plant and equipment or entry to the Tree Protection Zone.

Refer to **Appendix 4** for examples of protective fencing and signage.

Where remediation of contaminated soil can not be carried out within TPZs it is noted permanent fencing will be installed to limit access to these areas.

5.4 Trunk, Branch & Ground Protection

Where provision of tree protection fencing is impractical due to its proximity to the proposed building envelope, trunk protection shall be erected around the tree to avoid accidental damage. As a minimum, the trunk protection shall consist of two metre (2m) lengths of hardwood timbers (100 x 50mm) spaced at 100-150mm centres secured together with 2mm galvanised wire. These shall be strapped around the trunk (not fixed in any way) to avoid mechanical injury or damage. Trunk protection should be installed prior to any site works and maintained in good condition for the duration of the construction period.

Pavements should be avoided within the Tree Protection Zone of trees to be retained where possible. Proposed paved areas within the Tree Protection Zone of trees to be retained should be placed above grade to minimise excavations within the root zone and avoid root severance and damage.

Placement of fill material within the Tree Protection Zone of trees to be retained should be avoided where possible. Where placement of fill cannot be avoided, the material should be a coarse, gap-graded material such as 20 – 50mm crushed basalt (Blue Metal) or equivalent to provide some aeration to the root zone. Note that Roadbase or crushed sandstone or other material containing a high percentage of fines is unacceptable for this purpose. The fill material should be consolidated with a non-vibrating roller to minimise compaction of the underlying soil. A permeable geotextile may be used beneath the sub-base to prevent migration of the stone into the sub-grade. No fill material should be placed in direct contact with the trunk.

Refer to **Appendix 4** for examples of trunk, branch and ground protection.

5.5 Demolition Works within Tree Protection Zones

Where demolition of structures and pavements is required within the Tree Protection Zones of trees to be retained it is to be carried out to avoid disturbance to existing soils, damage to existing roots or potential root growth.

Machinery shall work within the footprint of existing pavements where possible to avoid compaction of the adjacent soil and Tree Protection Zones.

When removing hard surfaces it shall be stripped-off in thick layers using a small rubber tracked excavator or alternative approved method to avoid damage to underlying roots and minimise soil disturbance. The final layer of sub-base material shall be removed using hand tools where required to avoid compaction of the underlying soil profile and damage to woody roots.

If any concentrations of roots or roots with diameters equal to or greater than 50mm are encountered they must be retained in an undamaged condition for assessment by the Project Arborist. If the Project Arborist deems surrounding underground elements such as footing and pipes are providing support, these elements shall be left in-situ.

5.6 Excavations within Tree Protection Zones

The excavator shall work within the footprint of existing pavements where possible to avoid compaction of the adjacent soil and Tree Protection Zones.

Further detail of foundation/footing systems is required prior to construction so any additional impacts can be assessed.

5.7 Underground Services

All proposed underground services should be located as far away as practicable from existing trees to be retained to avoid excavation within the Tree Protection Zone.

For underground services, where the incursion to the Root Zone is less than 10% of the total TPZ (i.e. beyond the Minimum Setback Distance), a chain trenching device may be used. A backhoe or skid steer loader (bobcat) is unacceptable due to the potential for excessive compaction and root damage. Where large woody roots (greater than 50mm in diameter) are encountered during excavation or trenching, these shall be retained intact wherever possible (eg by sub-surface boring beneath roots or re-routing the service etc).

Excavations required for underground services within the Structural Root Zone of any tree to be retained should only be undertaken by sub-surface boring. The Invert Level of the pipe, plus the pipe diameter, must be lower than the estimated root zone depth as specified at a minimum depth of 600mm. This will depend on the soil conditions at the site. Where this is not practical and root pruning is the only alternative, proposed root pruning should be assessed by the Project Arborist to determine continued health and stability of the subject tree.

Further detail of site services is required prior to construction so any additional impacts can be assessed.

5.8 Grading and Level Changes

Further detail of level changes, particularly within the TPZ of any trees proposed for retention is required prior to construction so any additional impacts can be assessed.

5.9 Canopy pruning

Care shall be taken when operating backhoes, excavators and similar equipment near trees to avoid damage to tree canopies (foliage and branches). Under no circumstances shall branches be torn-off by construction equipment. Where there is potential conflict between tree canopy and construction activities, the advice of the Project Arborist must be sought.

All pruning works shall be directed by the Project Arborist and shall be carried out by an AQF Level 3 Arborist. All pruning works shall be in accordance with the Australian Standard (AS) 4373:2007 *Pruning of amenity trees*. This standard outlines appropriate pruning practices and procedures that reduce the risk of damage and injury to trees. Correct pruning practices respect the natural form and branching habit of a tree and work with the trees natural defence mechanisms against disease to avoid damage and injury to trees.

Pruning should always be limited to the minimum amount necessary to achieve the desired aim. Significant loss of foliage created by excessive pruning may weaken the tree, leading to premature decline or predisposition to branch failure or disease, creating potential hazards.

Council consent will be required prior to commencement of the work. Pruning must be performed in accordance with *Australian Standard (AS) 4373:2007 Pruning of amenity trees* (Standards Australia 2007).

5.10 Root Investigation

Exploratory excavation may be required where the proposed excavation created by the development works exceeds 10% of the Tree Protection Zone of any Prescribed Tree; or service trenches are required within the TPZ; to determine the impact of the development on the tree. The purpose of the investigation is to verify the quantity, size, type, depth and orientation of tree roots along the perimeter of the proposed encroachment in order to make an informed judgement in relation to the potential impact on the tree.

Exploratory excavation shall only be carried out using non-destructive or non-injurious techniques, such as careful digging using hand held implements, using compressed air (Airspade®), water pressure, or suction (vacuum device) or a combination of these techniques, to carefully remove soil without damaging roots. The work shall be undertaken by an arborist with a minimum qualification of AQF Level 3. Once roots are exposed, a visual examination can be carried out with the Project Arborist to evaluate the potential impact of the proposed root loss on the health and stability of the tree.

The results of the root investigation together with the Development Impact Assessment must be documented in the report and submitted together with the DA. The report shall

contain information that demonstrates that the trees will remain viable in conjunction with the works.

5.11 Root Pruning

Where root pruning is required, roots shall be severed with sterile, clean, sharp pruning implements resulting in a clean cut. Any excavated root zones shall be retained in a moist condition during the construction phase using Hessian material or mulch where practical. Trees that have roots removed shall have drip irrigation installed around the root zone to ensure they receive an adequate supply of water.

5.12 Tree Damage/ Decline

If trees show signs of stress or deterioration, remedial action shall be taken to improve the health and vigour of the subject tree(s) in accordance with best practice arboricultural principles. Advice must be sought from the Project Arborist.

In the event of any tree becoming damaged for any reason during the construction period the Project Arborist must be engaged to inspect and provide advice on any remedial action to minimise any adverse impact. Such remedial action shall be implemented as soon as practicable and certified by the arborist.

6.0 CONCLUSION

Twenty eight (28) trees have been considered on the site as part of this assessment and their locations are shown in **Appendix 1**. The trees consist of a mix of eleven (11) Australian endemic trees and seventeen (17) exotic trees. Refer to **Appendix 2** for tree locations

The proposed development is a Centre for Excellence Secondary School, known as the Hawkesbury and is located within the WSU Richmond Campus.

The plans show that seven trees (7) will need to be removed to accommodate the proposed development. A further five (5) juvenile street trees can either be removed or transplanted.

Table 1: Trees to be removed

Development footprint critical to the following trees	Other (poor condition, other studies, etc)	Dead / Weed species to be removed (exempt and can be removed without consent)
5, 6, 7, 8, 9, 26, 27		

Trees 5, 6 and 7 are native trees of moderate landscape significance. Trees 5, 6, 8 and 9 are in fair condition with short – medium term retention potential. Tree 7 is suppressed with short-term retention potential. All five trees are required to be removed to allow for the proposed development footprint.

Trees 26 and 27 are non-native trees in poor condition. They are required to be removed to allow excavation of an OSD dam on site and should be replaced with trees endemic to the area.

Table 1: Trees to be removed

Development footprint critical to the following trees	Other (poor condition, other studies, etc)	Remediation of contaminated land.
5, 6, 7, 8, 9, 26, 27		Trees assessed in Biodiversity Development Assessment Report prepared by Narla Environmental (<i>Angophora floribunda</i> and <i>Eucalyptus tereticornis</i>)

Trees 15, 16, 21, 22 and 23 are newly planted street trees and should be removed to accommodate the proposed development. They have high potential to be transplanted due to their youth and high quality.

Consent for the removal of Tree Nos. 5, 6, 7, 8, 9, 26 and 27 will be sought as part of the SSDA.

In addition trees assessed in Biodiversity Development Assessment Report prepared by Narla Environmental located in the area of agricultural plots may require removal.

The majority of these trees are located immediately adjacent to the drainage line and outside the existing fenceline (and site boundary). Most of these are endemic tree specimens of *Angophora floribunda* and *Eucalyptus tereticornis* further down the channel. These range in size from juvenile to mature specimens and have high value to be retained as remnant trees as a group.

With regard to contamination; I note that it has yet to be fully tested as to where excavation is required. Any trees within the contamination area will not be able to be retained and any potential to retain trees around the contamination area will be based on the final Validation Inspection.

With implementation of the tree protection/mitigation measures set out in Section 5 of this report, it should be possible to retain all other trees on the developed site. The plans show that fourteen (14) trees are proposed to be retained.

Trees on site that are to be retained as part of the approved development must be protected from potential damage caused by construction activities. Refer to section 5.0 for tree protection recommendations/mitigation measures.

7 trees outside of the main site area have been identified in vicinity of the remediation area but will be retained and protected. Where remediation of contaminated soil cannot be carried out within TPZs it is noted permanent fencing will be installed to limit access to these areas.

Further detail of site works is required particularly details of foundation/footing systems, site services, drainage works and level changes particularly within the TPZ of trees proposed for retention. This should be provided prior to construction so any additional impacts can be assessed.

Where recommended work processes and tree protection measures cannot be adhered to further advice should be sought from the Project Arborist.

7.0 DISCLAIMER

The author and Sturt Noble Arboricultural Consulting take no responsibility for actions taken and their consequences, contrary to those expert and professional instructions given as recommendations.

This is not a hazard assessment report and it should be noted that trees are always inherently dangerous. This assessment was carried out from the ground, and covers what was reasonably able to be assessed and available to the assessor at the time of inspection. No aerial or subterranean inspections were carried out and structural weakness may exist within roots, trunk or branches.

Any protection or preservation methods recommended are not a guarantee of tree survival or safety but are designed to improve vigour and reduce risk. Timely inspections and reports are necessary to monitor the trees' condition. No responsibility is accepted for damage or injury caused by the trees and no responsibility is accepted if the recommendations in this report are not followed.

Limitations on the use of this report: Trees are dynamic living structures, growing and adapting to conditions around them. Tree condition will change and vary over time depending on weather, environmental factors and mechanical or human interaction.

This report is to be utilised in its entirety only. Any written or verbal submission, report or presentation that includes statements taken from the findings, discussions, conclusions or recommendations made in this report, may only be used where the whole of the original report (or a copy) is referenced in, and directly attached to that submission, report or presentation.

Assumptions: Care has been taken to obtain information from reliable resources. All data have been verified insofar as possible; however, Sturt Noble Arboricultural Consulting can neither guarantee nor be responsible for the accuracy of information provided by others.

Unless stated otherwise: Information contained in this report covers only the trees that were examined and reflects the condition of the trees at the time of inspection.

Assessment is limited to the conditions at the time of the inspection and only trees discussed in the report have been assessed.

Where access to the base of the tree is limited, such as difficult site access due to site conditions, only general comments can be made. Assessment of tree health and structure is limited to that visible from the site of proposed works and may not reflect the true condition of the tree. Assessment of tree health and structure is limited to that visible from the site of proposed works and may not reflect the true condition of the tree.

Plans used to assess likely impact are those appended/ referenced.

Ongoing monitoring of all trees is advised and where significant changes are observed, further advice should be requested. Unusual developments or sudden changes in a tree's condition should be addressed immediately.

8.0 REFERENCES

Chapman, G. A & Murphy, C. L, 1989 Soil landscapes of the Sydney 1:100,000 sheet (9130) Pub. NSW Govt.

Draper, D.B and Richards, P.A (2009) Dictionary for managing Trees in Urban Environments, (IACA) Institute of Australian Consulting Arboriculturists ©. Pub. CSIRO Publishing, Melbourne.

IACA, 2010, Sustainable Retention Index Value Matrix (SRIV) Version 4, A visual method of objectively rating the viability of urban trees for development sites and management, based on general tree and landscape assessment criteria, Institute of Australian Consulting Arboriculturists, Australia, www.iaca.org.au.

Googlemaps ©. Viewed 15th March 2021

Standards Australia (2007) Australian Standard AS4373-2007 *Pruning of Amenity Trees*, Pub. Standards Australia, Sydney.

Standards Australia (2009) Australian Standard AS4970-2009 *Protection of Trees on Development Sites*, Pub. Standards Australia, Sydney.

Urban Arbor 10/10/2017 Arboricultural Impact Assessment Report

APPENDIX 1: METHODOLOGY

A1.1 Site Inspection

This report, its comments and recommendations have been prepared based on the information gathered during a detailed site inspection carried out on the on the 10th March 2021. This assessment is summarised in **Appendix 1**.

A1.2 Tree Locations

The location of the subject trees are based on the site survey, 79528_REV-A, 11/02/2021. Additional trees found on site that are not represented on the survey, have been shown in approximate locations only.

A1.3 Visual Tree Assessment

The trees were assessed from the ground by the Visual Tree Assessment (VTA) method as described in Mattheck & Breloer (1994), using non-invasive tools such as binoculars and acoustic mallet. No digging or exposing of the root zones occurred in this inspection and no aerial inspection by climbing was performed. No aerial inspection or diagnostic testing was undertaken as part of this assessment.

The following data was collected for each tree:

- Botanical and common name.
- Tree dimensions (approximate only).
- Canopy density (approximate only).
- Overall health and vitality, including epicormic growth, deadwood and predation by pests and diseases.
- Structural condition including evident faults such as Bark Inclusions or poor branch attachments, decay, cavities and mechanical or biological damage.
- Stability of the tree including excessive trunk lean, stability of the soil, soil cracking, soil heaving, exposed roots and root damage.

A1.4 Retention Value

Each tree has been given a Sustainable Retention Index Value (SRIV) according to the rating system set out in the Sustainable Retention Index Value Matrix (refer to the table in section A1.8). The SRIV for each tree is based on its health, vigour, structure and age class as established in the Visual Tree Assessment. The SRIV does not take into account the impact of the proposed development.

A1.5 Landscape Significance Assessment

Landscape Significance is an essential criterion to establish the importance that a particular tree may have on a site. Each tree has been given a Tree Significance in landscape rating based on the 'IACA Significance of a Tree, Assessment Rating

System'. A tree is to have a minimum of three criteria in a category to be applicable for that rating.

Tree Significance in the landscape ratings:

High	Medium	Low
<ul style="list-style-type: none"> The tree is in good condition and good vigour; The tree has a form typical for the species; The tree is a remnant or is a planted locally indigenous specimen and/or is rare or uncommon in the local area or of botanical interest or of substantial age; The tree is listed as a Heritage Item, Threatened Species or part of an Endangered ecological community or listed on Councils significant Tree Register; The tree is visually prominent and visible from a considerable distance when viewed from most directions within the landscape due to its size and scale and makes a positive contribution to the local amenity; The tree supports social and cultural sentiments or spiritual associations, reflected by the broader population or community group or has commemorative values; The tree's growth is unrestricted by above and below ground influences, supporting its ability to reach dimensions typical for the taxa in situ - tree is appropriate to the site conditions. 	<ul style="list-style-type: none"> The tree is in fair-good condition and good or low vigour; The tree has form typical or atypical of the species; The tree is a planted locally indigenous or a common species with its taxa commonly planted in the local area The tree is visible from surrounding properties, although not visually prominent as partially obstructed by other vegetation or buildings when viewed from the street, The tree provides a fair contribution to the visual character and amenity of the local area, The tree's growth is moderately restricted by above or below ground influences, reducing its ability to reach dimensions typical for the taxa in situ. 	<ul style="list-style-type: none"> The tree is in fair-poor condition and good or low vigour; The tree has form atypical of the species; The tree is not visible or is partly visible from surrounding properties as obstructed by other vegetation or buildings, The tree provides a minor contribution or has a negative impact on the visual character and amenity of the local area, The tree is a young specimen which may or may not have reached dimension to be protected by local Tree Preservation orders or similar protection mechanisms and can easily be replaced with a suitable specimen, The tree's growth is severely restricted by above or below ground influences, unlikely to reach dimensions typical for the taxa in situ - tree is inappropriate to the site conditions, The tree is listed as exempt under the provisions of the local Council Tree Preservation Order or similar protection mechanisms, The tree has a wound or defect that has potential to become structurally unsound. Environmental Pest / Noxious Weed Species The tree is an Environmental Pest Species due to its invasiveness or poisonous/ allergenic properties, The tree is a declared noxious weed by legislation. Hazardous/Irreversible Decline The tree is structurally unsound and/or unstable and is considered potentially dangerous, - The tree is dead, or is in irreversible decline, or has the potential to fail or collapse in full or part in the immediate to short term.

A1.6 Tree Protection Zones (TPZ) and Structural Root Zones (SRZ)

The intention of the TPZ is to ensure protection of the root system and canopy from the potential damage from construction works and ensure the long-term health and stability of each tree to be retained.

The Structural Root Zone (SRZ) is located within the TPZ around the base of a tree and provides the bulk of mechanical support and anchorage for a tree.

The Tree Protection Zones (TPZ) and Structural Root Zones (SRZ) have been arrived at using methods as detailed in Australian Standard AS 4970– 2009. Specific site factors are also considered that may influence the location of the TPZ and/or structural tree roots.

A1.7 Encroachment and Development Impacts


Encroachments and development impacts to tree TPZ's and SRZ's include;

- Excavation
- Filling
- Changes to existing soil levels
- Placing items and elements within the zones even if only temporarily
- Soil disturbance
- Any other physical damage to the trunk or root system or any other activity likely to cause damage to the tree.

Under *AS 4970:2009 Protection of trees on development sites*, a major encroachment is greater than 10% of the area of the TPZ and the Project Arborist must determine and demonstrate that the tree would remain viable. More detailed investigations, such as exploratory excavations and root investigation to enable an informed evaluation of the potential impact of the proposed works may be required.

Encroachments into the SRZ are not likely to be supported unless the Project Arborist has undertaken exploratory investigation and can demonstrate that there will be minimal impact to the tree.

A1.8 SRIV Table

	Vigour Class and Condition Class					
						
Age Class	Good Vigour & Good Condition (GVG)	Good Vigour & Fair Condition (GVF)	Good Vigour & Poor Condition (GVP)	Low Vigour & Good Condition (LVG)	Low Vigour & Fair Condition (LVF)	Low Vigour & Poor Condition (LVP)
	Able to be retained if sufficient space available above and below ground for future growth. No remedial work or improvement to growing environment required. May be subject to high vigour. Retention potential - Medium - Long Term.	Able to be retained if sufficient space available above and below ground for future growth. Remedial work may be required or improvement to growing environment may assist. Retention potential - Medium Term. Potential for longer with remediation or favourable environmental conditions	Able to be retained if sufficient space available above and below ground for future growth. Remedial work unlikely to assist condition, improvement to growing environment may assist. Retention potential - Short Term. Potential for longer with remediation or favourable environmental conditions.	May be able to be retained if sufficient space available above and below ground for future growth. No remedial work required, but improvement to growing environment may assist vigour. Retention potential - Short Term. Potential for longer with remediation or favourable environmental conditions.	May be able to be retained if sufficient space available above and below ground for future growth. Remedial work or improvement to growing environment may assist condition and vigour. Retention potential - Short Term. Potential for longer with remediation or favourable environmental conditions.	Unlikely to be able to be retained if sufficient space available above and below ground for future growth. Remedial work or improvement to growing environment unlikely to assist condition or vigour. Retention potential - Likely to be removed immediately or retained for Short Term. Potential for longer with remediation or favourable environmental conditions
Young (Y)	YGVG - 9 Index Value 9 Retention potential - Long Term. Likely to provide minimal contribution to local amenity if height Retain, move or replace	YGVF - 8 Index Value 8 Retention potential - Short - Medium Term. Potential for longer with improved growing conditions. Likely to provide minimal contribution to local amenity if height Medium-high potential for future growth and adaptability. Retain, move or replace.	YGVP - 5 Index Value 5 Retention potential - Short Term. Potential for longer with improved growing conditions. Likely to provide minimal contribution to local amenity if height Low-medium potential for future growth and adaptability. Retain, move or replace	YLVG - 4 Index Value 4 Retention potential - Short Term. Potential for longer with improved growing conditions. Likely to provide minimal contribution to local amenity if height Medium potential for future growth and adaptability. Retain, move or replace	YLVF - 3 Index Value 3 Retention potential - Short Term. Potential for longer with improved growing conditions. Likely to provide minimal contribution to local amenity if height <5m. Low-medium potential for future growth and adaptability. Retain, move or replace	YLVP - 1 Index Value 1 Retention potential - Likely to be removed immediately or retained for Short Term. Likely to provide minimal contribution to local amenity if height
Mature (M)	MGVG - 10 Index Value 10 Retention potential - Medium - Long Term	MGVF - 9 Index Value 9 Retention potential - Medium Term. Potential for longer with improved growing conditions.	MGVP - 6 Index Value 6 Retention potential - Short Term. Potential for longer with improved growing conditions	MLVG - 5 Index Value 5 Retention potential - Short Term. Potential for longer with improved growing conditions	MLVF - 4 Index Value 4 Retention potential - Short Term. Potential for longer with improved growing conditions	MLVP - 2 Index Value 2 Retention potential - Likely to be removed immediately or retained for Short Term.
Over-mature (O)	OGVG - 6 Index Value 6 Retention potential - Medium - Long Term.	OGVF - 5 Index Value 5 Retention potential - Medium Term.	OGVP - 4 Index Value 4 Retention potential - Short Term.	OLVG - 3 Index Value 3 Retention potential - Short Term. Potential for longer with improved growing conditions.	OLVF - 2 Index Value 2 Retention potential - Short Term.	OLVP - 0 Index Value 0 Retention potential - Likely to be removed immediately or retained for Short Term

APPENDIX 2: PLANS



LEGEND

----- PROPERTY BOUNDARY

⊕ EXISTING TREE
Refer to Tree Impact Assessment
Schedule

○ TREE PROTECTION ZONE

B	IMPACT ASSESSMENT REPORT REV E	07.07.2021
A	IMPACT ASSESSMENT REPORT	18.03.2021
ISSUE	DESCRIPTION	DATE



Suite 91, L5, 330 Wattle St
Ultimo NSW 2007
T. 02 9211 3744
W. www.sturt-noble.com.au
landscape architecture
environmental & urban design


PROJECT
CENTRE OF EXCELLENCE

CLIENT
NBRS ARCHITECTURE


DRAWING
TREE LOCATION PLAN

DRAWING NUMBER
ARB-2106-101


SCALE
1:1000 @ A1
1:2000 @ A3

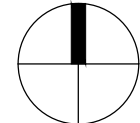

DRAWN	CHECKED	DIRECTOR
gh	gs	gs



ACN: 164 245 514 ABN: 99 164 245 514
THIS DRAWING SHOULD BE READ IN CONJUNCTION WITH ALL RELEVANT CONTRACTS,
SPECIFICATIONS, REPORTS AND DRAWINGS. COPYRIGHT OF THIS DRAWING IS VESTED IN
STURT NOBLE ASSOCIATES PTY LTD.

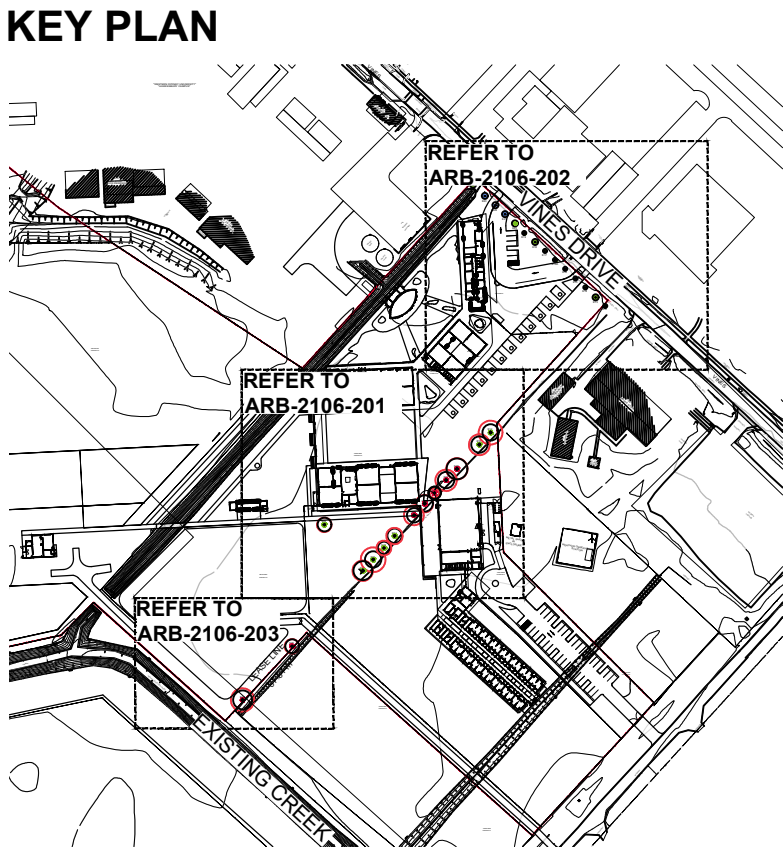

- LEGEND**
- PROPERTY BOUNDARY
 - EX EXISTING TREE
Refer to Tree Impact Assessment Schedule
 - TREES TO BE RETAINED
Refer to Tree Impact Assessment Schedule
 - TREES TO BE REMOVED
Refer to Tree Impact Assessment Schedule
 - TREES TO BE REMOVED OR TRANSPLANTED
Refer to Tree Impact Assessment Schedule
 - TREE PROTECTION ZONE

C	IMPACT ASSESSMENT REPORT REV E	07.07.2021
B	IMPACT ASSESSMENT REPORT REV D	28.06.2021
A	IMPACT ASSESSMENT REPORT	18.03.2021
ISSUE	DESCRIPTION	DATE



Suite 91, L5, 330 Wattle St
Ultimo NSW 2007
T. 02 9211 3744
W. www.sturtncoble.com.au
landscape architecture
environmental & urban design

PROJECT
CENTRE OF EXCELLENCE

CLIENT
NBRS ARCHITECTURE



DRAWING
IMPACT ASSESSMENT PLAN 01

DRAWING NUMBER ARB-2106-201	ISSUE C
SCALE 1:200 @ A1 1:400 @ A3	DRAWN gh
	CHECKED gs
	DIRECTOR gs

0 2 4 10m

ACN: 164 245 514 ABN: 99 164 245 514

THIS DRAWING SHOULD BE READ IN CONJUNCTION WITH ALL RELEVANT CONTRACTS, SPECIFICATIONS, REPORTS AND DRAWINGS. COPYRIGHT OF THIS DRAWING IS VESTED IN STURT NOBLE ASSOCIATES PTY LTD.

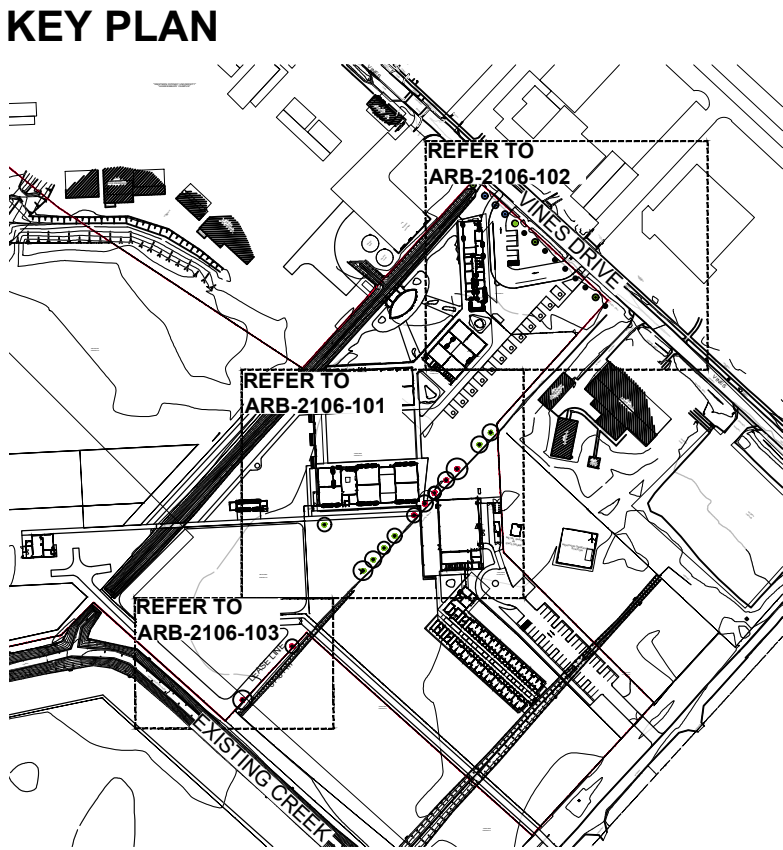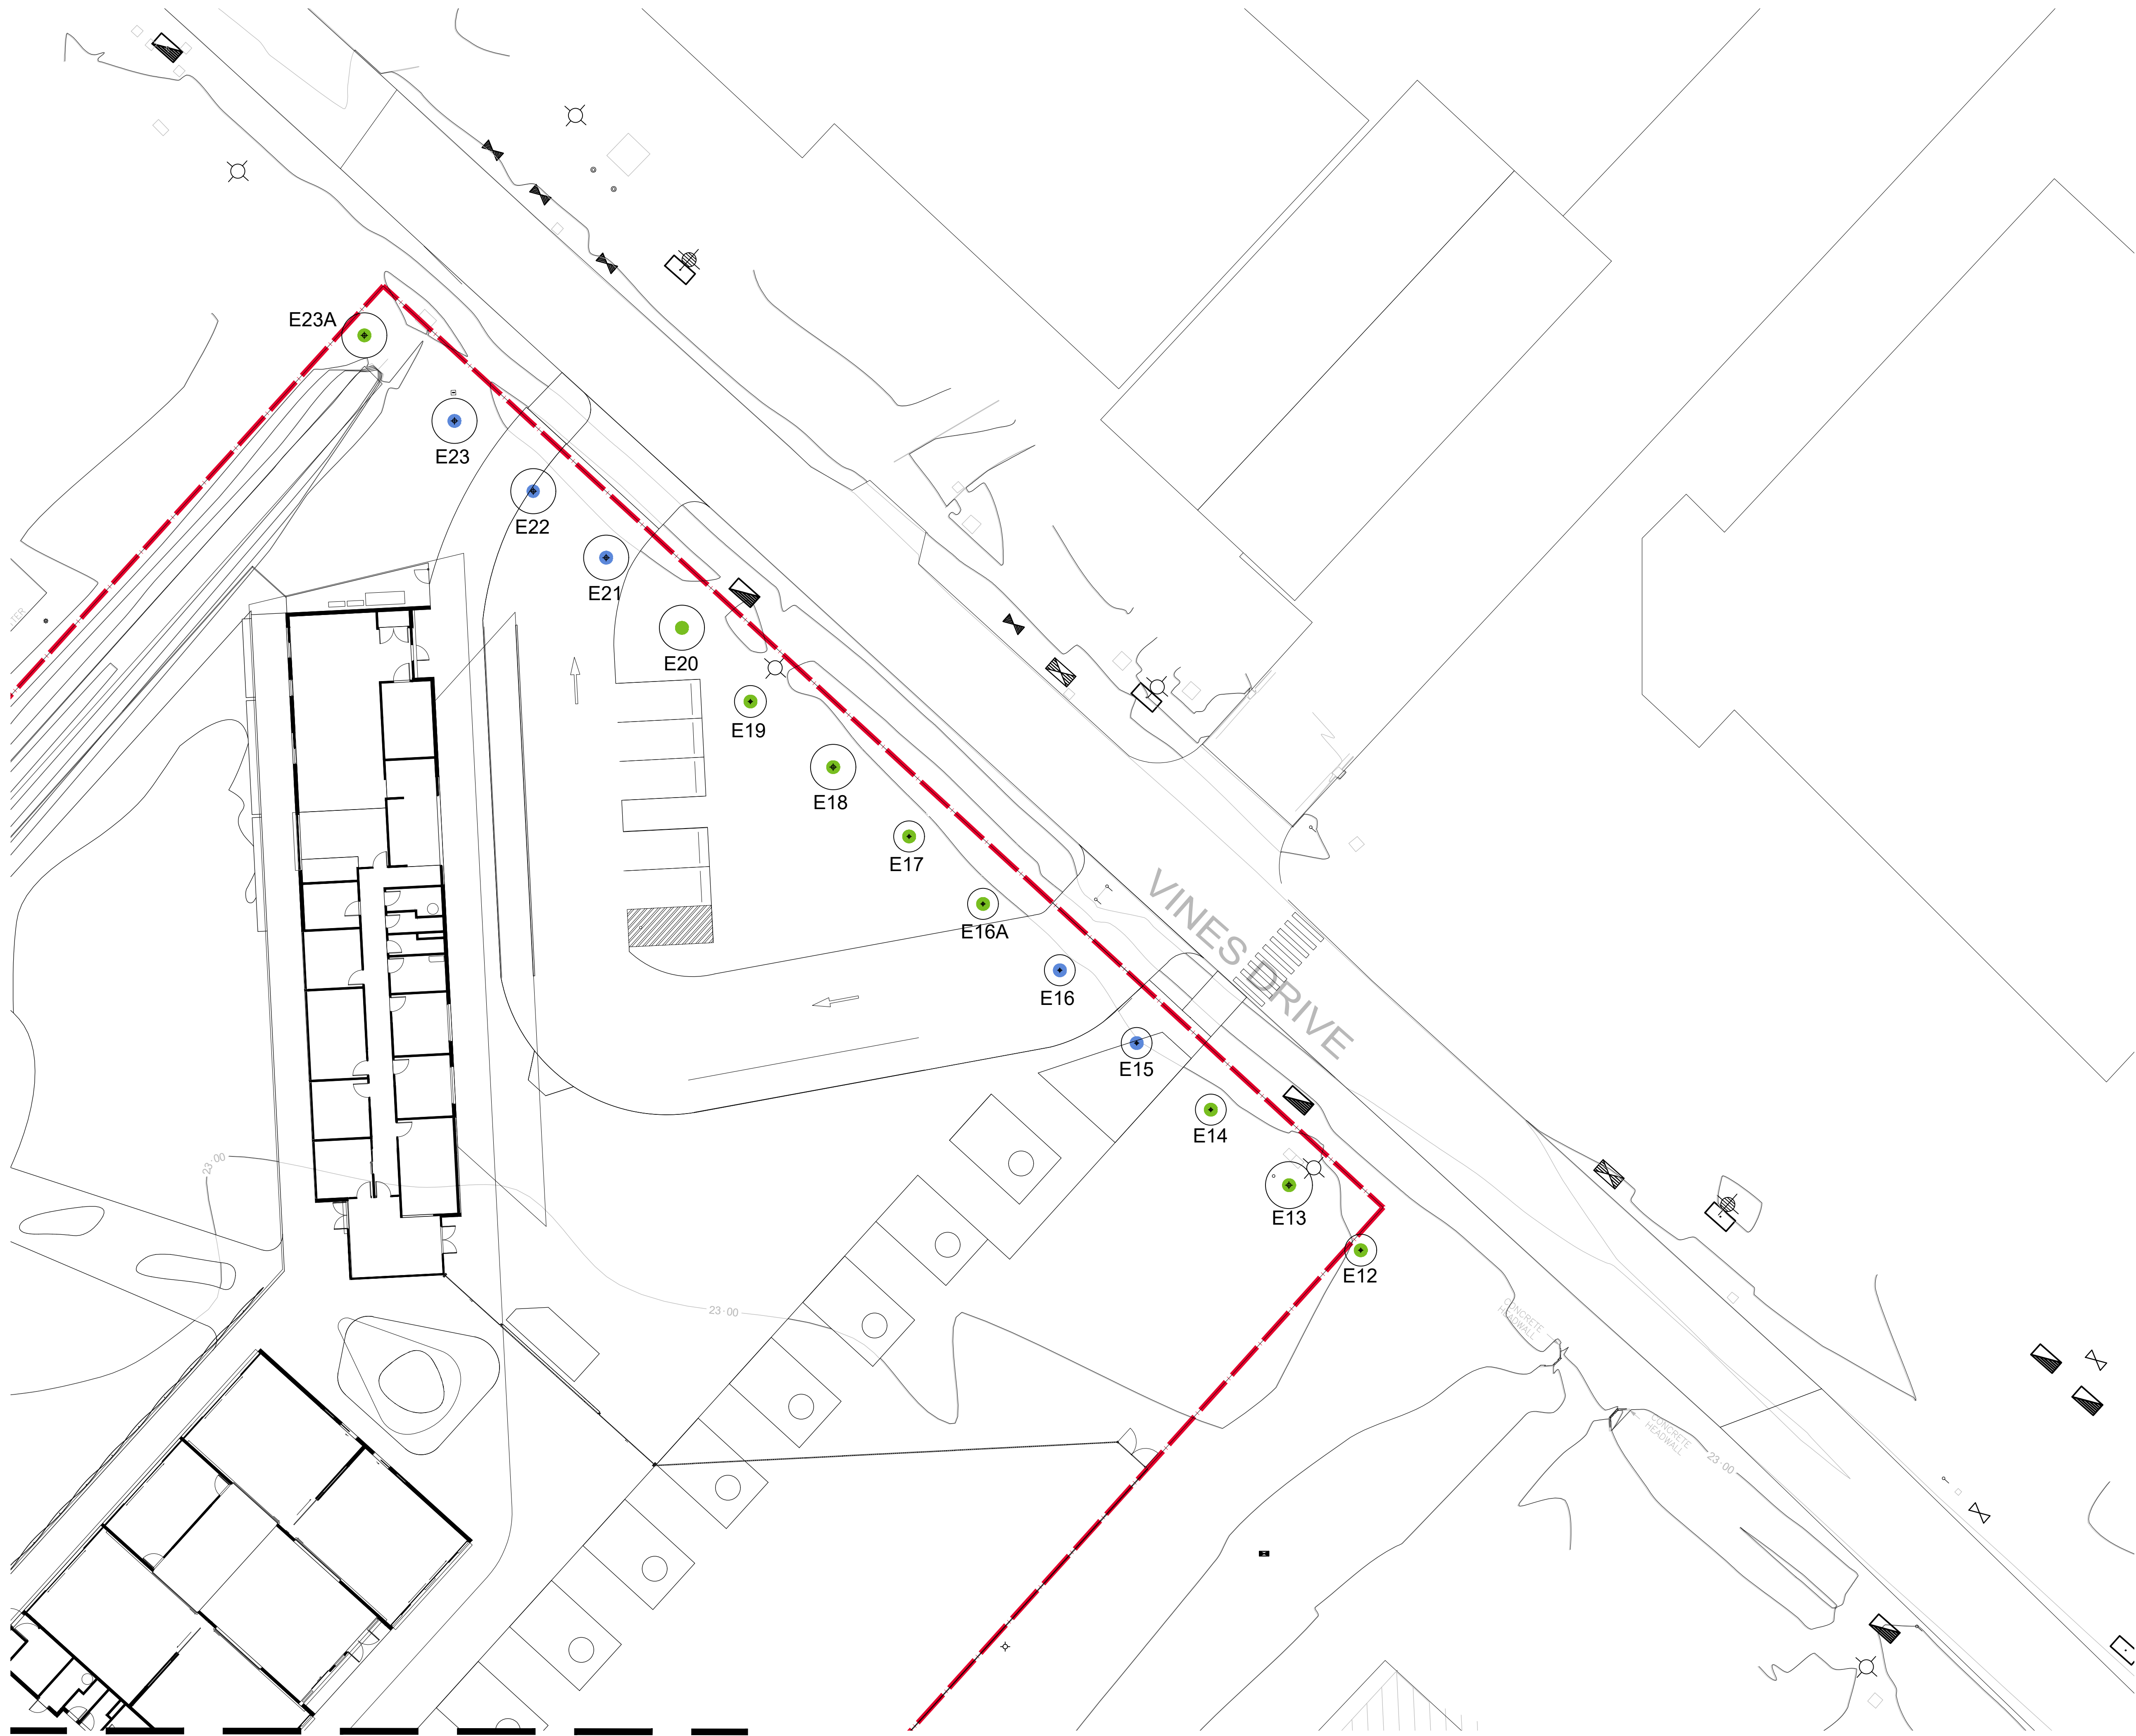

LEGEND

- PROPERTY BOUNDARY
- EXISTING TREE
Refer to Tree Impact Assessment Schedule
- TREES TO BE RETAINED
Refer to Tree Impact Assessment Schedule
- TREES TO BE REMOVED
Refer to Tree Impact Assessment Schedule
- TREES TO BE REMOVED OR TRANSPLANTED
Refer to Tree Impact Assessment Schedule
- TREE PROTECTION ZONE

C	IMPACT ASSESSMENT REPORT REV E	07.07.2021
B	IMPACT ASSESSMENT REPORT REV D	28.06.2021
A	IMPACT ASSESSMENT REPORT	18.03.2021
ISSUE	DESCRIPTION	DATE

Sturt Noble
landscape architecture
environmental & urban design

Suite 91, L5, 330 Wattle St
Ultimo NSW 2007
T. 02 9211 3744
W. www.sturnoble.com.au

PROJECT
CENTRE OF EXCELLENCE

CLIENT
NBR ARCHITECTURE


DRAWING
IMPACT ASSESSMENT PLAN 02

DRAWING NUMBER ARB-2106-202	ISSUE C
SCALE 1:200 @ A1 1:400 @ A3	DRAWN gh
	CHECKED gs
	DIRECTOR gs


0 2 4 10m

ACN: 164 245 514 ABN: 99 164 245 514

THIS DRAWING SHOULD BE READ IN CONJUNCTION WITH ALL RELEVANT CONTRACTS, SPECIFICATIONS, REPORTS AND DRAWINGS. COPYRIGHT OF THIS DRAWING IS VESTED IN STURT NOBLE ASSOCIATES PTY LTD.

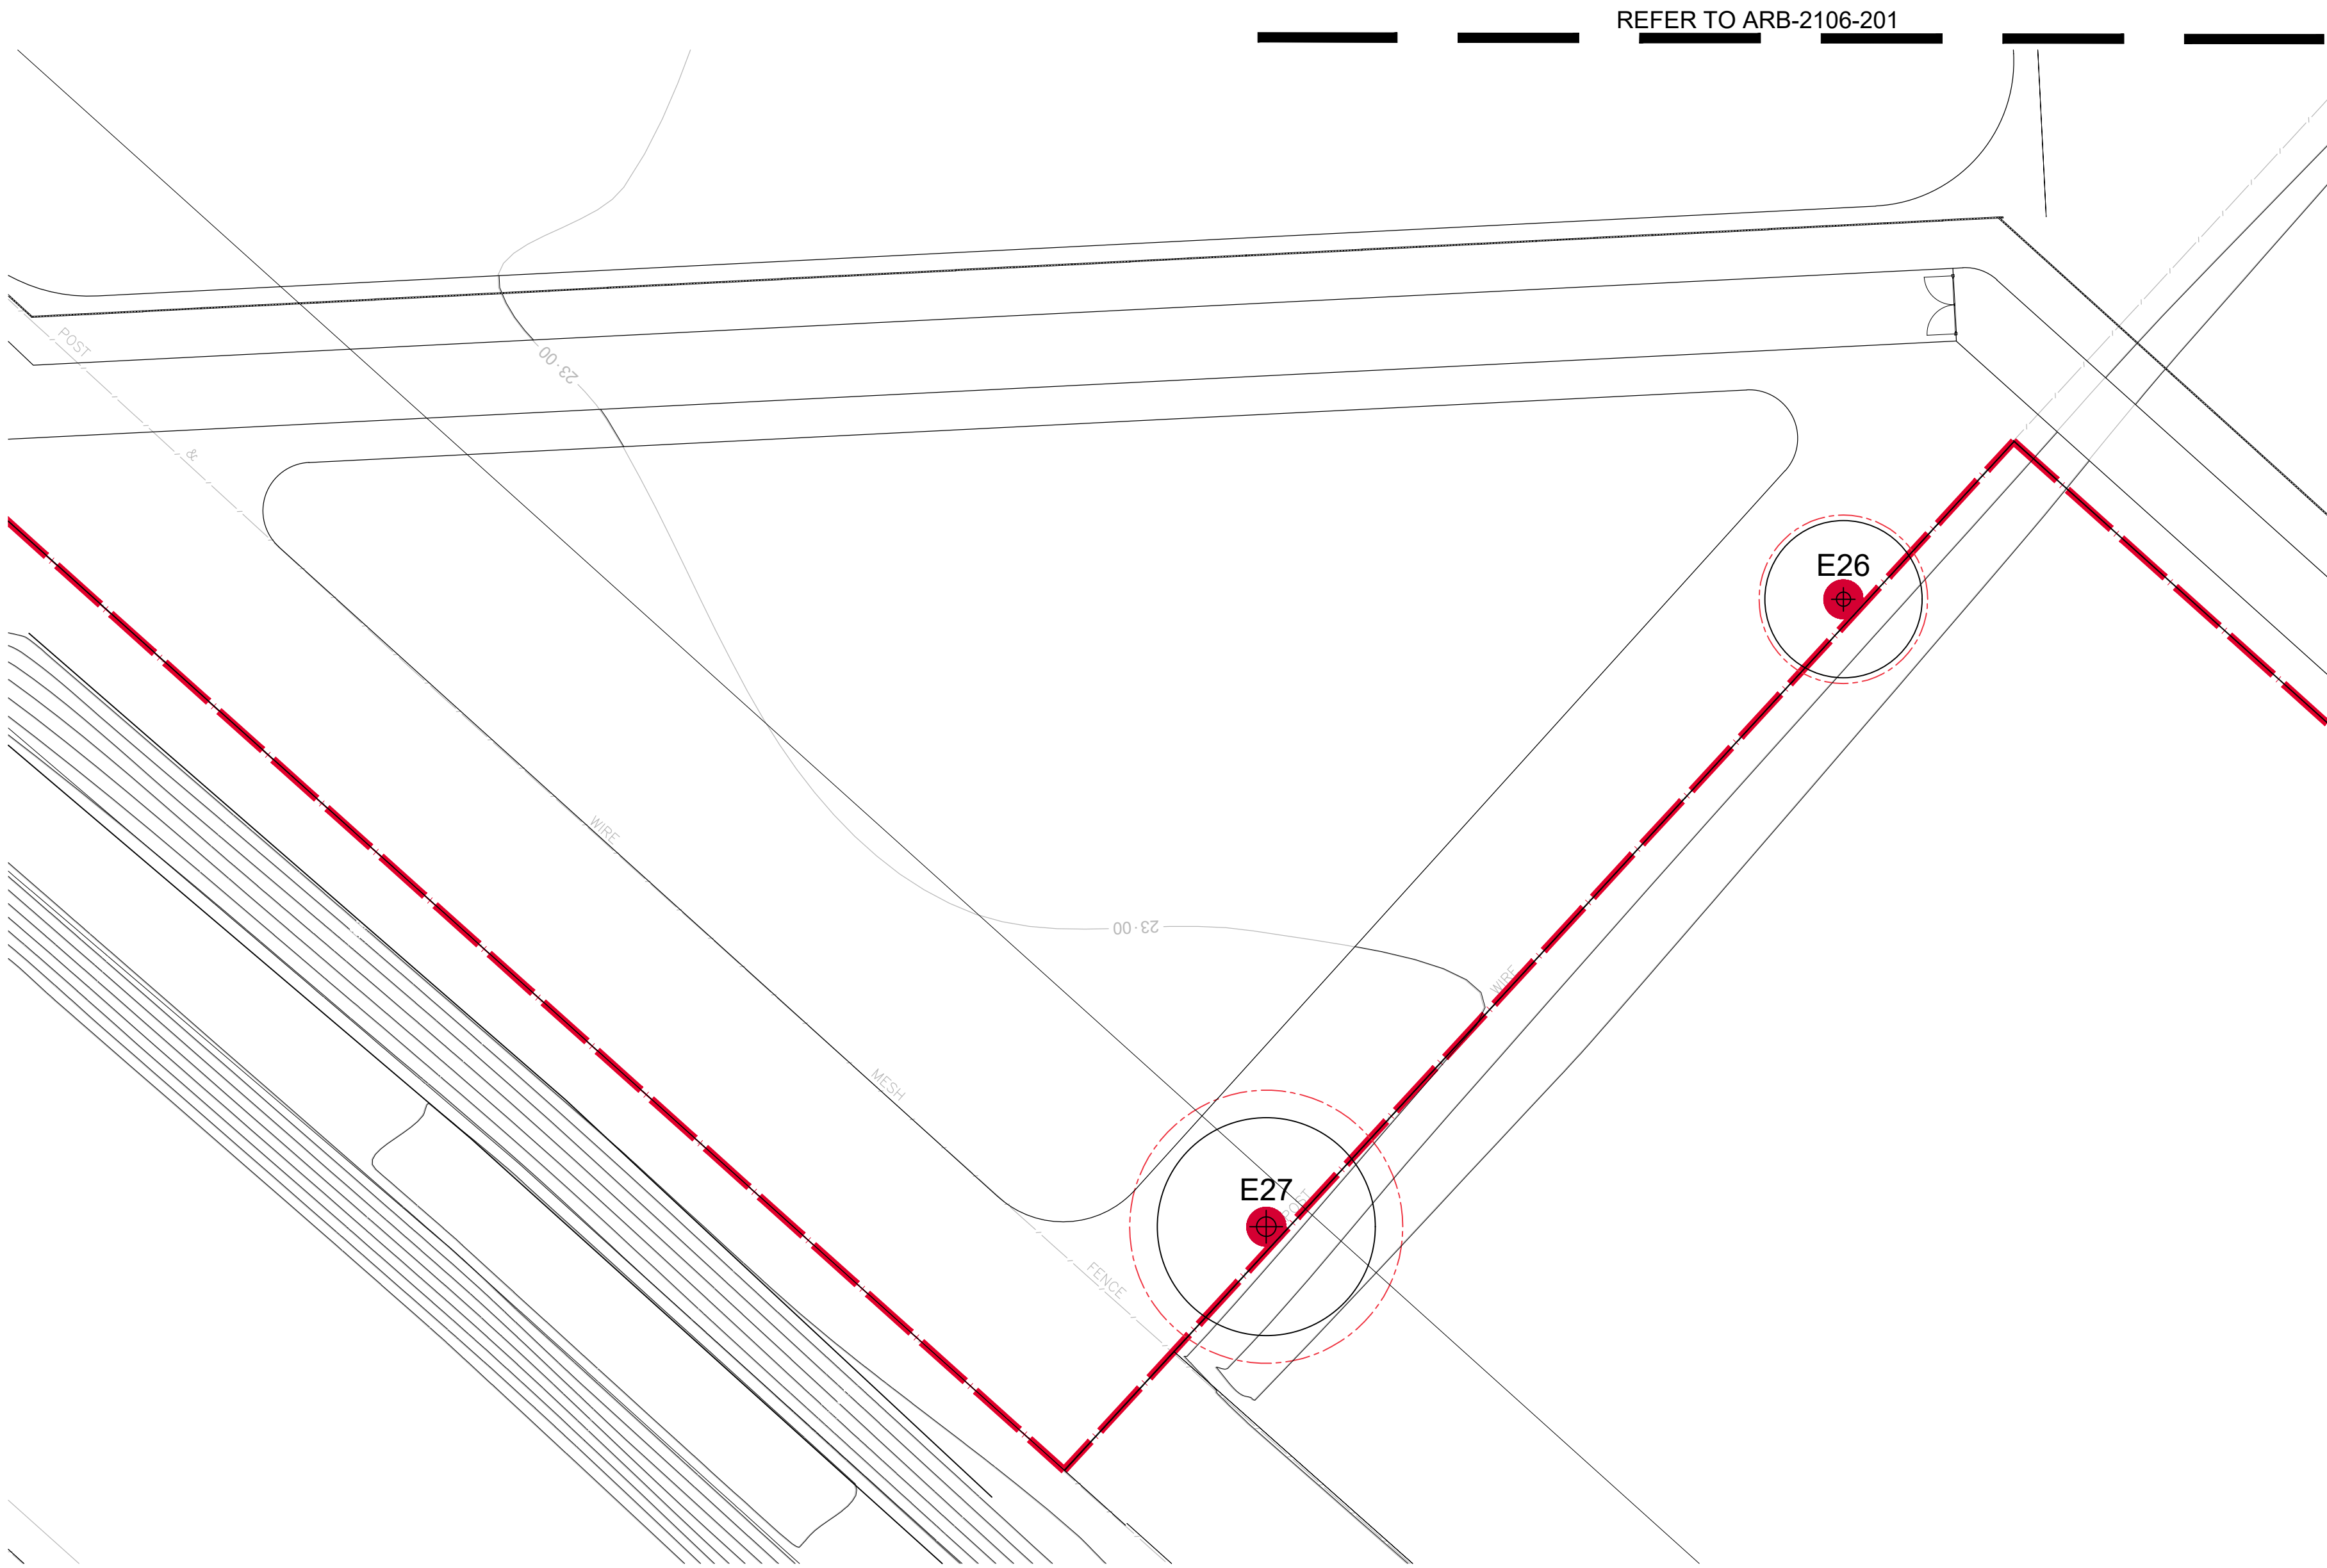

KEY PLAN

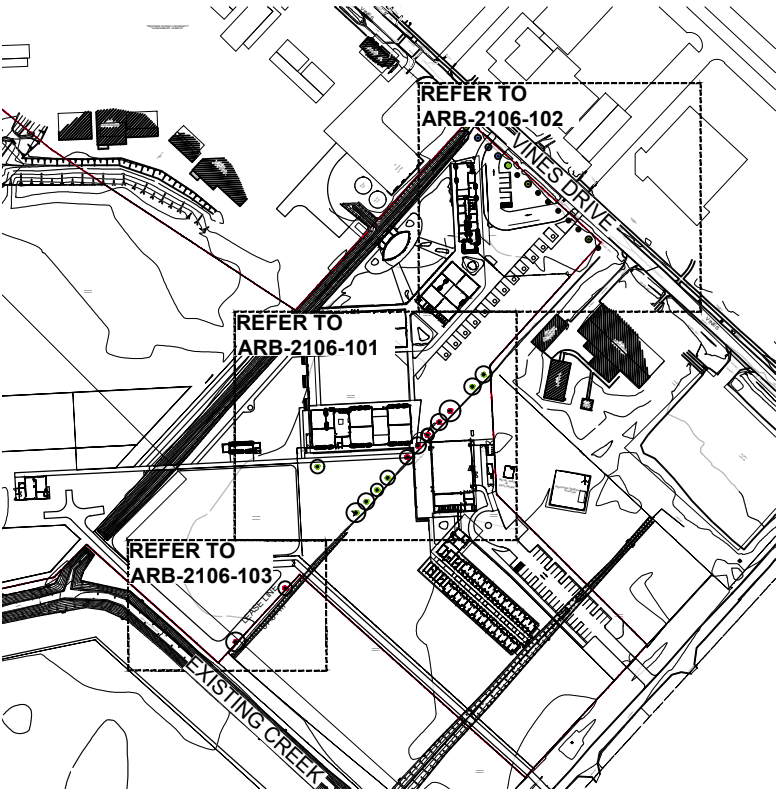

LEGEND

- PROPERTY BOUNDARY
- EX
EXISTING TREE
Refer to Tree Impact Assessment Schedule
- TREES TO BE RETAINED
Refer to Tree Impact Assessment Schedule
- TREES TO BE REMOVED
Refer to Tree Impact Assessment Schedule
- TREES TO BE REMOVED OR TRANSPLANTED
Refer to Tree Impact Assessment Schedule
- TREE PROTECTION ZONE

B	IMPACT ASSESSMENT REPORT REV D	28.06.2021
A	IMPACT ASSESSMENT REPORT	18.03.2021
ISSUE	DESCRIPTION	DATE




Suite 91, L5, 330 Wattle St
Ultimo NSW 2007
T. 02 9211 3744
W. www.sturt-noble.com.au
landscape architecture
environmental & urban design

PROJECT
CENTRE OF EXCELLENCE

CLIENT
NBRS ARCHITECTURE

DRAWING
IMPACT ASSESSMENT PLAN 03

DRAWING NUMBER ARB-2106-203	ISSUE B	DRAWN gh	CHECKED gs	DIRECTOR gs
SCALE 1:200 @ A1 1:400 @ A3				



LEGEND

- Existing Trees Removed
Refer to arborist report
- Existing Trees Retained
Refer to arborist report
- Proposed Trees
Refer to Planting Plan and Schedule
- Propagation Fields by School
Soil, irrigation and other infrastructure needed
- Planting
Soil, irrigation (drip) and plants (4 per/m2)
- Hardscape
- Coloured Concrete
- Decomposed granite
- Porous Paving
- Brick Paving
- Unit Pavers
- Grey Concrete
- Turf
- High Quality Irrigated Lawn
- Low Maintenance Lawn (establishment irrigation)
- Fences
- 2.1m High Security Fence (Corromesh)
- 2.1m High Security Fence (Tubular)
- Paddock Fence
- Refer to fence plans in architecture set.



LANDSCAPE ELEMENTS

- 01: Pergola - Timber structure with cables to allow grape vine to grow over. Australian hardwood.
- 02: Vineyard Trellis - Timber posts and cabling. Irrigation infrastructure required.
- 03: Orchard - Provide soil, ground preparation and water supply points. Tree specimens installed by school.
- 04: Kitchen Gardens - Raised garden beds constructed from Australian Hardwood (400 High). Water supply points, mulch, soil, compost bins and trellis structures required.
- 05: Outdoor Seating Elements - Bespoke / proprietary outdoor seating furniture. Concrete and mod wood materials to be used.
- 06: Seating Steps - Concrete seating steps (600W x 300H).
- 07: Plaques / Educational Installation - Allow costing to supply / install elements inset into pavement TBC by school.
- 08: Kick About Lawn - Allow costing to grade / level landform and provide drainage to prevent water from pooling.
- 09: Bike Racks - 24 secure bike parking locations undercover. Hooped stainless steel bike racks.
- 10: External Foot Paths - External foot paths extent to be confirmed

NOTE:
This drawing illustrates works to be tendered on. Highlighted/noted areas to be realised as apart of schools curriculum.


Issue			
No.	Date	Description	Chkd
A	24/02/2021	DRAFT CONCEPT	AL
B	01/04/2021	SCHEMATIC ISSUE	AL
C	28/04/2021	SSDA ISSUE	AL
D	28/06/2021	SSDA ISSUE	JK

Disclaimer
These plans are for tender use only. Not intended for construction purpose unless specifically noted. The contractor intending to use these documents shall check and verify all works on site and report any discrepancy to the Landscape Architect prior to commencement. Failure to do so shall not be the responsibility of the Client or Landscape Architect.

Landscape Architect
NBR
ARCHITECTURE.
LANDSCAPE
Level 3, 4 Glen Street, Milsons Point, NSW 2061 Australia
T: 61 2 9922 2344 F: 61 2 9922 1308
E: architects@nbrsarchitecture.com W: nbrsarchitecture.com
Any form of replication of this drawing in full or in part without the written permission of NBR & PARTNERS Pty Ltd constitutes an infringement of the copyright
ABN 16 002 247 565 © 2017


Project
Centre of Excellence in Agricultural Education
at
Vine Dr, Richmond NSW 2753
for
Department of Education


Drawing Title
Overall Tender Plan

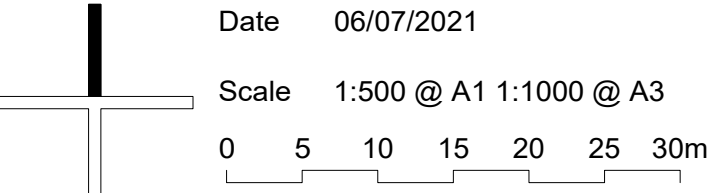

Drawing Reference
20417-NBRS-L-SK 005

Rev
D

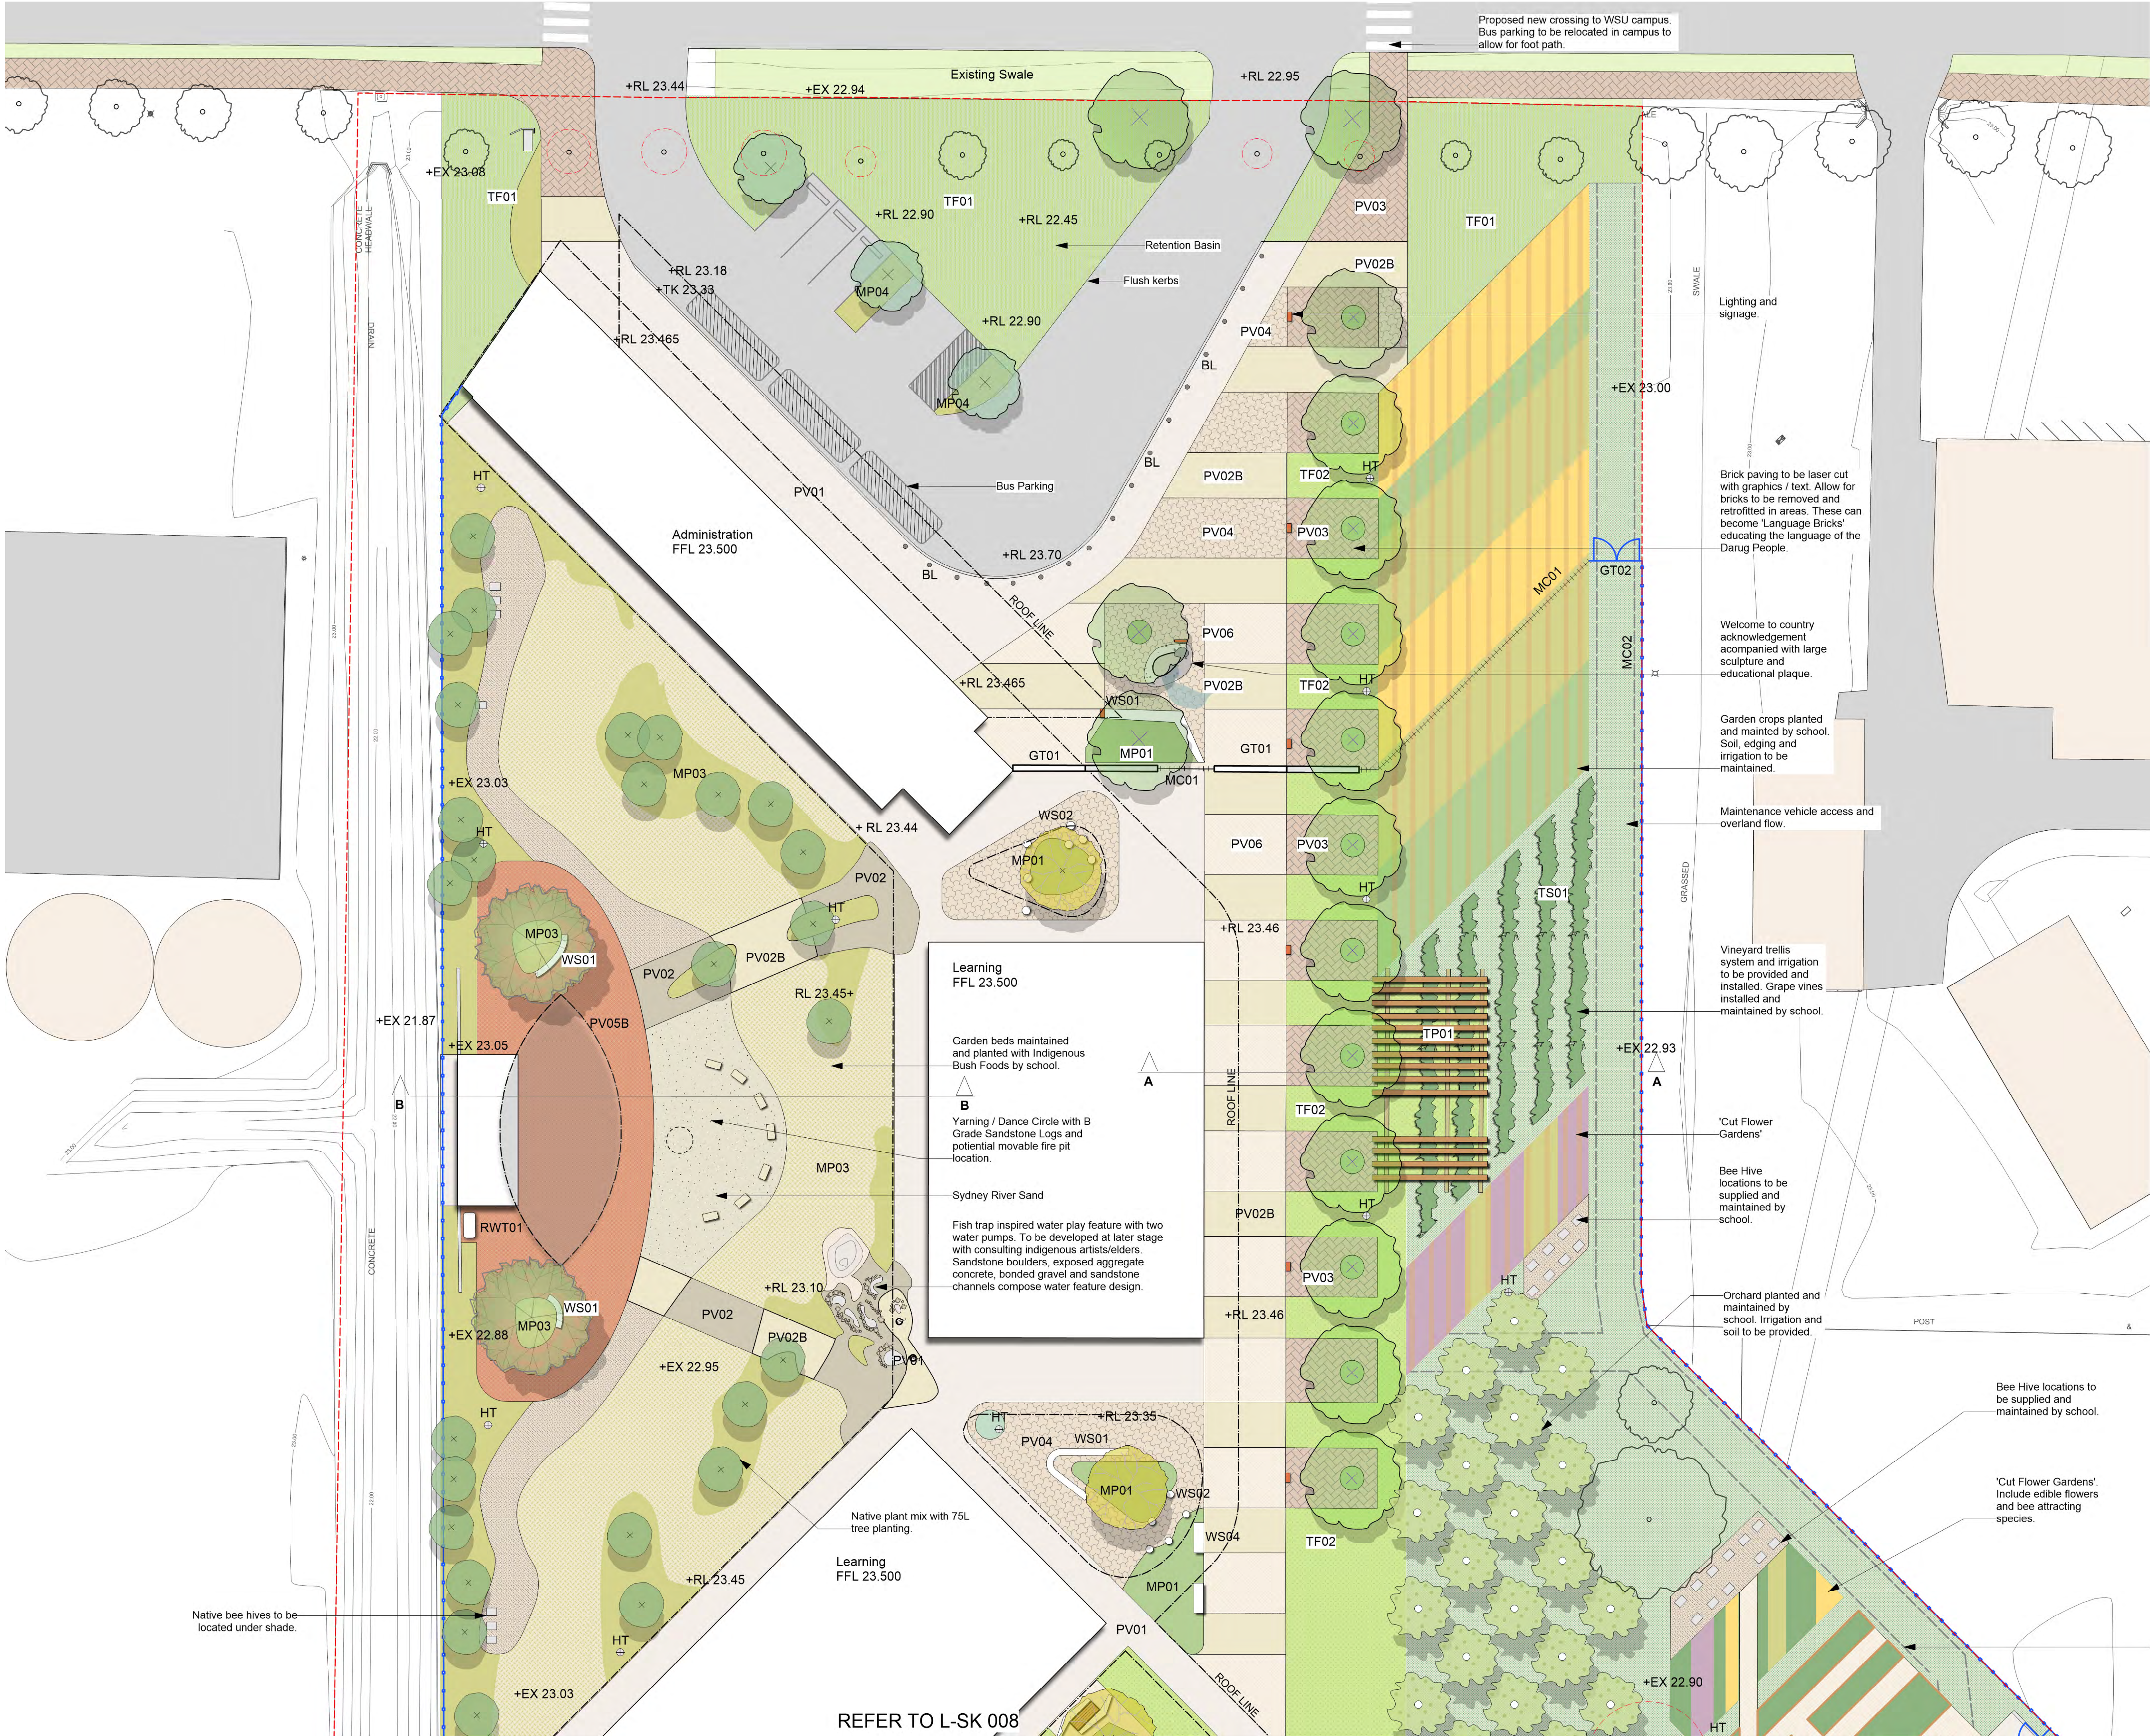

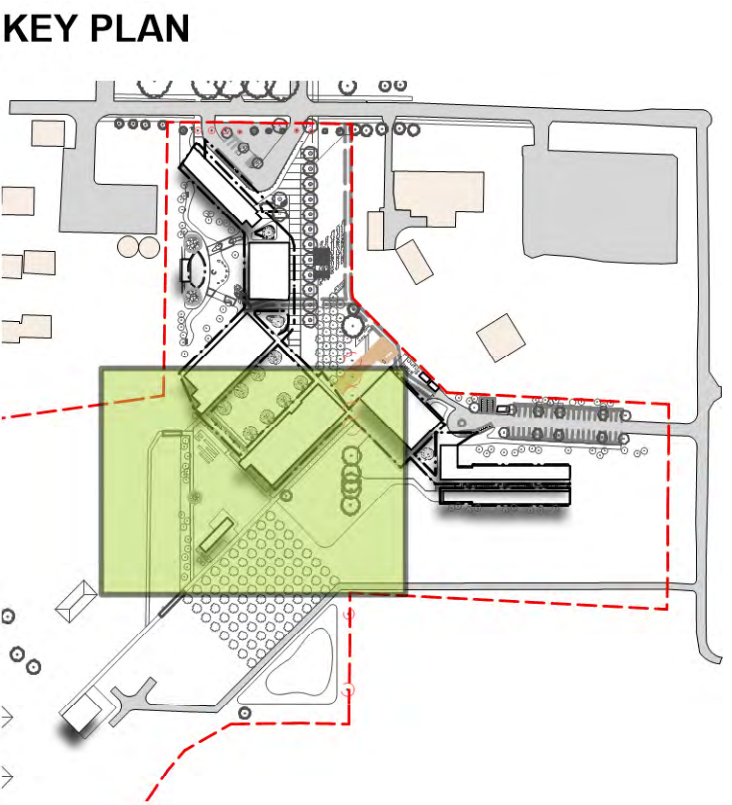

Issue			
No.	Date	Description	Chkd
A	01/04/2021	SCHEMATIC ISSUE	AL
B	28/04/2021	SSDA ISSUE	AL
C	28/06/2021	SSDA ISSUE	JK

Disclaimer

These plans are for tender use only. Not intended for construction purpose unless specifically noted. The contractor intending to use these documents shall check and verify all works on site and report any discrepancy to the Landscape Architect prior to commencement. Failure to do so shall not be the responsibility of the Client or Landscape Architect.

Landscape Architect

**NBR
SARCHITECTURE.
LANDSCAPE**

Level 3, 4 Glen Street, Milsons Point, NSW 2061 Australia
T 61 2 9922 2344 F 61 2 9922 1308
E architects@nbrsarchitecture.com W nbrsarchitecture.com

Any form of replication of this drawing in full or in part without the written permission of NBR & PARTNERS Pty Ltd constitutes an infringement of the copyright
ABN 16 002 247 585 © 2017

Project

Centre of Excellence in Agricultural Education

at

Vine Dr, Richmond NSW 2753

for

Department of Education

Drawing Title

Arrangement Plan 02

Date 06/07/2021


Scale 1:200 @ A1 1:400 @ A3

0 1 2 3 4 5 6m

Drawing Reference

20417-NBR-S-LK 008

Rev C

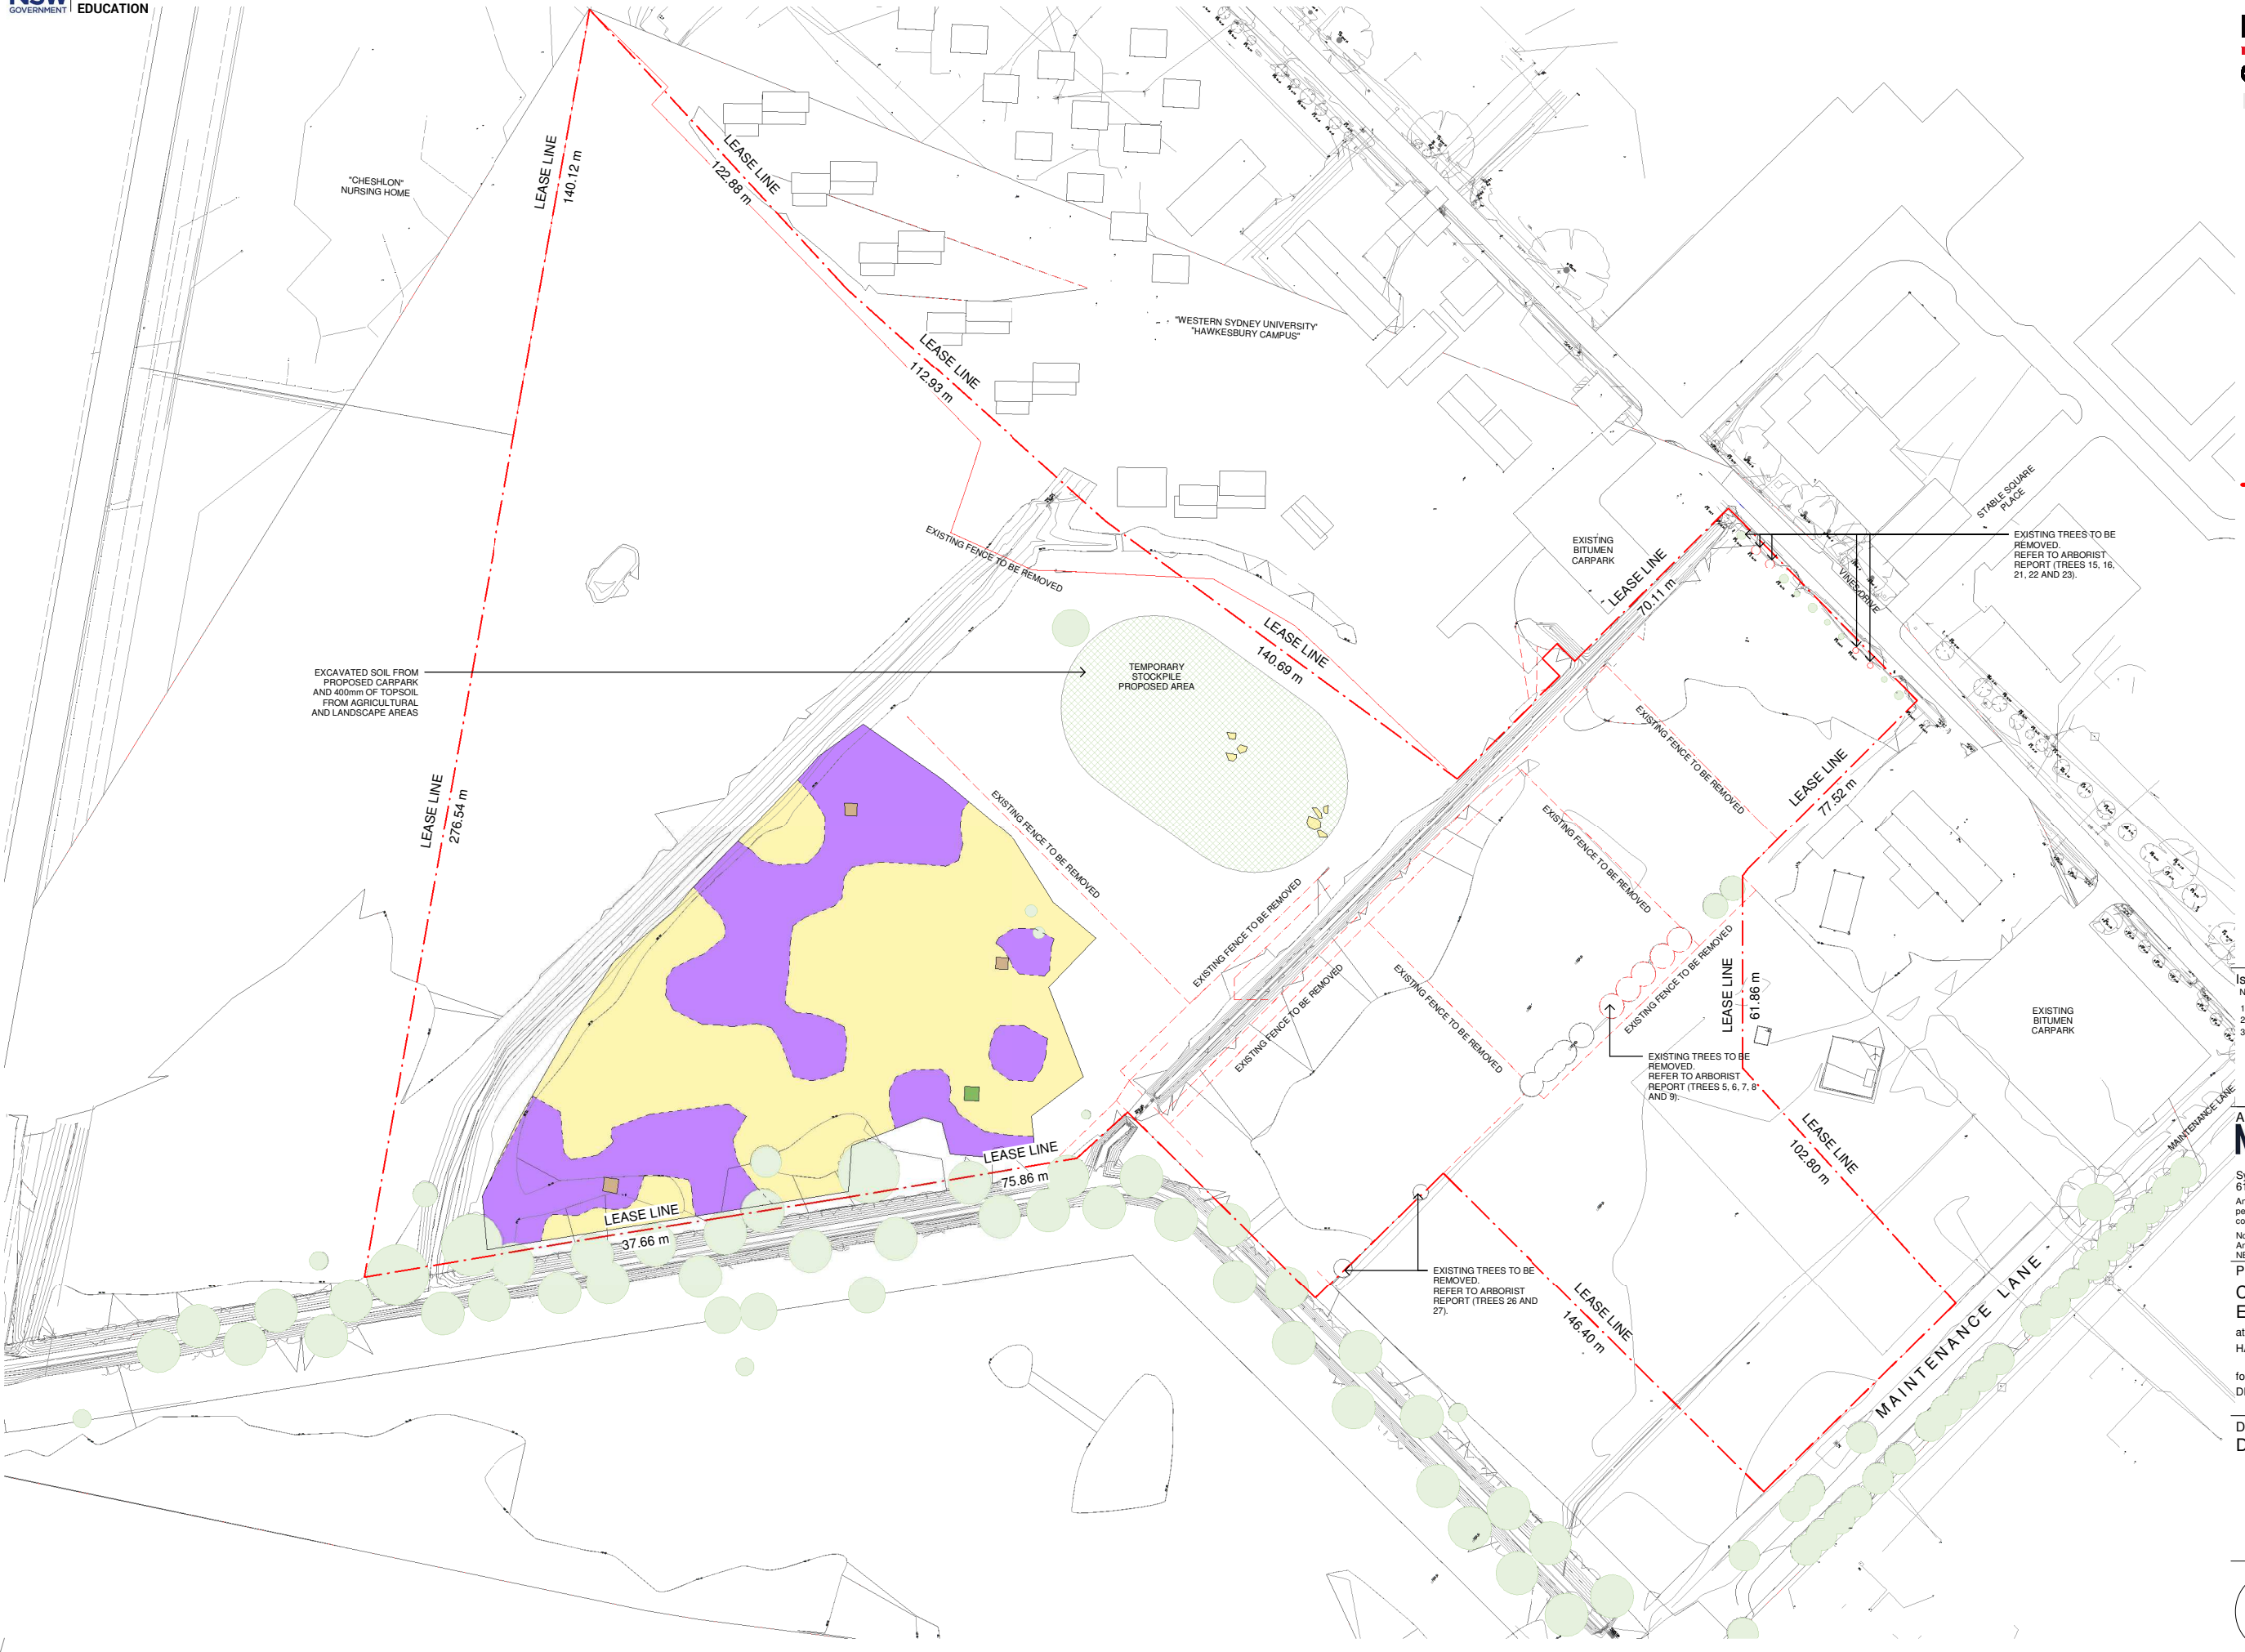

ISSUE No.	Date	Description	Chkd
1	09/04/2021	DRAFT EIS SCHEMATIC	SJF
2	28/04/2021	SSDA	SJF
3	28/06/2021	SSDA - REVISED	SJF

Architect
NBRARCHITECTURE.
Sydney
61 2 9922 2344
Any form of replication of this drawing in full or in part without the written permission of NBR+PARTNERS Pty Ltd constitutes an infringement of the copyright.
Nominated Architect:
Andrew Duffin NSW 5602
NBR & Partners Pty Ltd VIC 51197
© 2020
ABN 16 002 247 565
Project
Centre of Excellence in Agricultural Education
at
HAWKESBURY
for
DEPARTMENT OF EDUCATION

Drawing Title
Demolition Plan

PRELIMINARY

APPENDIX 3: TREE ASSESSMENT SCHEDULE

Tree Assessment Sheet																													
Location:		Centre of Excellence																											
Client:		NBRS Architecture																											
Date:		10.03.2021																											
Tree No.	Botanical Name / Common Name	Dimensions						Health				Vigour				Structure					Age Class					Landscape Significance	Retention Value SRIV	Comments	
		TPZ radius (m)	SRZ radius (m)	DBH (mm)	DAB (mm)	Height (m)	Spread EW (m)	Spread NS (m)	Deadwood	Dieback	Pests	Diseases	Canopy density %	Foliage size	Foliage colour	Extension growth	Inclusions	Fractures	Wounds	Cavities	Decay	Senescent	Mature	Semi Mature	Young				New planting
1	Casuarina glauca Swamp Sheoak	4.92	2.61	410	570	15	8	10	MIN	-	-	-	80	G	G	Y	-	-	-	-	-		M				M	MGVF9	Retain
2	Casuarina glauca Swamp Sheoak	6.00	2.73	500	630	15	8	7	Y				70									M					M	MGVF9	Co-dominant. Retain
3	Casuarina glauca Swamp Sheoak	3.60	2.25	300	400	15	6	6					70									M					M	MLVG5	Retain
4	Casuarina glauca Swamp Sheoak	3.96	2.30	330	420	15	7	7	Y		Y		70									M					M	MLVF4	Mistletoe. Retain
5	Casuarina glauca Swamp Sheoak	4.80	2.59	400	560	15	6	7					70									M					M	MGVF9	Remove
6	Casuarina glauca Swamp Sheoak	4.20	2.47	350	500	15							60									M					M	MLVG5	Remove
7	Casuarina glauca Swamp Sheoak	2.28	2.00	190	300	7	5	7	-	-	-	-	80										Y				M	YGVF8	Suppressed. Co-dominant. Remove
8	Casuarina glauca Swamp Sheoak	5.16	2.73	430	630	14																					M	MLVG5	Mistletoe. Remove
9	Casuarina glauca Swamp Sheoak	5.16	2.67	430	600		9	11	Y				50									M					M	MLVG5	Remove
10	Casuarina glauca Swamp Sheoak	5.04	2.63	420	580																						M	MGVF9	Retain
11	Casuarina glauca Swamp Sheoak	5.76	2.71	480	620																						M	MGVF9	Retain
12	Lagerstroemia indica Crepe Myrtle	0.90	1.26	75	100	L							90												Y		L	YGVG9	(S) Small: recently planted. 2m high. 30mm - 40mm diameter. YGVG9. Retain. (L) Large: 3m high. 50mm - 75mm diameter. 400L. YGVG9. Retain
13	Lagerstroemia indica Crepe Myrtle	0.90	1.26	75	100	L							90												Y		L	YGVG9	
14	Lagerstroemia indica Crepe Myrtle	0.48	1.11	40	75	S							90												Y		L	YGVG9	
15	Lagerstroemia indica Crepe Myrtle	0.48	1.11	40	75	S							90												Y		L	YGVG9	(L) Large: 3m high. 50mm - 75mm diameter. 400L. YGVG9. Remove or transplant
16	Lagerstroemia indica Crepe Myrtle	0.90	1.26	75	100	L							90												Y		L	YGVG9	(L) Large: 3m high. 50mm - 75mm diameter. 400L. YGVG9. Remove or transplant
16A	Lagerstroemia indica Crepe Myrtle	0.48	1.11	40	75	S							90												Y		L	YGVG9	(S) Small: recently planted. 2m high. 30mm - 40mm diameter. YGVG9. Retain. (L) Large: 3m high. 50mm - 75mm diameter. 400L. YGVG9. Retain
17	Lagerstroemia indica Crepe Myrtle	0.90	1.26	75	100	L							90												Y		L	YGVG9	
18	Lagerstroemia indica Crepe Myrtle	0.48	1.11	40	75	S							90												Y		L	YGVG9	

Tree Assessment Sheet																													
Location:		Centre of Excellence																											
Client:		NBRS Architecture																											
Date:		10.03.2021																											
Tree No.	Botanical Name / Common Name	Dimensions						Health			Vigour			Structure				Age Class					Landscape Significance	Retention Value SRV	Comments				
		TPZ radius (m)	SRZ radius (m)	DBH (mm)	DAB (mm)	Height (m)	Spread EW (m)	Spread NS (m)	Deadwood	Dieback	Pests	Diseases	Canopy density %	Foliage size	Foliage colour	Extension growth	Inclusions	Fractures	Wounds	Cavities	Decay	Senescent				Mature	Semi Mature	Young	New planting
19	<i>Lagerstroemia indica</i> Crepe Myrtle	0.48	1.11	40	75	S						90													Y		L	YGVG9	(S) Small: recently planted. 2m high. 30mm - 40mm diameter. YGVG9. Retain.
20	<i>Lagerstroemia indica</i> Crepe Myrtle	0.90	1.26	75	100	L						90													Y		L	YGVG9	(L) Large: 3m high. 50mm - 75mm diameter. 400L. YGVG9. Retain
21	<i>Lagerstroemia indica</i> Crepe Myrtle	0.90	1.26	75	100	L						90													Y		L	YGVG9	(L) Large: 3m high. 50mm - 75mm diameter. 400L. YGVG9. Remove or transplant
22	<i>Lagerstroemia indica</i> Crepe Myrtle	0.90	1.26	75	100	L						90													Y		L	YGVG9	(L) Large: 3m high. 50mm - 75mm diameter. 400L. YGVG9. Remove or transplant
23	<i>Lagerstroemia indica</i> Crepe Myrtle	0.90	1.26	75	100	L						90													Y		L	YGVG9	(L) Large: 3m high. 50mm - 75mm diameter. 400L. YGVG9. Remove or transplant
23A	<i>Lagerstroemia indica</i> Crepe Myrtle	0.90	1.26	75	100	L						90													Y		L	YGVG9	(L) Large: 3m high. 50mm - 75mm diameter. 400L. YGVG9. Retain
24	<i>Pyrus ussuriensis</i> Manchurian Pear	3.48	2.37	0.35	450	4	3	3	-	-	-	90	G	G	G												L	YGVP5	Multi-trunk
26	<i>Pyrus ussuriensis</i> Manchurian Pear	3.48	2.18	0.29	370	5	6	7	Y	-	-	80	G	G	G												L	OLVP0	Multi-trunk. Poor form. Remove
27	<i>Pyrus ussuriensis</i> Manchurian Pear	5.64	2.55	0.47	540	9	10	8	Y	-	-	80	G	G	Y	Y	Y					M					L	MGVP6	Multi-trunk. Remove

Legend

Tree to be retained and protected
Tree to be removed due to Construction
Tree to be removed due to other reason
Dead tree or weed species (exempt and can be removed without consent)

APPENDIX 4: ECOLOGICAL PLANS

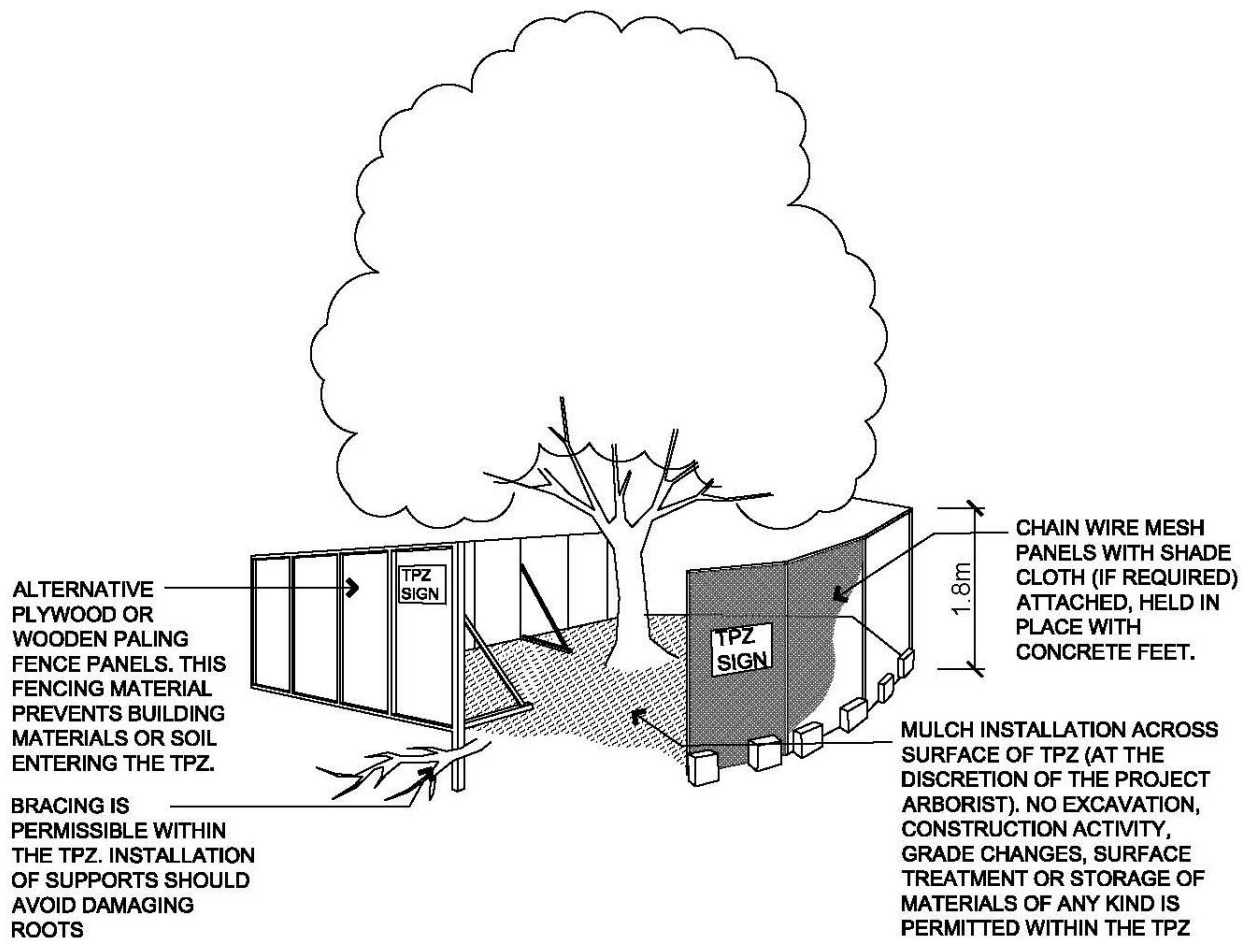


Figure 10. Narla field validated vegetation mapping and location of BAM plots within the Subject Land.



Figure 12. Management zones within the Subject Land.


APPENDIX 5: TYPICAL TREE PROTECTION DETAILS



PROTECTIVE FENCING

Based on AS4970-2009

NOT TO SCALE

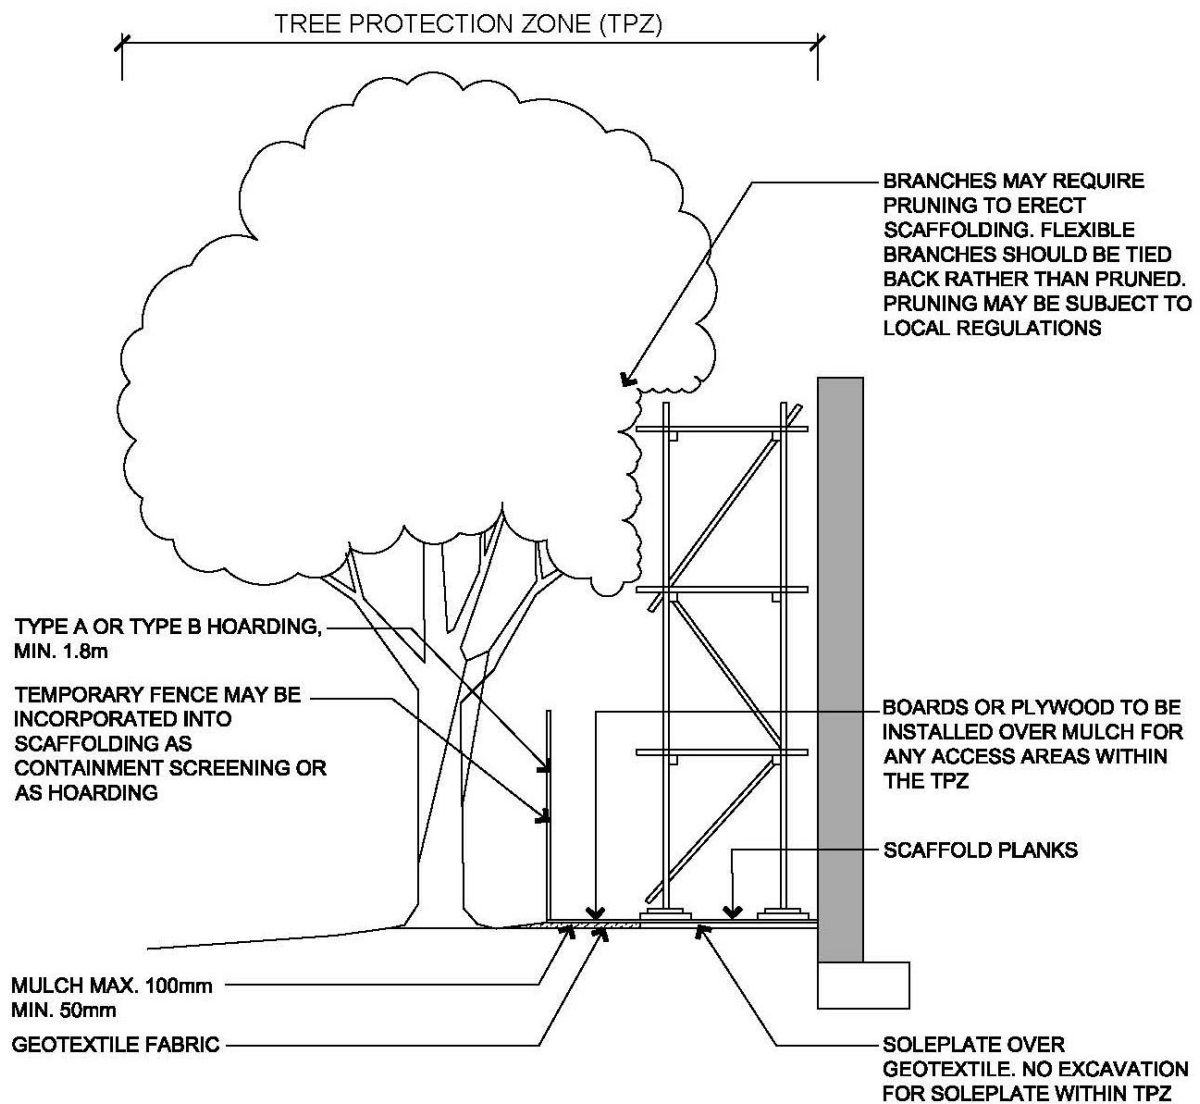


NOTE: Excavation required for the insertion of support posts for tree protection fencing should not involve the severance of any roots greater than 20mm in diameter, without the prior approval of the project arborist.

INDICATIVE SCAFFOLDING WITHIN A TPZ

Based on AS4970-2009

NOT TO SCALE

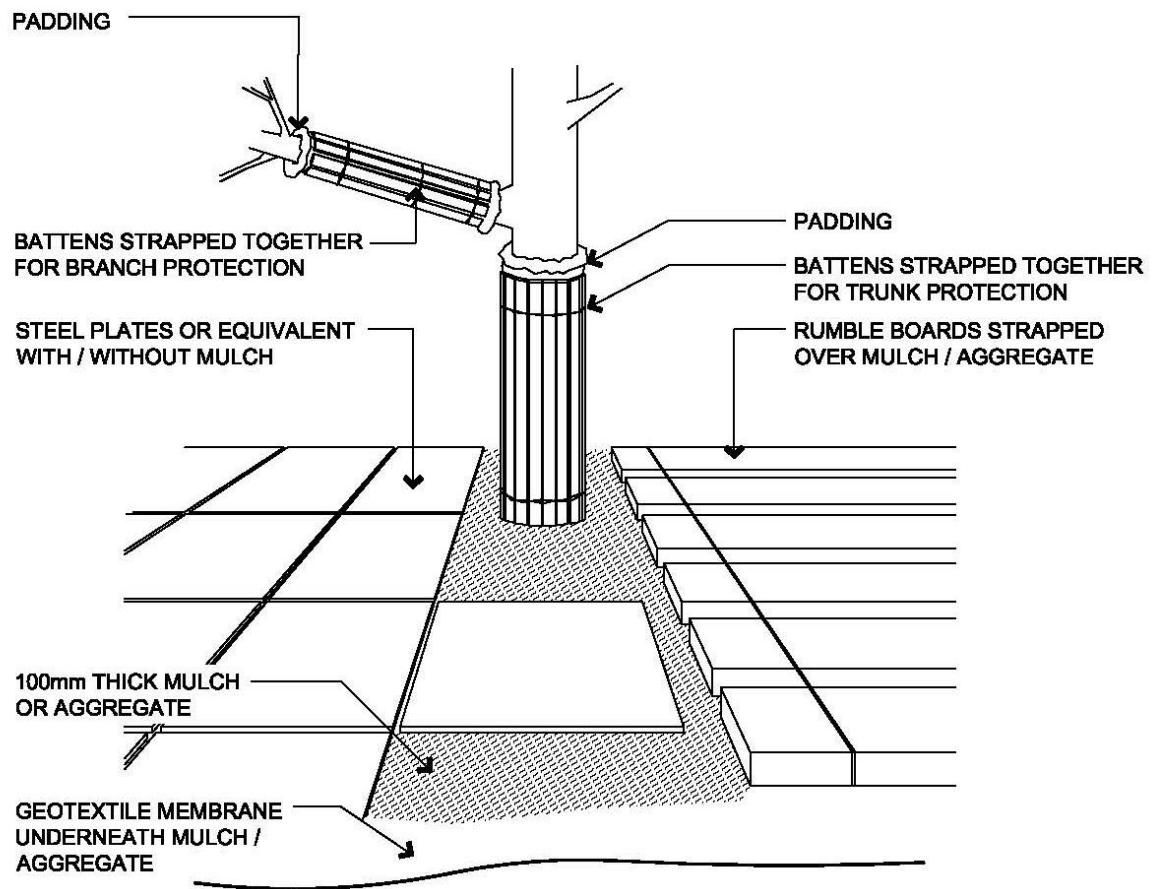

NOTE:

1. For trunk and branch protection use boards and padding that will prevent damage to bark. Boards are to be strapped to trees, not nailed or screwed.
2. Rumble boards should be of a suitable thickness to prevent soil compaction and root damage.

EXAMPLES OF TRUNK, BRANCH AND GROUND PROTECTION

Based on AS4970-2009

NOT TO SCALE



TREE PROTECTION ZONE SIGN

Based on AS4970-2009

NOT TO SCALE